

ERDC/GSL TR-03-7

Geotechnical and Structures
Laboratory



**US Army Corps
of Engineers®**
Engineer Research and
Development Center

Enhanced Coastal Trafficability: Road Construction Over Sandy Soils

Rosa L. Santoni

July 2003

20030822 106

Enhanced Coastal Trafficability: Road Construction Over Sandy Soils

Rosa L. Santoni

*Geotechnical and Structures Laboratory
U.S. Army Engineer Research and Development Center
3909 Halls Ferry Road
Vicksburg, MS 39180-6199*

Final report

Approved for public release; distribution is unlimited

ABSTRACT: This report describes field experiments conducted using Multi-Purpose (MP) mats, hexagonal plastic mats (Allround and Special), and sand-geofiber stabilization for expedient road construction over sandy soils. Field sections were constructed and trafficked to evaluate construction procedures, design parameters, and their performance over loose sand conditions. Experiment items were trafficked with 500 passes of a 41,600-lb, 5-ton military truck. Field experiment results indicated that MP mats and sand-geofiber stabilization are capable of providing structural support to military traffic over sandy soil conditions on straight and curved sections. The Allround and Special hexagonal plastic mats are capable of withstanding limited traffic, but they are unsuitable for supporting substantial amounts of military traffic on curved sections over the very loose sand conditions used in this experiment.

DISCLAIMER: The contents of this report are not to be used for advertising, publication, or promotional purposes. Citation of trade names does not constitute an official endorsement or approval of the use of such commercial products. All product names and trademarks cited are the property of their respective owners. The findings of this report are not to be construed as an official Department of the Army position unless so designated by other authorized documents.

Contents

Executive Summary	v
Conversion Factors, Non-SI to SI Units of Measurement.....	vii
Preface.....	viii
1—Introduction	1
Background.....	1
Objective.....	2
Scope.....	2
2—Materials	3
Unreinforced Sand	3
Geofiber-Reinforced Sand System	3
Mat Systems.....	4
Multi-Purpose (MP) mat	4
Hexagonal plastic mat	7
3—Field Experiments.....	9
Experiment Design	9
Description	9
Materials.....	9
Construction.....	10
General	10
Description	10
Construction	11
Behavior of Experimental Items Under Traffic	14
Traffic.....	14
Failure criteria	15
Maintenance	15
Rut depth measurements	15
Moisture and density measurements	16
Dynamic cone penetrometer (DCP) measurements.....	16
Cross section measurements.....	17
4—Analysis of Field Experiment.....	19
Material Performance.....	19
Post traffic condition	19
Item 1: Multi-Purpose Mats	19
Item 2: Hexagonal Plastic Mats.....	20

Item 3: Sand-Geofiber Stabilized Sections.....	21
Field Data.....	21
Installation Rates.....	21
5—Conclusions and Recommendations.....	23
Conclusions.....	23
Recommendations.....	24
References	25
Figures 1-29	
Photos 1-94	
SF 298	

List of Tables

Table 1.	Sand Properties.....	3
Table 2.	Properties of the Aluminum Connector Pin and Anchors	6
Table 3.	MP Mat and Pin Connector Results (Modified ASTM Tests)	8
Table 4.	MP Mat and Pin Connector Results (ASTM Tests)	8
Table 5.	Summary of the Rut Depth Measurements	16
Table 6.	Summary of Moisture and Density Measurements	17
Table 7.	DCP Results Summary for the Full-Scaled Field Test Section.....	17
Table 8.	Permanent Deformation Measurement for the Full-Scaled Field Test Section	18
Table 9.	Performance Summary	20

Executive Summary

This report describes an investigation designed to evaluate various expedient road construction techniques over sandy soils under full-scaled test traffic. The investigation was conducted at the U.S. Army Engineer Research and Development Center (ERDC), Vicksburg, MS, during June through December 2001. The objectives of this investigation were to (a) evaluate the performance of the multi-purpose (MP) mat, hexagonal plastic mat, and sand-geofiber stabilization on curved sections; (b) determine the construction procedures and construction rates for each system; and (c) prepare expedient road construction guidelines that will support military operations such as the Joint-Logistics-Over-The-Shore (JLOTS). Traffic was applied to the mat sections and the sand-geofiber section with a 5-ton military truck loaded to a 41,600-lb gross vehicle weight.¹ The wheeled military traffic testing was conducted to evaluate the potential of each mat section and sand-geofiber section as an expedient road when placed over sandy subgrades. An analysis of the field data was conducted to determine the potential of these expedient pavements under actual loading conditions. A summary of each material investigated and its performance is presented in this report.

The results and observations of the field experiment revealed the following:

- a. The control experiment indicated immobilization of the test vehicle after 25 passes when the loose sand was trafficked without any reinforcement or surfacing.
- b. Sand-geofiber stabilization is adequate for straight and curved roadway sections. The 50-ft and 75-ft radius curved sand-geofiber sections were adequate to sustain 500 military truck passes over a 16-in. layer of loose sand.
- c. The selected fiber content of 0.8 percent per dry weight of sand provided adequate support under the applied traffic.
- d. The 8-in. stabilized sand layer provided adequate support for 500 passes of the 5-ton military truck.
- e. Overall, the Allround hexagonal plastic mats provided poor load support for the 5-ton truck traffic and extremely poor load support in the 50-ft radius curved section.

¹ A table for converting non-SI units of measurement to SI units is presented on page vii.

- f.* The Special hexagonal plastic mats provided adequate support for 500 passes of a 5-ton military truck in a straight section of the roadway, but the mats disconnected at the centerline of the lane and at the upheaval areas creating unstable structural support in the wheel paths after 500 passes.
- g.* The MP mats are adequate for straight and curved roadway sections. A 50-ft radius section provided adequate structural support to sustain 500 passes of the 5-ton military truck.
- h.* The aluminum connector pins withstood flexures of the mat in excess of 3 in. The alignment tools were useful to align the mat holes and to install the connector pins. The anchors helped to stabilize the mats during turning maneuvers.
- i.* The MP mats, hexagonal plastic mats, and sand-geofiber stabilized technologies were confirmed as adequate alternatives to traditional road construction technologies for sand subgrades. These technologies were exposed to heavy rains, humidity, winds, and high and low temperatures for a period of 6 months. They were durable and low maintenance.
- j.* For the MP mat item, the installation rate was 253 ft² per man-hour. The installation time for the Allround hexagonal plastic mat was 585 ft² per man-hour. The installation rate for the Special hexagonal plastic mat was 786 ft² per man-hour. The installation rate for the sand-geofiber item was 209 ft² per man-hour.

Detailed information concerning the MP mat, hexagonal plastic mat, and geofiber sections is presented in this report. Chapter 1 consists of an introduction including background related to the research. Detailed material information is provided in Chapter 2 of this report. Chapter 3 presents the field experiments and their results. Chapter 4 presents an analysis based on performance under traffic. Finally, conclusions and recommendations are presented in Chapter 5.

Conversion Factors, Non-SI to SI Units of Measurement

Non-SI units of measurement used in this report can be converted to SI units as follows:

Multiply	By	To Obtain
angle (degree)	0.01745329	radians
cubic feet	0.02832	cubic meters
feet	0.3048	meters
gallons	3.785	liters
gallons per square yard	4.5273149	liters per square meter
inches	2.54	centimeters
kilosecond-feet	28.32	cubic meters per second
kip, (1,000 lb)	0.4535924	1,000 kilograms
miles	1.609347	kilometer
ounces	0.02957353	liters
pounds (force) per square inch	6.894757×10^{-3}	megaPascals
pounds (force) per square foot	47.88026	Pascals
pounds (mass)	0.4535924	kilograms
pounds (mass) per cubic foot	0.157	kilonewtons per cubic meter
square feet	0.09290	square meters
square inches	6.4516×10^{-4}	square meters
square meters	2.59	square kilometers
square yards	0.8361	square meters
tons	907.1	kilograms

Preface

The investigation described in this report was sponsored by Headquarters, U.S. Army Corps of Engineers, under the project: DT08, "Enhanced Coastal Trafficability/Sea State Mitigation ATD." The Army technical monitor was Dr. Paul Mlakar.

This publication was prepared by the U.S. Army Engineer Research and Development Center (ERDC), Geotechnical and Structures Laboratory (GSL), Vicksburg, MS, based upon experiments conducted during the period June through December 2001. Staff members actively engaged in the planning and implementation of the investigation were Ms. Rosa L. Santoni, Messrs. Carroll J. Smith, Jeb S. Tingle, Steve L. Webster, Travis Mann, Patrick McCaffrey, Timothy McCaffrey, and Louis W. Mason, Airfields and Pavements Branch (APB), GSL. Technical assistance was also provided by Messrs. Dennis J. Beausoliel, Timothy Conrad, and Charles Wilson, Directorate of Public Works. This publication was prepared by Ms. Santoni under the general supervision of Dr. David W. Pittman, Acting Director, GSL, and under the direct supervision of Dr. Albert J. Bush III, Chief, Engineering Systems and Materials Division, and Mr. Don R. Alexander, Chief, APB.

Commander and Executive Director of ERDC was COL James R. Rowan, EN. Dr. James R. Houston was Director.

1 Introduction

Background

A Logistics-Over-The-Shore (LOTS) operation is the process of discharging cargo from vessels anchored off-shore or in-the-stream, transporting it to the shore and/or pier, and marshalling it for movement inland (Joint Tactics, Techniques, and Procedures for Joint Logistics Over-the-Shore, Joint Pub 4-01.6). LOTS operations are conducted over unimproved shorelines, through fixed ports not accessible to deep-draft shipping, and through fixed ports that are inadequate without using LOTS capabilities. Joint-Logistics-Over-the-Shore (JLOTS) operations are defined as operations in which Navy and Army forces conduct LOTS operations together under a joint force commander. These exercises test and evaluate the capabilities of the services to deliver logistics support from ships to forces ashore in areas where there are no usable port facilities or transportation infrastructure. Frequently, the unimproved shorelines and inland soils do not possess adequate strength to support trafficability of heavy military vehicle and equipment.

Poor soil conditions can delay military operations due to reduced mobility or immobilization of vehicles and/or equipment. Excessive fuel and maintenance costs can also be expected when poor soil conditions are encountered. The U.S. Army Engineer Research and Development Center (ERDC) has been developing expedient road systems to overcome poor soil conditions encountered along shorelines since the 1960s. ERDC developed aluminum and steel mats for military airfields. These mats were classified as a light-duty steel mat, a medium-duty aluminum mat, and a heavy-duty truss web aluminum mat. They were developed to withstand various types of aircraft operations on a 4-CBR subgrade. Mo-Mat, M8A1 steel mat, and Uni-Mat were also used to construct expedient roads in sandy soil conditions. These systems are no longer available on the commercial market; only limited supplies of these mats exist in inventory. These mats designs have significant limitations such as poor transportability, extremely bulky and heavy, and require significant maintenance when used in curved roadway sections.

In October 1995, ERDC advertised request for proposals (RFP) in the Commerce Business Daily for lightweight surfacing to satisfy aircraft and truck load requirements. Six companies responded to the RFP and after evaluations, the ERDC purchased test mat quantities from four of the companies. Limited field evaluations of the four mats revealed that all mats were not capable of sustained aircraft traffic. However, the fiberglass mats demonstrated significant

potential for supporting military truck traffic in evaluations conducted during 1997. This original mat evaluation also showed poor installation characteristics. Consequently, ERDC researchers developed a new mat configuration and pin connector using the same material as reported in TR GL-98-10. The hexagonal plastic mats also demonstrated significant potential for supporting military truck traffic.

Therefore, ERDC was tasked to develop new expedient road systems to overcome poor sandy soil conditions with a reduced logistics footprint (i.e., less volume and weight). Sand-geofiber stabilization, multi-purpose mat (fiberglass mat), and hexagonal plastic mat are three new expedient road systems evaluated by ERDC. These systems are light, easy to install, and have low logistics requirements.

Objective

The objective of this investigation was to evaluate sand-geofiber stabilization, multi-purpose (MP) mat, and hexagonal plastic mat as expedient road system over loose sand.

Scope

The objective of this investigation was accomplished by the construction and testing of a specially designed test section as described herein. The test road that contained three test items composed of each system was subjected to accelerated traffic of a 5-ton military truck. This report describes the materials used in the test section, construction techniques, and behavior of each material under traffic. A summary of findings and recommendations is also presented.

2 Materials

The materials used in the experiment were divided into three categories: unreinforced sand, geofiber-reinforced sand, and mat systems. Properties of each material are provided in the text and complemented with tables.

Unreinforced Sand

The sand used for the experiment was a sand local to Vicksburg, MS, normally used as fine aggregate in concrete. The sand was a pit-run washed sand containing approximately 4 percent gravel sizes and 2 percent minus No. 200 U.S. standard sieve size material. It was classified as a poorly graded (SP) sand, American Society for Testing and Materials (ASTM) D 2487 (ASTM 1992). Additional material properties for the sand are provided in Table 1 (dry unit weights were determined according to ASTM D 4253 (ASTM 1993)).

Table 1 Sand Properties	
Property	Value
Specific gravity	2.65
Laboratory maximum, dry unit weight, lb/ft ³	117.70
Laboratory minimum, dry unit weight, lb/ft ³	98.20
Coefficient of uniformity, C_u	2.00
Coefficient of curvature, C_c	1.23
Plasticity index	Nonplastic
Percent finer than no. 200 sieve	2.00
Grain size	Medium
Mean diameter, D_{50} (in.)	0.02
Fineness modulus	2.31

Geofiber-Reinforced Sand System

Geofiber. The sand described previously was reinforced with hair-like 2-in.-long monofilament geofibers at a rate of 0.8 percent by dry weight of sand. The geofibers were mixed into moist sand using a self-propelled rotary mixer. These 2-in. polypropylene geofibers have a specific gravity of 0.91 lb/ft, a tensile strength of 75,000 psi, and a Young's modulus of 500,000 psi. The 20-denier monofilament geofibers were used in this investigation. A denier is the mass in

grams of a 27,528-ft length of a geofiber, and it is used as a measure of fineness as developed by the textile industry. The sand-geofiber mix can withstand an unconfined compressive strength of 21 to 27 psi for a 0.5- and 1-in. deformation, respectively. The cost of the fiber is \$1.60 per pound (Tingle et al. 1999 and Webster and Santoni 1997).

Road Oyl. Road Oyl was used to stabilize the wearing surface. Road Oyl is a resin-modified emulsion that is nonwater soluble and has a high bonding strength. It was developed specifically for use in pavement applications, dust control treatment, soil stabilization, and erosion control. It contains selected fractions of natural tree resins combined with a strong bonding agent. It can be field mixed with premoistened materials or diluted with water and sprayed on for surface penetration. It is petroleum-free and can be cold-applied. The boiling, freezing, and flash points of the Road Oyl are 212°F, 33°F, and 400°F, respectively. Road Oyl is environmentally friendly and available for bulk shipments, 55-gal drums, and 275-gal pelletized bulk container packaging. The Road Oyl used in the field experiments was purchased in 55-gal drums for \$4.20 per gallon. The bulk price was approximately \$1.79 per gallon plus \$2.00 per mile per 6,000-gal truck load.

Mat Systems

Two mats were selected for this study based on a literature review and recent studies conducted at ERDC (Santoni et al. 2001 and Tingle and Webster 1998). These mat systems are described below.

Multi-Purpose (MP) mat

Description. The MP mat dimensions are 6 ft, 8 in. by 6 ft, 8 in. by approximately 0.35 in. thick (Figure 1). Each MP mat panel has a flat surface area with downward fold sides on two panel edges. The downward fold sides provide a bottom ledge for connecting with adjacent mat panels. Each panel edge contains three rectangular holes for connecting adjacent panels. The holes on the upper panel edges are slightly larger than the connector holes on the downward fold edges. Figure 2 illustrates the top and bottom rectangular hole dimensions. The mat surface has a skid resistant texture defined by the woven roving weave pattern of the top ply of fiberglass material, which is not smoothed over by the use of excess resin. The usable surface area when installed is approximately 36 ft². The weight of a panel is approximately 115 lb with a unit weight of 2.59 lb/ft². The cost for each MP mat panel is \$320. The MP mat was fabricated by GFI, Inc., Harrison, AR (www.GFIinc.us). The geometric configuration of the mat was designed by ERDC to optimize structural performance, installation rate, and deployability. The MP mat has a pending patent.

Materials. The mat is constructed of fiberglass-reinforced polyester composite. It consists of a polyester resin reinforced with four plies of woven chopped fiberglass (GFI 1996). The resin is known as CoRezyn 105-58, and it is both corrosion and chemical resistant. This resin meets the requirements of the Navy Military Specification MIL-R-21607. The resin is a low-pressure

thermosetting polyester, laminating type, which contains a styrene suppressant that will not adversely affect secondary bonding or environmental stability of the mat. Ultra-violet (UV) inhibitors are added for product protection. The polyester resin-to-fiberglass ratio is approximately 11:9 by weight.

The fiberglass reinforcement is a fiberglass fabric mat reinforcement composite type E (Navy Military Specification MIL-M-43248). This composite is made of a plain-weave pattern of roving bonded to a chopped fiberglass mat. One ply is defined as the combination of the woven roving bonded to the chopped fiber layer. The woven roving is constructed by weaving, in a plain wave, 113 linear yards per pound fiberglass roving into a pattern consisting of four roving per inch in the warp by two roving per inch in the fill directions, respectively. The woven roving consists of continuous filament yarns and has an average weight of 40.8 ± 2.4 ounces per square yard. The chopped fiber layer consists of randomly oriented fibers of 1.5 to 2.5 in. long. The fibers are designed as type K fibers with an average diameter of 0.00051 in., or type H fibers having an average diameter of 0.0004 in. The chopped fiber weighs 2.0 ± 0.2 ounces per square foot (GFI 1996).

Aluminum drop-in pin connectors. The MP mat panels are connected together by using aluminum pin connectors (Figure 3). These connectors were designed at ERDC. The pin connector is comprised of top and bottom aluminum plates along with a hexagonal button head cap screw with an internal tooth washer (Figures 4 and 5). The cap screw is recessed into the top pin connector plate and the edges of the top plate are rounded to present a low pin connector profile on the surface of the connected mat panels (Figures 3 and 5). A service removable medium strength thread locker (Loctite® type 242) was applied to the cap screw threads before assembly with the bottom plate. The thread locker provides sufficient strength for the bottom plate to rotate 90 degrees below the bottom mat panel (Figures 3 and 5).

A cam on the bottom pin plate stops rotation of the bottom plate at 90 degrees to the holes in the mat panels. The rotated bottom plate below the bottom mat panel then allows the pin connector to be tightened and lock the two mat panels together. During tightening, the thread locker breaks under medium torque to allow the cap screw to be fully tightened. During disassembly, the thread locker again breaks under moderate torque allowing the cap screw to be loosened. As the pin is loosened, the thread locker retains sufficient locking strength to force the bottom plate to rotate back 90 degrees. After rotating 90 degrees, the cam on the bottom pin plate stops the rotation to align the bottom plate with holes in the mat panels. The aluminum drop-in pin connectors are then removed.

The drop-in pin connectors were fabricated with aluminum type 6061-T6. Table 2 shows the aluminum mechanical properties and its chemical analysis. The pin connectors were fabricated using 868-lb extruded QQ A 200/8 aluminum bars. These bars have a rectangular cross section and are 12 ft long.

Anchoring system. The MP mat item was anchored using a multi purpose Duckbill anchor system to prevent excessive movement caused by shear and centrifugal forces acting on curved sections. The anchor was driven into the ground using a hammer and a steel drive rod. The Duckbill anchor worked as a toggle bolt when rotate in undisturbed soil (Figure 6). For this investigation, the selected model was the 68-DB1. The anchor's manufacturer provided the engineering properties (www.earthanchor.com). The anchor holding power in normal soil is 1,100 lb. The wire rope breaking strength is 1,700 lb, and its length is 2.5 ft. The anchor weight is 4.5 ounces. The steel drive rod diameter is 0.5 in. The anchor's material properties are as follows: casting method - die cast, aluminum alloy - k-9, tensile yield strength - 20,700 psi, ultimate tensile strength - 26,500 psi, and elongation - 3.5 percent. Anchors were shipped in boxes of twenty-four with a total weight of 2 lb per box. Basic dimensions of the anchor and steel drive rod are shown in Figures 7 and 8, respectively. A total of 960 anchors and 2 steel drive rods were purchased for this experiment. The cost of the anchor and driven steel rod was \$4.40 and \$28.50, respectively.

Table 2	
Properties of the Aluminum Connector Pin and Anchors	
Mechanical Property	Value
Aluminum Connector Pin	
Yield Stress, ksi	40.4
Ultimate Tensile Stress, ksi	43.4
Percent of Elongation	98.2
Anchor	
Casting Method	Die cast
Aluminum alloy	k-9
Tensile Yield Strength, psi	20700
Ultimate Tensile Strength, psi	26500
Elongation, percent	3.5
Steel Drive Rod	
Production Method	Cold formed
Tensile Yield Strength, psi	85000
Ultimate Tensile Strength, psi	74000
Elongation, percent	18

Laboratory tests. The MP mat samples and pin connectors were tested to determine their performance under both compression and tension loads. Samples of an MP mat were taken from a panel that was part of the 350 panels purchased for the field test. Figure 9 shows the samples' location on the MP mat panel. Different sample sizes as well as downward fold samples were tested. The aluminum drop-in pin connectors used during these laboratory tests were fabricated at ERDC. The 3-point beam test was used to evaluate the load carrying capacity of the mat and pin connector under compressive loads. A direct tension test was used to determine the mat and pin connector performance under tensile load. The flexural strength was evaluated to determine if a difference in the 9-in. and 6-in. spans would make a difference in the flexural strength (ASTM D 6272). The tensile strength test was used to determine the ultimate tensile strength according to ASTM D 3039. Figure 10 and Photos 1 through 6 show the test set up. Tables 3 and 4 show the test results. The beam

and tension tests were conducted using an Instron® 4208 testing system. The Instron® system consists of the test loading instrument and a computer for load-time recording of results. The load was applied to each MP mat samples at a constant crosshead rate of 0.25 in. per minute. Results were recorded every 0.02 in.

The results showed that the MP mat was stronger in the traffic direction (Figure 9 and 19) or suggested placement. The MP mat connection area was the weakest area of the mat. The MP mat downward fold sides were weaker than the center section of the mat. The aluminum pin connector performed excellent during the tests. Finally, the results were directly proportional to the sample size and span. The larger MP mat samples and span provided higher load.

Hexagonal plastic mat

Description. This mat was produced by UmTech - Ecological Technology Company, Inc., Munich, Germany. Test panels were purchased from the U.S. distributor, Grid Tech of Newport, Rhode Island. These lightweight interlocking mat panels were designed for quick installation to create parking areas and access roadways. The panels are ultraviolet (UV) stable and made from recycled HDPE.

Each panel weighs 7.05 lb and has a surface area of approximately 2.9 sq ft, resulting in a unit weight of 2.43 psf. The factory recommended maximum wheel load is 13,000 lb per panel when installed over a gravel base. The hexagonal form permits road angles of 30, 60, and 90 degrees to be created. The cost of test quantities of the mat was \$7.25 per sq ft.

Two types of the hexagonal plastic mats were used in this field experiment: Allround and Special. The Allround hexagonal plastic mat is shown in Photos 7 and 8. The Special hexagonal plastic mat is shown in Photos 9 and 10. Both mats can support 13,000 lb per panel. Both mats have skid resistance texture to improve tire traction. The Allround mat has handles that ease its installation (Photo 11). The Allround and Special mats have 12 and 18 reinforcement ribs, respectively (Photo 12).

Table 3 MP Mat and Pin Connector Results (Modified ASTM Tests)				
Sample No.	Span (in.)	Width (in.)	Load (lb)	Deflection (in.)
3-Point Beam Connector Test				
A-A'	9	4	1,372	0.629
B-B'	9	4	1,084	0.589
3-Point Beam Test				
1	9	4	1,712	0.602
2	9	4	2,125	0.699
3	9	4	2,213	0.884
Direct Tension Connector Test				
T1-T1'	9	4	5,133	0.662
T2-T2'	9	4	7,487	0.954
Direct Tension Test				
TM2	9	4	25,520	0.553
TM3	9	4	37,450	0.541
TM4	9	4	35,890	0.551

Table 4 MP Mat and Pin Connector Results (ASTM Tests)						
Sample No. ¹	Span (in.)	Width (in.)	Depth (in.)	Load (lb)	Deflection (in.)	Strength (psi)
Beam Test (9 in. span)²						
A1	9	2.00	0.375	1,182	0.739	37,824
A2	9	2.00	0.385	1,421	0.873	43,140
A3	9	1.90	0.383	1,514	0.888	48,890
B1	9	1.98	0.365	478	0.483	16,310
B2	9	1.98	0.360	1,020	1.070	35,710
B3	9	1.95	0.366	409	0.410	14,090
Beam Test (6 in. span)²						
A5	6	1.375	0.360	970	0.273	32,660
A6	6	1.375	0.370	1,024	0.285	32,640
A7	6	1.374	0.360	1,073	0.309	36,150
B5	6	1.375	0.345	475	0.217	17,410
B6	6	1.375	0.345	960	0.418	33,620
B7	6	1.375	0.353	743	0.364	26,470
B8	6	1.375	0.350	982	0.479	35,020
Tensile Strength Test³						
T1	--	1.10	0.343	9,555	0.331	25,330
T2	--	1.01	0.345	9,635	0.327	27,650
T3	--	1.00	0.350	9,735	0.338	27,810
S1	--	1.00	0.370	6,388	0.389	17,270
S2	--	0.99	0.375	7,973	0.319	21,480
S3	--	0.99	0.365	6,568	0.355	18,180
¹ A1 and A3 (downward fold) and A2, and A4 (center) – 2 in. x 12 in. samples. A5 and A7 (downward fold) and A7 (center) – 1 3/8 in. x 12 in. samples. B1 and B3 (downward fold) and B2 and B4 (center) – 2 in. x 12 in. samples. B5 and B7 (downward fold) and B6 and B8 (center) – 1 3/8 in. x 12 in. samples. T1 and T3 (downward fold) and T2 (center) – 1 in. x 12 in. samples. S1 and S3 (downward fold) and S2 (center) – 1 in. x 12 in. samples. ² ASTM D6272. ³ ASTM D3039.						

3 Field Experiments

Experiment Design

Description

The field experiment for this investigation was conducted in an outdoor environment on the ERDC reservation. The site of the experiment was located on the northeast end of Brown's Lake within a dredge fill containment area, which is encircled by a gravel-surfaced road (Susquehanna Circle). Plan and profile drawings of the loose sand experiment site are shown in Figures 11 and 12, respectively. Item 1 was constructed using the MP mats, Item 2 was constructed using the hexagonal plastic mats (Allround and Special), and Item 3 was constructed using sand-geofiber stabilization. The experiments were designed to evaluate the load-carrying capabilities of the various expedient roadway systems under military truck traffic when installed as roadway sections over the sandy soils. Construction procedures and design parameters were also validated. The road sections were designed for single-lane traffic.

Materials

The subgrade for this experiment was the poorly-graded loose sand (SP) described in Chapter 2. The loose sand was the subgrade underlain by the dredged material that was composed of soils dredged from Brown's Lake and dumped in the fill containment area. These dredged soils have been contained in this area since the 1980's. Local soils in the Vicksburg, MS, area are loess deposits, and subgrade sediments in the containment are classified as a low-plasticity silt (ML). Classification data for the subgrade material are shown in Figure 13. The mats, unreinforced sand, and geofibers used in the experiment are those described in Chapter 2. All materials except the connecting pins for the Multi-Purpose mats were commercially available products. The connector pins were under development at the time of the experiment and were fabricated according to ERDC specifications.

Construction

General

The test section was constructed and evaluated during the period June through December 2001. All construction work was accomplished by ERDC personnel using conventional construction equipment. Items 1 through 3 were arranged in an oval configuration so continuous truck traffic could be applied over the items. The existing dredge material (ML soil) had an average CBR of 9 percent. The existing material was not disturbed, but two sections at the edge of the gravel-surfaced road were cut to fit the oval section with the boundary conditions (Photos 13 and 14). At the outside and inside edge of shoulders, flags and strings lines were placed. The flags were placed every 5 ft. Over the existing dredge material, 12- to 28-in. sand layer was delivered by dump truck and leveled with a D4 bulldozer (Photos 15 through 17). The difference in the sand layer thickness was to overcome the irregular topographic ground contour (Figure 14). To replicate the loose conditions of beach sand, the 36-ft- wide sandy base course layer was not compacted. Two pipes were placed in the sandy base's toe so that the water level could flow naturally within all experiment areas (Photos 18 and 19). An aerial view of the experiment site prior to items installation is shown in Photo 20. Figure 14 shows the elevations and field test section location. The roadway's loose sand condition was demonstrated by a 5-ton military truck loaded to 41,600 lb becoming immobilized after 25 passes. Photos 21 and 22 show the 10-in. rut depth after 25 passes of the 5-ton military truck.

Description

Multi-Purpose mat (Item 1). Item 1 was constructed using the MP mats. It was divided into two sections consisting of a straight section and a 50-ft radius curved section (Figures 11 and 12). A total of 146 MP mats and 510 connector pins were used for this item. The connector pins used for Item 1 were assembled prior to construction as shown in Photos 23 and 24. Figure 16 shows the pin assembly procedure. A 0.25-in. gap between the pin top and bottom plates was set using the spacer guide tool (Figure 17). An MP mat access ramp was installed as a patch and then connected to the main Item 1 sections (Photo 25). The MP mat ramp was 24-ft wide by 42-ft long. A ramp was constructed to provide access to the three items (Photo 27). Item 1's straight section was approximately 54 ft long and 24 ft wide (Photo 26). Item 1's 50-ft radius curve section had an inside radius of 50 ft and an outside radius of 74 ft (Photo 27). The section width was 24 ft. A plan and profile of the sections are shown in Figures 11 and 12, respectively.

Hexagonal plastic mat (Item 2). Item 2 was constructed using two types of hexagonal plastic mats. The hexagonal plastic mat properties were described in Chapter 2. Item 2 was divided into two sections consisting of the Allround and Special hexagonal plastic mat sections (Figure 15). The Allround section had an inside radius of 50 ft and an outside radius of 74 ft (Photo 28). This section was approximately 24 ft wide. A plan and profile are shown in Figures 11 and 12.

The Special section was a straight section, and it was approximately 50 ft long by 24 ft wide (Photo 29).

Sand-geofiber stabilization (Item 3). Item 3 was constructed using the geofiber stabilization technique. The geofiber and sand properties were described in Chapter 2. Item 3 was divided into three sections: a 75-ft radius curved section, a 50-ft radius curved section, and a straight section (Figure 15). The two curved sections were approximately 24 ft wide (Photos 30 and 31). The straight section was approximately 25 ft long by 24 ft wide (Photo 32). Plan and profile drawings of Item 3 are shown in Figures 11 and 12, respectively.

Construction

Transition zones. Three transition zones were located between MP mat 50-ft radius curve section and Allround hexagonal plastic mat (Photo 33), Special hexagonal plastic mat and 75-ft radius curve sand-geofiber section (Photo 34), and 50-ft radius curve sand-geofiber section and MP mat straight section (Photo 35). The first transition zone, MP mat 50-ft radius curve section and Allround hexagonal plastic mat, consisted of placing two rows of hexagonal plastic mats underneath the MP mat section. This transition zone was approximately 3 ft long by 24 ft wide. The second transition zone, Special hexagonal plastic mat and 75-ft radius curve sand-geofiber section, consisted of placing the sand-geofibers then three rows of Special hexagonal mats were placed on top of the stabilized zone. This second transition zone was approximately 5 ft long by 24 ft wide. The third transition zone, 50-ft radius curve sand-geofiber section and MP mat straight section, consisted of placing sand-geofiber then two rows of the MP mats were installed over the stabilized zone. This transition zone was approximately 12 ft long by 24 ft wide.

Multi-Purpose mat (Item 1) installation. String lines and flags were used as a construction guide to outline the boundaries of the section. Construction began by delivering the banded MP mat pallets to the installation site using a forklift (Photos 36 and 37). Each pallet had 15 MP mats. The MP mats for the 50-ft radius curve section were placed over six rows of previously installed Allround hexagonal plastic mats (Photo 33). The first row of MP mat was placed with the downwarp fold sides facing north and west. The MP mat roadway consisted of four panels wide and centered on the item. The downwarp mat edges were meshed together, holes in the panel edges were aligned, and connector pins were inserted through the holes and tightened to secure the individual panels. Photos 38 to 40 show the alignment tool designed to ease installation of the MP mats and connector pins. The alignment tools were designed and produced at ERDC. Figure 18 shows the basic dimensions of the alignment tools used in this investigation. The alignment tools were used to guide the mats into position and to align mat holes during connector pin placement (Photos 41 to 43). Once the MP mat holes were aligned, the connector pins were installed and pre-tightened by turning the hex-bolt 360 degrees (one turn). The pins were pre-tightened to rotate the pin bottom plate 90 degrees and lock the pin in-place. Since the connector pins of in-place MP mats were loose, the mats to be installed and holes were easily aligned with the alignment tools. The pin pre-tightening was done with a hand tool as shown in Photo 44. The final pin tightening was done with an impact drill with a hexagonal bit

(Photo 45). The installation procedure for the MP mat is illustrated in Figure 19. The MP mat item was anchored to prevent any movement due to shear forces in the curved sections. MP mats were anchored using Duckbill anchors (Photo 46). A total of 16 anchors were placed in the inside edge of the MP mat section (Figures 11 and 12). The anchor cable was inserted throughout the MP mat holes (Photo 47). Then the anchor was passed throughout the cable's eye to loop the anchor and fasten the mat to the ground (Photo 48). Finally, the anchor was driven into the soil using a hammer and steel drive rod as shown Photos 49 and 50. Some anchor cables had small cable's eyes; therefore, the anchors were not able to pass throughout the loop. These irregular anchors were discarded.

Hexagonal plastic mat (Item 2) installation. The edges of Item 2 edges were lined up with flags and string lines. Construction began by delivering the banded Allround hexagonal plastic mat pallets to the installation site using a small forklift (Photos 51 and 52). This method provided a continuous supply of panels to the laborers during placement. Each pallet had 80 hexagonal plastic mats. The installation procedure is illustrated in Figure 20. The installation procedure consisted of three main steps. In Step 1, the Allround mats were laid down starting at the right corner of the section as shown Figure 20 and Photo 53. The mat was then released in Step 2 (Photo 54). Finally, the mat was set in-place by stepping on it (Photo 55). Once the first row of mats (mat 1 through 16) was placed, rows 17-32, 33-48, and following, were then connected by hanging the hook into the handle and by connecting the mat to the two remaining free hooks. The Allround hexagonal plastic mat roadway consisted of 16 mats wide and centered on the item to create a 50-ft-radius curve road. Photos 56 and 57 show the installation progress of the Allround hexagonal plastic mat section. Photo 58 shows the final section.

The Special hexagonal plastic mat installation was similar to the Allround mat installation (Photos 59 and 60). The Special hexagonal mats were delivered on banded pallets using a forklift. Each pallet had 80 hexagonal plastic mats. The installation procedure is illustrated in Figure 21. The first Special hexagonal mat was laid down starting at the left corner of the Special section Figure 21. Once the first row of Special mats (mats 1 through 14) was placed, rows 15-28, 29-32, and following, were then connected by hanging the hook into the mat. The installation of both mats required no specialized tools or skills. The Special hexagonal plastic mats were directly connected to the Allround hexagonal plastic mats (Figure 22 and Photos 61 and 62).

After installation, the Allround and Special hexagonal plastic mat sections were compacted using a steel-wheel vibratory compactor (Photo 63) to embed the mat in the sand. The compaction equipment pushed the mats into the sand. The mat radial ribs (Photos 8, 10, and 12) increased the friction between the mat and sand and served as an anchor system. When the steel-wheel roller was moving from the MP mat item to the sand-geofiber item, it compacted the mats with vibration (forward). The compactor did not provide any vibration when it moved backward. Item 2 was compacted using six overlapping passes of a steel-wheel vibratory roller.

Sand-geofiber stabilization (Item 3) installation. Item 3 consisted of the in-place stabilization of the sand using synthetic geofibers. All work was accomplished using conventional U.S. Army construction equipment. The item was divided into three sections (i.e., a 75-ft radius curve section, a 50-ft radius curve section, and a straight section) as shown in Figure 15. The test sections were constructed in a 28-in.-thick by 36-ft-wide concrete sand layer. Since the difference between the three sections were geometrical dimensions, they were constructed at the same time. The sections of Item 3 were stabilized in-place. Moisture content samples were taken from the sand layer to calculate its dry weight using a nuclear gage device. The average moisture content was 2.3 percent. The average dry density for the item was 108.5 pcf. The target moisture content for the concrete sand was approximately 8 percent. Therefore, the water required to obtain the target moisture content was added prior to placing the geofibers on the sand. The appropriate amount of geofibers was calculated based upon the dry density and dry weight of the sand.

A 2-in.-long monofilament geofiber was selected for this experiment. The amount of geofiber was set to 0.8 percent per dry weight of sand. Using the dry density of sand of 108.5 pcf, an approximate item area of 4,539 ft², and a thickness of 8 in., the calculated amount of geofibers was 3,932 lb. The geofibers were shipped in boxes (Photo 64). Each box had 15 bags, and each bag weighed 20 lb. The number of bags used in this experiment was 206 representing 4,120 lb. Due to the variation in moisture and irregular item area, the additional 188 lb was minimal considering that it represented 0.04 percent of geofiber.

The sections were outlined using string lines and flags. Within each test section, marks were placed to outline the curved section radius. Marks were painted every 5 ft to place 20-lb geofiber bags (Photo 65). Four parallel lines were marked (Figures 11 and 12), and bags were placed (Photos 65 and 66). The parallel lines were spaced every 6 ft between each other and 3 ft from the outside and inside edges (Figures 11 and 12). Once the bags were placed over the marks, the plastic bags were removed, and geofibers were dumped over the marks. The piled geofibers were spread across the surface of the sand manually (Photo 67). Photo 68 shows the geofiber over the sand prior mixing. A self-propelled rotary mixer was used to mix the geofibers into the sand. The rotary mixer made four coverages (4 passes = 1 coverage) across the sand-geofiber sections. The outside and inside edges were mixed first, followed by the inner section of the lane. Photos 69 and 70 illustrate the mixing process.

After the mixing process, a D4 dozer was used to level/smooth the sand-geofiber (Photo 71). Due to high temperatures and evaporation of the sand-geofiber moisture, water was sprayed using a water truck hose (Photo 72). Water was added to the Item 3 for about 25 min. After the watering process, the sand-geofiber layer was compacted with five coverages (5 passes = 1 coverage) with the smooth drum vibratory compactor to form an 8-in.-thick base layer (Photo 73). The outside and inside edges of the lane were compacted first, followed by the inner section of the lane. Several areas in the sand-geofiber item depressed after compaction was completed. These areas were patched after the Road Oyl application.

Following the compaction of Item 3, a total of 825 gallons of Road Oyl was applied to the sand-geofiber item using an asphalt distributor truck. It was applied at a rate of 1 gallon per square yard. This spray-on surfacing material was shipped in 55 gal drums. Each drum was shaken by rolling the drum backward and forward on the ground for about 15 ft (Photo 74). The operation of the asphalt distributor truck was tested at the test sections using water to verify the nozzles, spray bar range, speed, and pressure gauges prior to applying the Road Oyl. Then, 15 drums were pumped into the asphalt distributor tank at a rate of 150 gal/min (Photo 75). The tank capacity was 1,500 gal. The spray bar width was 12 ft, containing 12 nozzles, and it was 12 in. above the ground. The Road Oyl was pumped through spray bar nozzles at a rate of 150 gal/min (Photo 76). The spray-on surfacing was allowed to cure for 24 hr.

As mentioned previously, several locations in the sand-geofiber item were patched to repair densified areas. The patching was done after the Road Oyl application and before final compaction. The sand-geofiber mix for the patching was prepared in a staging area. The moisture content of the sand stockpile was 8 percent. The total amounts of sand and geofibers used for this patch mixing were 25,000 lb and 200 lb, respectively. The sand was weighed out using the difference in weight of an empty and loaded front-end loader. The sand was placed in the staging area where it was leveled to a depth of approximately 1 ft using a D4 bulldozer. The amount of geofibers was weighed and uniformly spread across the surface of the moist sand. A self-propelled rotary mixer was used to mix the geofibers into the sand. The rotary mixer made four initial passes across the sand-geofiber mix. Then, the mix was piled and releveled with a front-end loader. Following the releveled, four additional passes of the rotary mixer were made. The sand-geofiber was then piled and ready for installation at the site. The depressed areas were patched by using the Bob-Cat equipment and two pitch forks (Photo 77).

Finally, four passes of the vibratory steel-wheel roller were applied to seal the surface (Photo 78). The outside and inside edges of the lane were compacted first, then the center section of the lane. In the patched areas, the sand-geofiber peeled off with compaction due to the adhesion of the Road Oyl. Several lessons were learned during the patching of the sand-geofiber item. First, the depressed areas need scarification before placing the patching sand-geofiber material. Second, Road Oyl should be mixed into the sand-geofiber mix to be used for repairs. Finally, the steel-wheel roller should be used but without vibration.

Behavior of Experimental Items Under Traffic

Traffic

Traffic was applied using a M923 5-ton military truck loaded to a gross vehicle weight of 41,600 lb (Photo 79). The individual truck tires were inflated to a 75-psi tire pressure with a contact area of approximately 55.5 in². A total of 500 channelized truck passes were applied to Items 1, 2, and 3. Traffic was

applied by driving the traffic vehicle (approximately 5 to 10 mph) over the items, which were oriented in an oval configuration.

Failure criteria

The failure criteria used in the experiment were based primarily on the development of roughness and excessive mat breakage resulting from subgrade deformation. When the cross section measurements exceeded 3 in., the item was considered failed because of permanent deformation. Failure, as a result of mat breakage, was defined as sufficient breakage to pose a tire hazard during operations. For the purposes of the experiment, mat breakage in excess of 20 percent indicated item failure. It was determined that normal maintenance procedures would include up to 10 percent mat replacement.

Maintenance

No maintenance was performed on Item 1 (MP mats) with the exception of the sand shoulders. The inside shoulder of the MP mat item was eroded due to heavy rains (Photo 80). The eroded shoulder was repaired with sand-geofiber mix (Photo 81). After 25 passes on Item 2, 2- to 3-in. ruts were measured in the Allround hexagonal plastic mats section and 1-in. ruts had developed in the Special hexagonal plastic mat section. After 165 passes, the Allround hexagonal plastic mats were removed due to the severe rutting (4 in.) and disconnection of mats. Once the Allround hexagonal plastic mats were removed, the top 6 in. of the sand layer was pushed from the outside edges to the inside of the section using a D4 dozer. The sand layer was then re-leveled, and a 6-in.-thick layer of crushed limestone (about 100 tons) was placed on top of the sand. The crushed limestone was wet and contaminated with fines. A front-end loader was used to place the crushed limestone in a 20-ft-wide center section of the roadway. The spreading of the limestone started at the edge of the MP mat item and worked toward the Special hexagonal plastic mat section. After the limestone was placed and spread, it was compacted with 3 coverages of a vibratory steel-wheel roller. After 300 truck passes, the wheel path area in the transition between Special hexagonal mat and 75-ft radius curve section of the sand-geofiber item developed rut depth of 3 in. The deterioration of the transition was filled with geofiber-stabilized material from stockpiles (Photo 82). During the traffic period, the outside and inside shoulders of the entire oval field test section were eroded several times due heavy rains. In all case, they were repaired using sand-geofiber.

Rut depth measurements

Rut depth measurements were recorded at 21 stations throughout the traffic test period. Measurements were made at three locations in each station by placing a metal straightedge across the traffic lane. The maximum rut depth was measured using a folding ruler. The measured rut depth included both the permanent deformation and the upheaval within the traffic lane. Photo 83 shows the straight edge across the ruts in the Allround hexagonal plastic mat section. The average rut depth of each location consisted of the average of the maximum rut depth values from each wheel path. The average of the three locations within each item was recorded as the average rut depth for a given traffic pass level for

the entire item. The cross section data were normalized (each subsequent measurement was subtracted from baseline data taken at zero passes) to clearly identify the damage due to the applied traffic. Figure 22 presents the average rut depth measurements for Items 1, 2, and 3 at various traffic levels. Table 5 summarizes the detailed rut depth data.

Table 5
Summary of the Rut Depth Measurements

Number of Passes	Hexagonal Mats		Multi-Purpose Mats		Sand-Fiber Section		
	Allround	Special	Straight	50 ft Radius	75 ft Radius	50 ft Radius	Straight
0	0.00	0.00	0.00	0.00	0.00	0.00	0.00
25	1.22	0.85	0.56	0.79	0.63	0.68	0.64
50	1.77	1.19					
75	2.29	1.40					
100	2.36	1.47	0.81	0.96	1.09	1.00	0.92
135							
165	4.79	1.36					
215		1.99					
300		2.36	1.36	1.41	3.08	3.27	1.90
335							
500		5.87	1.76	1.57	4.99	5.07	3.38

Moisture and density measurements

Moisture and density measurements were recorded for experiment sections before traffic and following the termination of the traffic test period. Measurements were made using a Troxler 3430 nuclear gage according to the manufacturer's recommendations by certified personnel. Tests were conducted by using the scraper plate to level the test area, hammering the drill rod into the ground, removing the scraper plate, positioning the gauge over the rod hole, and extending the probe to various depths. A 6-in. probe depth was selected for reporting the material properties of experiment sections. The moisture and density data for sections before and after traffic are presented in Table 6 for comparison. A discussion of these results is presented in the Chapter 4 of this report.

Dynamic cone penetrometer (DCP) measurements

DCP measurements were conducted in experiment sections according to the procedure described in Webster et al. (1992). Three DCP measurements were conducted in each item before traffic was applied. After the termination of traffic, a DCP test was conducted at each station. The test procedure involved placing the DCP cone point on the surface and driving the cone into the ground until the base of the cone was flush with the surface. Then, a baseline measurement was recorded to the nearest 5 mm. The 17.6-lb hammer was then raised and dropped 22.6 in. onto an anvil, which drove the penetrometer rod and cone into the soil. Measurements of the cone's penetration and the corresponding number of hammer blows were recorded approximately every inch (25 mm) or whenever any noticeable change in penetration rate occurred. A DCP strength index in terms of penetration per hammer blow was calculated for each measurement interval. The DCP index was then converted to CBR percentage using the

correlation: $CBR = 292/DCP1.12$ where DCP is in mm/blow. Table 7 summarizes the results of the DCP readings taken from experiment sections. The representative sand subgrade strength for experiment sections ranged from 2 to 12 percent CBR before construction and from 5 to 50 CBR after 500 truck passes. The sand-geofiber strength was approximately a 10 CBR both before and after traffic. A discussion of the DCP test results is presented in the Chapter 4 of this report.

Table 6
Summary of Moisture and Density Measurements

Nuclear Gauge Readings					
Before Traffic					
Location	Section	Wet Density lb/ft ³	Dry Density lb/ft ³	Moisture lb/ft ³	Moisture %
1	Sand-Fiber	112.7	109.0	3.7	3.4
2	Crushed Limestone	132.3	129.5	2.7	2.1
3	Hexagonal Mat	111.2	109.2	2.0	1.8
4	MP Mat	109.0	107.3	1.7	1.6
After Traffic					
1	Sand-Fiber	109.6	104.8	5.0	4.7
2	Crushed Limestone	139.3	135.9	3.4	2.5
3	Hexagonal Mat	122.8	112.9	8.9	7.9
4	MP Mat	122.2	116.0	6.2	5.4

Notes:
Crushed limestone was constructed after the Allround hexagonal plastic mat failed (165 passes).
The corresponding density and moisture for the Allround hexagonal mat after traffic are as follows:
wet density = 118.4 lb/ft³, dry density = 110.4 lb/ft³, moisture = 8.0 lb/ft³, and moisture = 7.3%.

Table 7
DCP Results Summary for the Full-Scaled Field Test Section

Average CBR - Before Traffic			
Section	Surface Layer	Sand	Dredge
Hexagonal Mat	---	4.3	10.3
MP Mat	---	2.9	9.0
Sand-Geofiber	10.2	4.5	2.2
Average CBR - After Traffic			
Allround Hexagonal Mat	---	5.7	7.5
Special Hexagonal Mat	---	8.8	50.0
MP Mat	---	9.8	20.0
Sand-Geofiber	10.2	10.0	4.5

Cross section measurements

Surface cross sections were recorded at traffic pass intervals throughout the testing period. Rod and level measurements of the cross section were recorded at 1-ft intervals across the traffic lane at three locations in each section. These measurements provide an accurate measure of the average maximum permanent deformation. The cross section data were also normalized for analysis purposes. Typical cross section plots for various sections were useful in describing the performance of each section. Figures 23 to 29 show the deformation of each

section. Table 8 summarizes the permanent surface deformation data for this full-scaled field experiment.

Table 8							
Permanent Deformation Measurements for the Full-Scaled Field Test Section							
Number of Passes	Hexagonal Mats		Multi-Purpose Mats		Sand-Geofiber Section		
	Allround	Special	Straight	50 ft Radius	75 ft Radius	50 ft Radius	Straight
0	0.00	0.00	0.00	0.00	0.00	0.00	0.00
25	0.54	0.76	0.08	0.04	0.12	0.04	0.12
50	0.93	1.20					
75	1.20	0.92					
100	1.08	0.96	0.40	0.32	0.48	0.20	0.54
135							
165	2.49	0.96					
215		1.52					
300		1.92	0.84	0.56	1.16	1.64	1.26
335							
500		3.12	1.28	1.32	1.64	2.04	1.92

4 Analysis of Field Experiment

The following analysis is based solely on the performance of the roadway systems under the test conditions presented in this report. The tests did not include braking traffic conditions.

Material Performance

A summary of the performance of Items 1, 2, and 3 is presented in Table 9.

Post traffic condition

The sand-geofiber and MP mat items provided adequate structural support to withstand the application of 500 truck passes with no maintenance. In summary, all of the experiment sections performed adequately with the exception of the Allround hexagonal plastic mat. Photos 83 and 84 show the post traffic condition of Allround hexagonal plastic mat section of Item 2. This section was designed to evaluate the performance of the Allround hexagonal plastic mats in a 50-ft radius curve. After 165 passes, it was in poor condition, and the mats separated at several locations. Mats were hitting the truck's rear end differential as it moved across the section. At station 1+05, the rut depth was 12 in.

Item 1: Multi-Purpose Mats

Straight section. This section reached an average permanent deformation of 1.28 in. after 500 truck passes. The mat and connector pins performed well. One panel was slightly damaged, and one pin was loose. After 300 truck passes, the section moved about 8 in toward traffic direction. Photo 85 shows a total displacement of 12 in. on the straight section after 500 truck passes. One connector pin was not properly tightened and became disconnected after 500 passes (Photo 86). One MP mat delaminated at the downward fold edge as shown Photo 87. The anchor performed well once it locked itself as shown in Photo 88.

50-ft radius curve. This section had an outside and inside radius of 74 ft and 50 ft, respectively. The section provided excellent structural support throughout the traffic period. The permanent deformation for this section was

1.32 in. after 500 truck passes. The section moved approximately 2 in. laterally after the test traffic (Photo 89). Mats, connector pins, and anchors were in excellent conditions after the 500 passes.

Table 9
Performance Summary

Roadway System	Traffic Passes	Permanent Deformation in.	Performance	Comments
Item 1 (Multi-Purpose Mats Straight Section)	500	1.28	Excellent	Suitable for 5-ton military truck traffic over loose sand
Item 1 (Multi-Purpose Mats 50-ft Radius Curve Section)	500	1.32	Excellent	Suitable for 5-ton military truck traffic over loose sand.
Item 2 (Allround Hexagonal Plastic Mat)	165	2.49	Poor	In previous studied, the Allround mats performed good in straight section. This section had a 50-ft radius curve and mats disconnected.
Item 2 (Special Hexagonal Plastic Mat)	500	3.12	Poor	The Special mats performed poor in straight section but extensive ruts were observed.
Item 3 (Sand-Geofiber 70-ft Radius Curve Section)	500	1.64	Excellent	Suitable for 5-ton military truck traffic over loose sand with maintenance after 500 passes.
Item 3 (Sand-Geofiber 50-ft Radius Curve Section)	500	2.04	Excellent	Suitable for 5-ton military truck traffic over loose sand with maintenance after 500 passes.
Item 3 (Sand-Geofiber Straight Section)	500	1.92	Excellent	Suitable for 5-ton military truck traffic over loose sand.

Item 2: Hexagonal Plastic Mats

Allround hexagonal plastic mat section. The Allround hexagonal plastic mats section had an outside and inside radius of 74-ft and 50-ft, respectively. These mats were previously tested on straight sections and performed excellent. The performance of this mat under 50-ft radius curves was poor as indicated by 2.49 in. average permanent deformation after 165 truck passes. The maximum permanent deformation was 12 in., therefore, the traffic was discontinued and item was replaced. The mats were removed since the mats were hitting the truck's axles. Forty-two mats were damaged as shown Photos 90 and 91. The mats disconnected at the upheaval and center lane areas. The poor bearing capacity of the loose sand, shear forces caused by truck tires, and poor mat connection mechanisms unzipped the mats in these areas (Photo 92). To maintain trafficability of the field test section, the Allround hexagonal mat section was replaced with a 6 in. layer of crushed limestone.

Special hexagonal plastic mat section. This mat was tested for the first time in this experiment on a straight section. This section supported 500 truck passes with a 3.12-in. average permanent deformation. The special hexagonal mats section moved approximately 7 in. toward the direction of traffic after the Allround hexagonal mat section was removed (Photo 93). Mats became

disconnected in the wheel path. Since the truck axles were hitting the mats, several mats broke as shown Photo 94.

Item 3: Sand-Geofiber Stabilized Sections

75-ft radius curved section. This section had an inside and outside radius of 75 ft and 99 ft, respectively. The performance of this section was excellent as indicated the 1.64 in. of average permanent deformation after 500 truck passes.

50-ft radius curved section. This curved section had an inside and outside radius of 50 ft and 74 ft, respectively. The performance of this curve was good as indicated the 2.04 in. of permanent deformation after 500 truck passes.

Straight section. The sand-geofiber was tested in straight sections in previous studies and performed excellent. The performance of this section was excellent as indicated by the 1.92 in. of average permanent deformation after 500 truck passes.

Field Data

Moisture and density data. Moisture and density data were collected from the centerline and the wheel paths. A summary of the data is presented in Table 6. A comparison of the densities measured before traffic to those measured after traffic indicates that the sand and crushed limestone layers experienced significant densification under the applied traffic. The densities of the sand layer were consistent along three items. The sand-geofiber showed less density due the loss of geofiber reinforcement at the wheel paths. The moisture content measurements were higher after traffic due to heavy rains. The sand-geofiber moisture content was higher before traffic but lower after traffic.

DCP data. DCP measurements were made in several locations along the sections. These data were converted to CBR as described previously, and the average CBRs for selected pavement layers are presented in Table 7. A comparison of the DCP values before and after traffic also indicates that strength increases after traffic. This could be attributed to sand-geofiber layer densification.

Installation Rates

During the construction of the oval field test section, temperatures ranged from 78 to 95 degrees Fahrenheit, the humidity ranged from 50 to 87 percent, and heat index ranged from 80 to 105 degrees Fahrenheit. For the MP mat item, the construction crew consisted of six men including an equipment operator. The total roadway area and construction time were 5,148 ft² and 203 min, respectively. The installation rate for the MP mat item was 253 ft² per man-hour. For the Allround hexagonal plastic mat section, eight men installed the mats. The

section area was 2,340 ft². The construction time was 30 min. The installation time for the Allround hexagonal plastic mat was 585 ft² per man-hour. For the Special hexagonal plastic mat section, eight men installed the mats. The section area was 1,259 ft². The construction time was 12 min. The installation time for the Special hexagonal plastic mat was 786 ft² per man-hour. For the sand-geofiber item, an average of 5 men constructed the item. The item area was 6,800 ft². The construction time was 6.5 hr. The installation time for the sand-geofiber item was 209 ft² per man-hour.

5 Conclusions and Recommendations

Conclusions

The following conclusions were noted:

- a.* Item 1: The MP mats provided adequate structural support to sustain 500 passes of the 5-ton military truck in both the straight and 50-ft radius curved section.
- b.* Item 1: The aluminum connector pins withstood flexures of the mat in excess of 3 in. The alignment tools were useful to align the mat holes and to install the connector pins. The anchors helped to stabilize the mats during turning maneuvers once the cable stressed.
- c.* Item 2: The Allround hexagonal plastic mats provided poor load support for 5-ton truck traffic. The Allround hexagonal mats performed extremely poor under a 50-ft radius curved section. The mats disconnected creating a dangerous roadway for the truck.
- d.* Item 2: The Special hexagonal plastic mats provided adequate support for 500 truck passes in a straight section, but the mats disconnected at the centerline of the lane and at the upheaval areas at the edge of the wheel paths.
- e.* Item 3: Sand-geofiber stabilization is adequate for straight and curved roadway sections. The 75-ft and 50-ft radius curved sand-geofiber sections were adequate to sustain 500 military truck passes over 24-in. layer of loose sand.
- f.* Item 3: The selected fiber content of 0.8 percent per dry weight of sand provided adequate support to withstand the applied traffic.
- g.* Item 3: The 8 in. stabilized sand layer provided adequate support for 500 passes of the 5-ton military truck.
- h.* The MP mats, hexagonal plastic mats (in straight section), and sand-geofiber stabilized technologies were confirmed as adequate alternatives to traditional road construction technologies. These technologies were exposed to heavy rains, humidity, winds, and high and low temperatures for a period of 6 months.

- i. For the MP mat item, the installation rate was 253 ft² per man-hour. The installation time for the Allround hexagonal plastic mat was 585 ft² per man-hour. The installation time for the Special hexagonal plastic mat was 786 ft² per man-hour. The installation time for the sand-geofiber item was 209 ft² per man-hour.

Recommendations

The performance of MP mats and sand-geofiber stabilization during traffic testing indicate the potential for excellent field performance when used over loose sand conditions. However, the tests conducted did not include the effects of braking. A field demonstration is required to transfer the technology from the field investigation to the warfighter while monitoring materials performance under actual field conditions.

The MP mats and sand-geofiber stabilization technology are recommended for roadway construction because they are not logistic intensive, and cheaper than other potential mat surfacings. The Allround and Special hexagonal plastic mats are recommended for parking, storage, walkways, tent flooring, and low-density traffic areas.

The results of this study demonstrated great potential for military road applications using the MP mats and sand-geofiber technologies. The effect of tracked vehicles on mat deterioration requires additional investigation.

References


- American Society for Testing and Materials. (1992). "Standard classification of soils for engineering purposes (Unified Soil Classification System)," Designation: D 2487, Philadelphia, PA.
- _____. (1993). "Standard test methods for maximum index density and unit weight of soils using a vibratory table," Designation: D 4253, Philadelphia, PA.
- _____. (1998). "Standard test method for flexural properties of unreinforced and reinforced Plastics and electrical insulating materials by four-point bending," Designation: D 6272, Philadelphia, PA.
- _____. (1998). "Standard test method for tensile properties of polymer matrix composite materials," Designation: D 3039, Philadelphia, PA.
- Department of Defense. (1988). Joint Chiefs of Staff. (1998). "Joint Tactics, Techniques, and Procedures for Joint Logistics Over-the-Shore (JLOTS)," JP 4-01.6, Washington, DC.
- Geotechnical Fabrics Report, GFR. (1998). "Specifier's guide 1999," GFR, Industrial Fabrics Association International, Roseville, MN.
- GFI. (1996). "Technical Proposal – Solicitation Number DACA 39-96-R-0003," GFR, Industrial Fabrics Association International, Roseville, MN.
- Tingle, Jeb S., Webster, Steve L., and Santoni, Rosa L. (1999). "Discrete fiber reinforcement of sands for expedient road construction," Technical Report GL-99-3, U.S. Army Engineer Waterways Experiment Station, Vicksburg, MS.
- Tingle, Jeb S. and Webster, Steve L. (1998). "Expedient Road Construction Over Sands Using Lightweight Mats," Technical Report GL-98-3, U.S. Army Engineer Waterways Experiment Station, Vicksburg, MS.
- Webster, Steve L. (1986). "Sand-grid demonstration roads constructed for JLOTS II tests at Fort Story, Virginia," Technical Report GL-86-19, U.S. Army Engineer Waterways Experiment Station, Vicksburg, MS.

Webster, Steve L., and Santoni, Rosa L. (1997). "Contingency airfield and road construction using geosynthetic fiber stabilization of sands," Technical Report GL-97-4, U.S. Army Engineer Waterways Experiment Station, Vicksburg, MS.

www.GFlinc.us

www.earthanchor.com

Section A-A'
Profile View

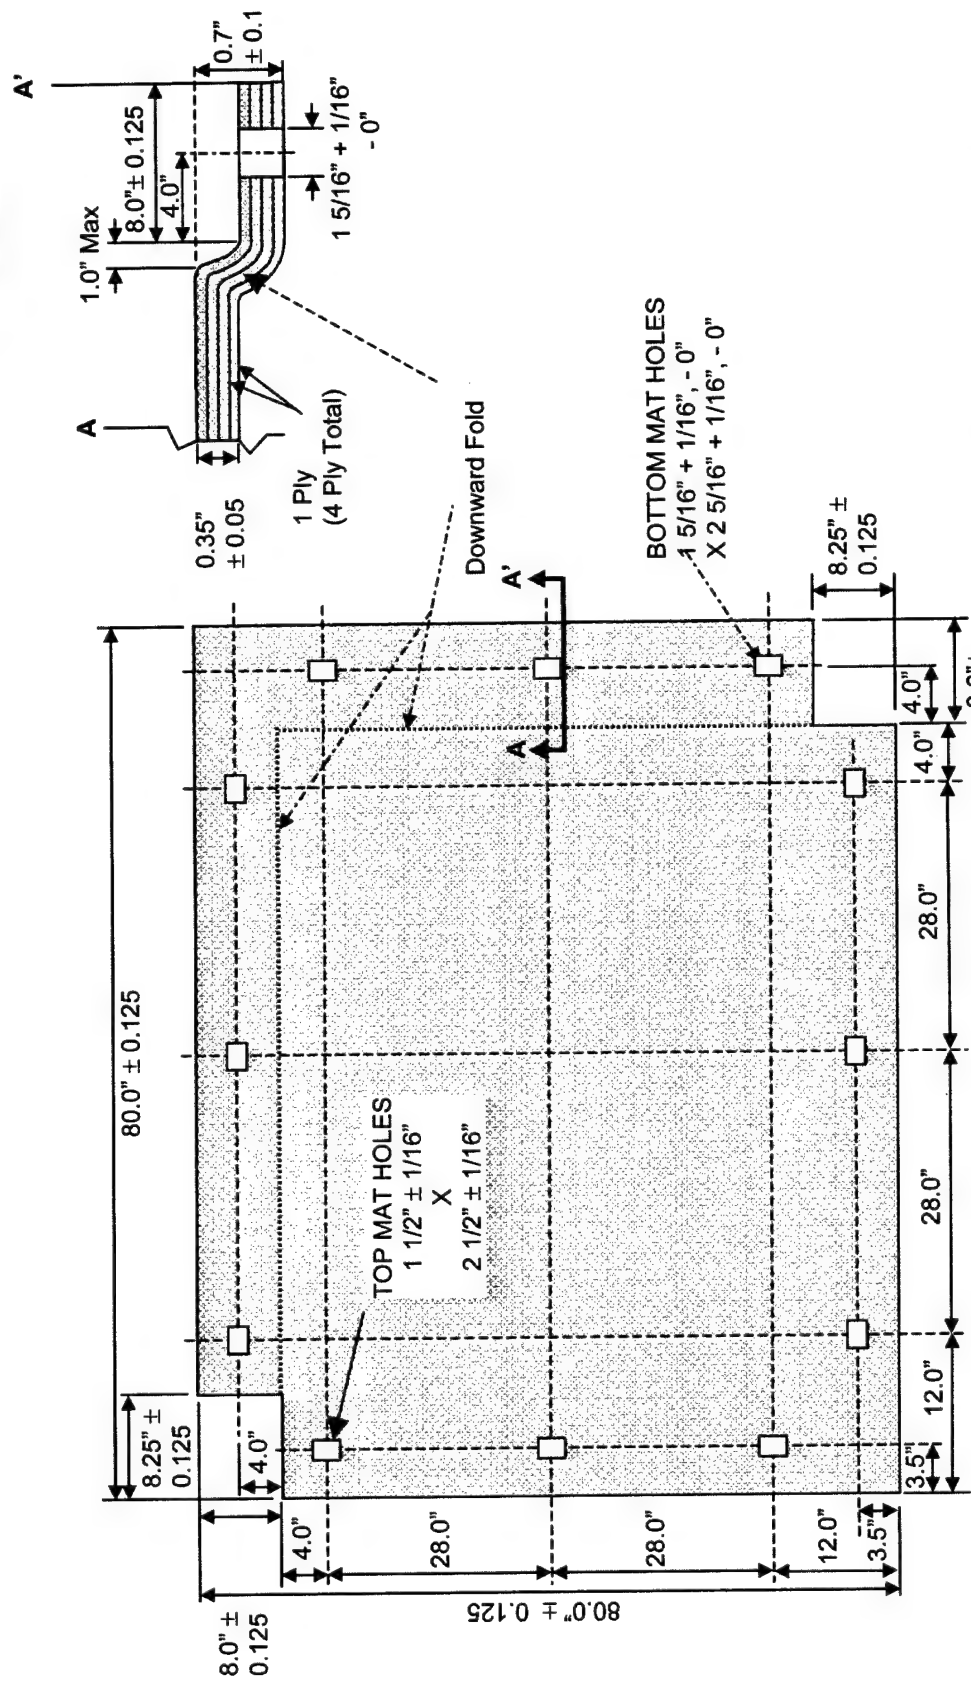

No. Plys	Thickness $\pm 0.05''$	Weight lbs	Weight lb/ft ²
4	0.35''	115	2.93

Figure 1. MP mat dimensions


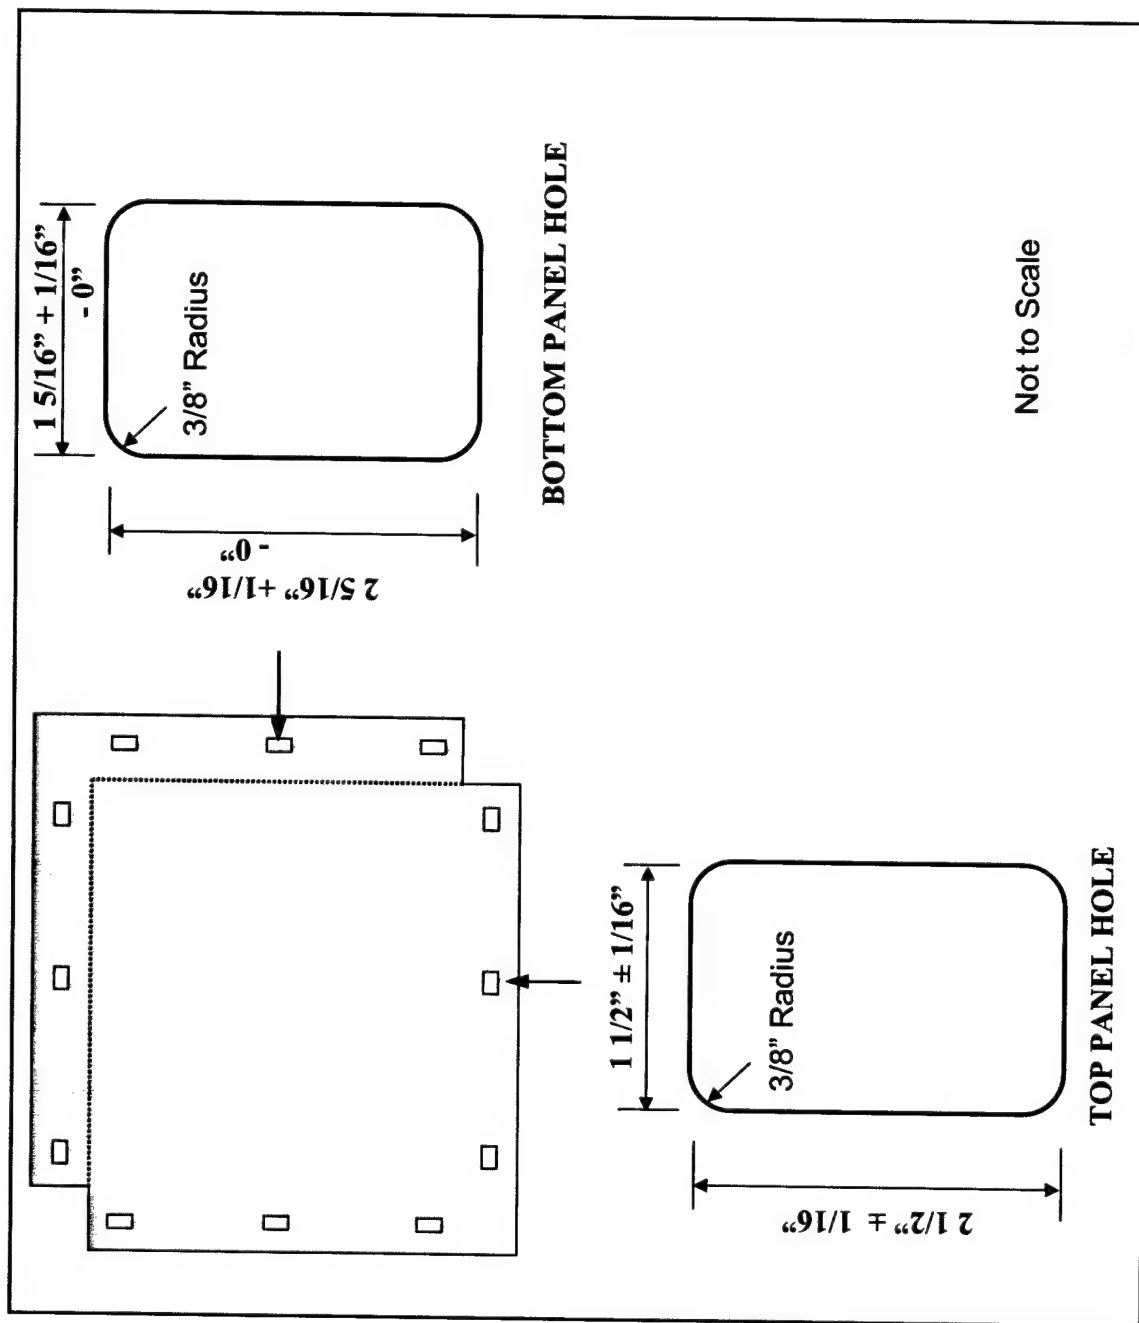


Figure 2. MP mat rectangular hole dimensions

5/8" HEX BUTTON HEAD CAP SCREW
-COARSE THREAD

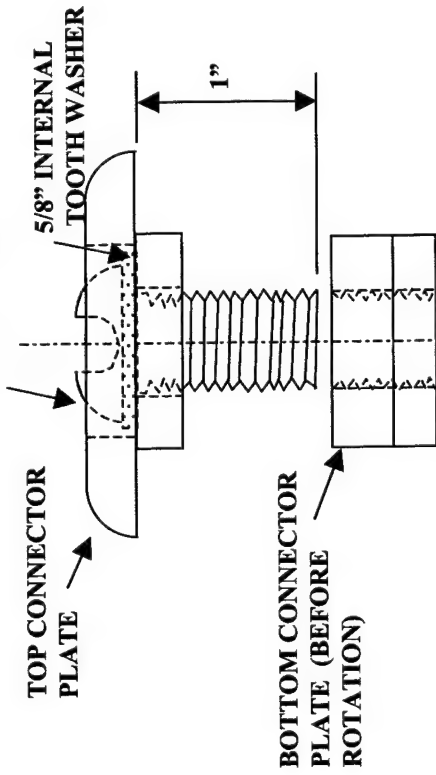

CONNECTOR PIN ASSEMBLY

MAT WITH
CONNECTOR PIN ASSEMBLY

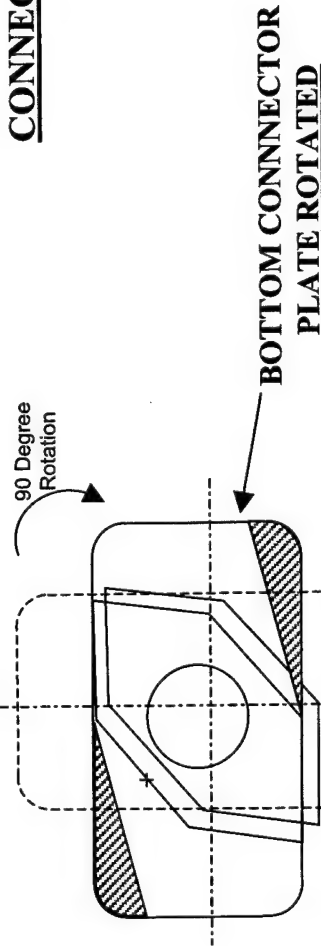
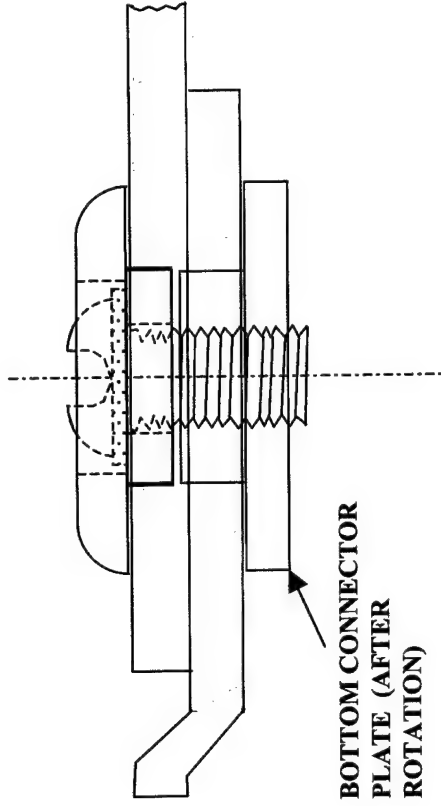


Figure 3. Aluminum drop-in pin connector assembly

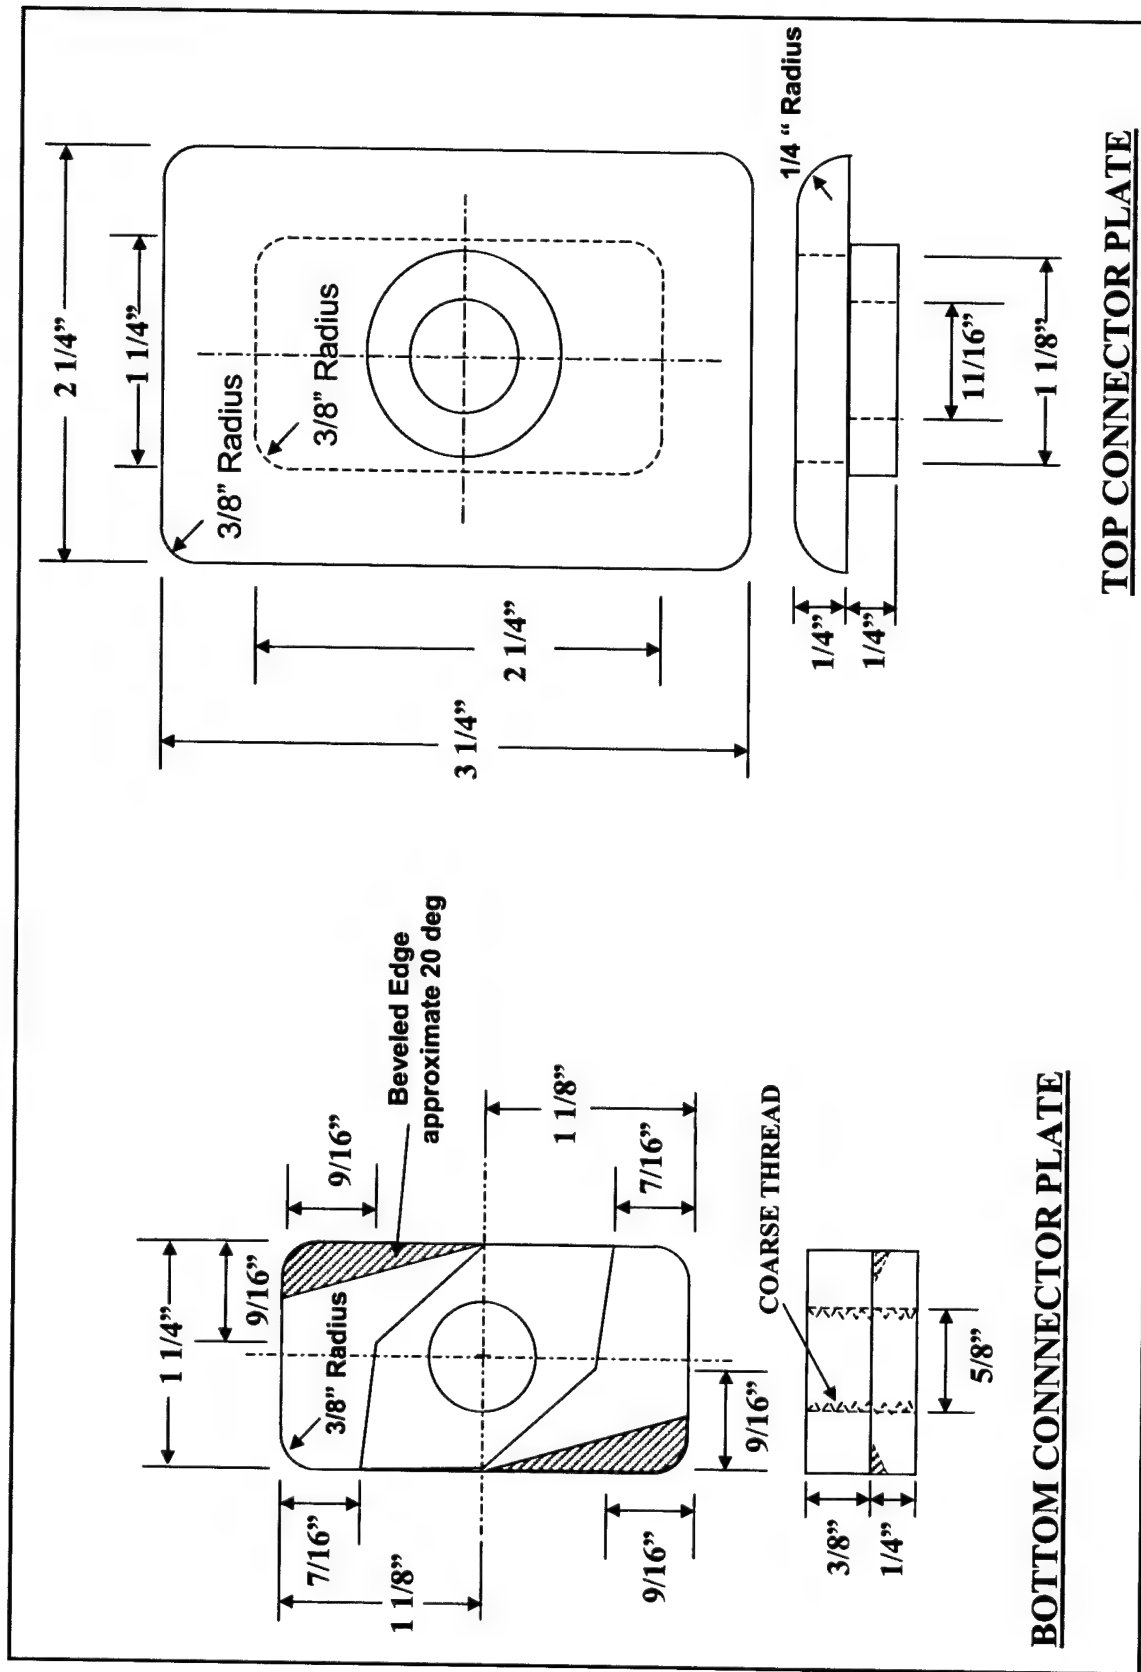


Figure 4. Aluminum drop-in pin connector plate dimensions



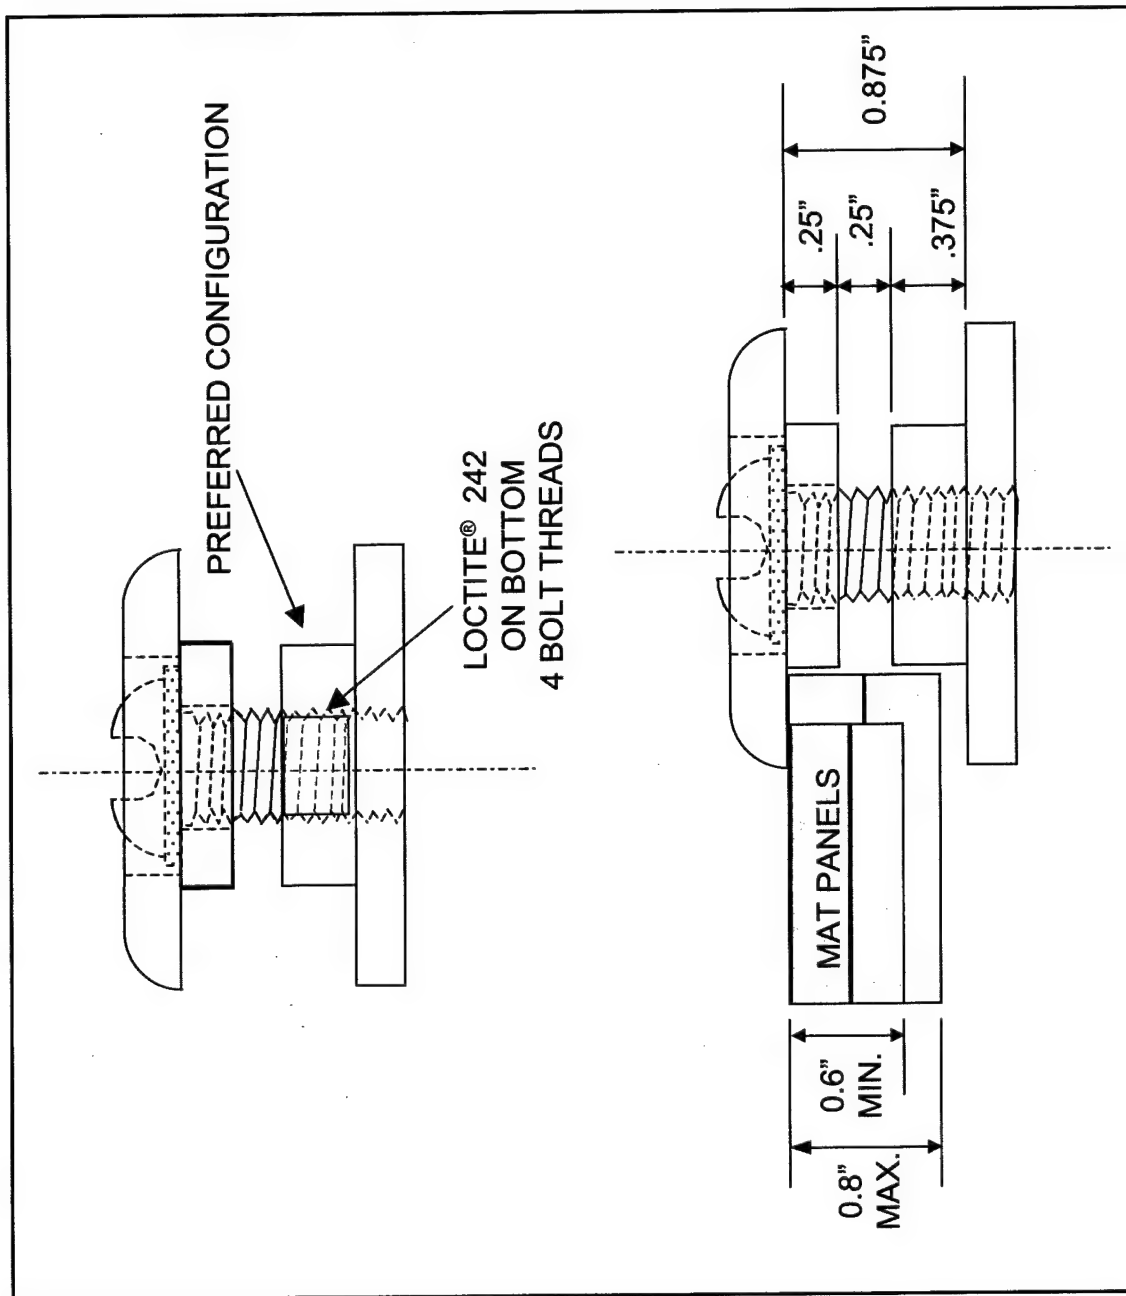


Figure 5. Aluminum drop-in pin connector configurations for locking bottom connector plate to cap screw and tolerance ranges

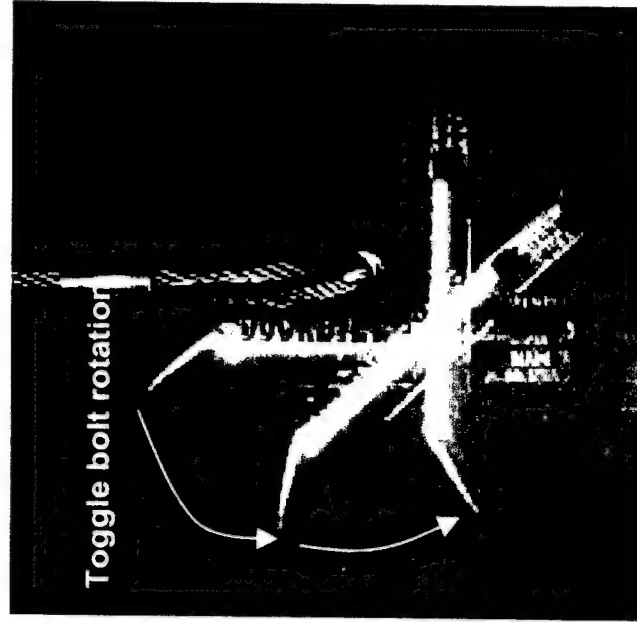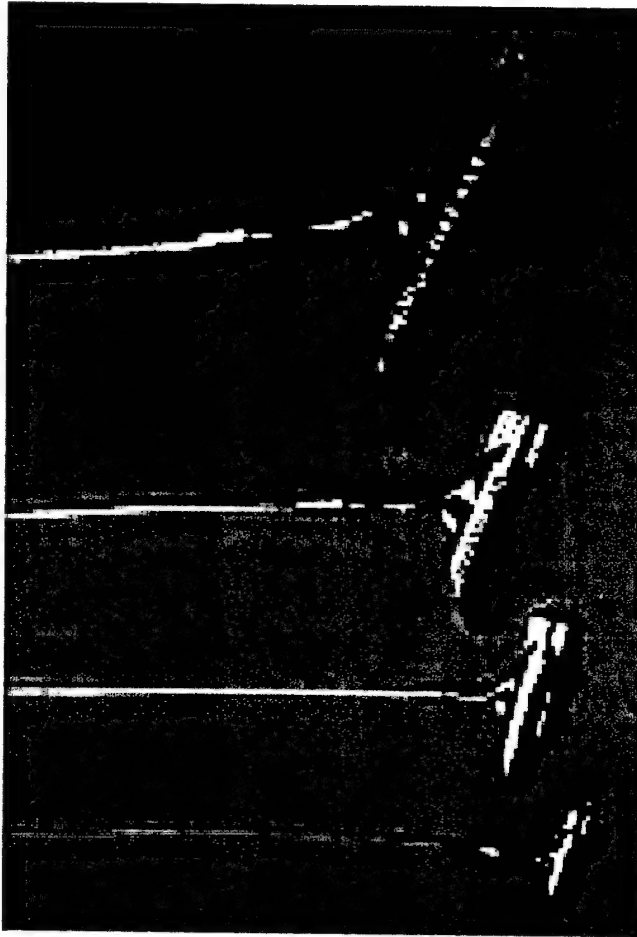

Toggle bolt rotation

Reference: www.earthanchor.com

Figure 6. Duckbill anchor components


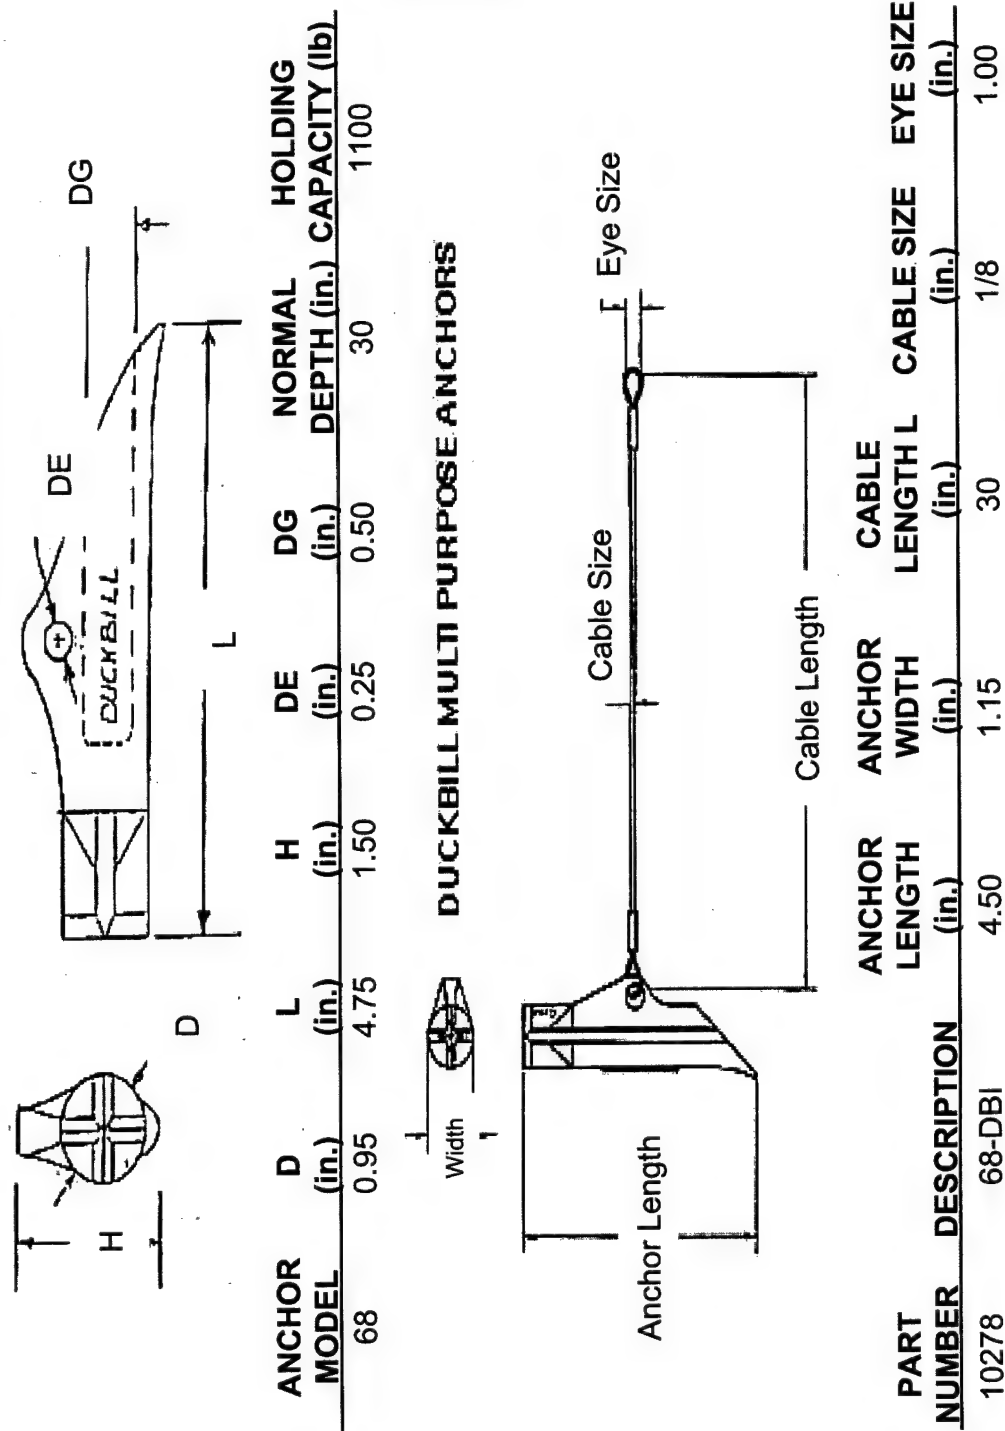


Figure 7. Duckbill anchor dimensions

DUCKBILL DRIVE STEEL

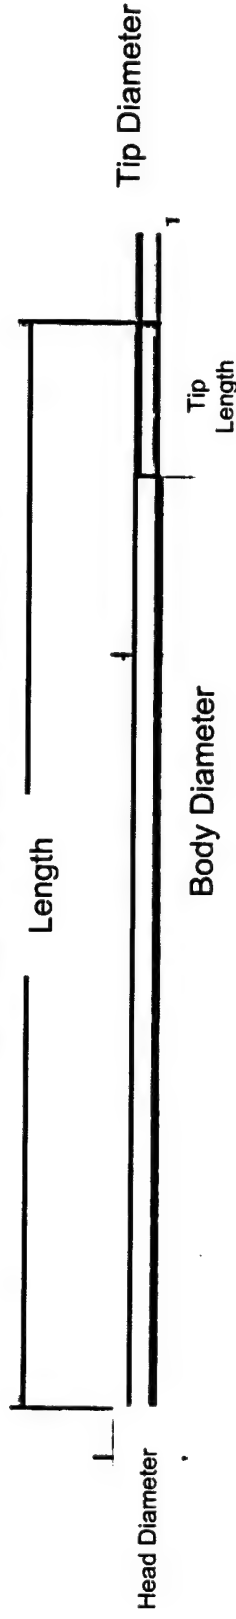

FOR USE ON ANCHOR	PART NUMBER	DESCRIPTION	LENGTH (in.)	BODY DIAMETER (in.)	HEAD DIAMETER (in.)	TIP LENGTH (in.)	TIP DIAMETER (in.)
68-DB	50009	DS-68	36	0.50	0.88	N/A	0.50

Reference: *Handbook of Drilling Engineering*

Figure 8. Steel drive rod basic dimensions

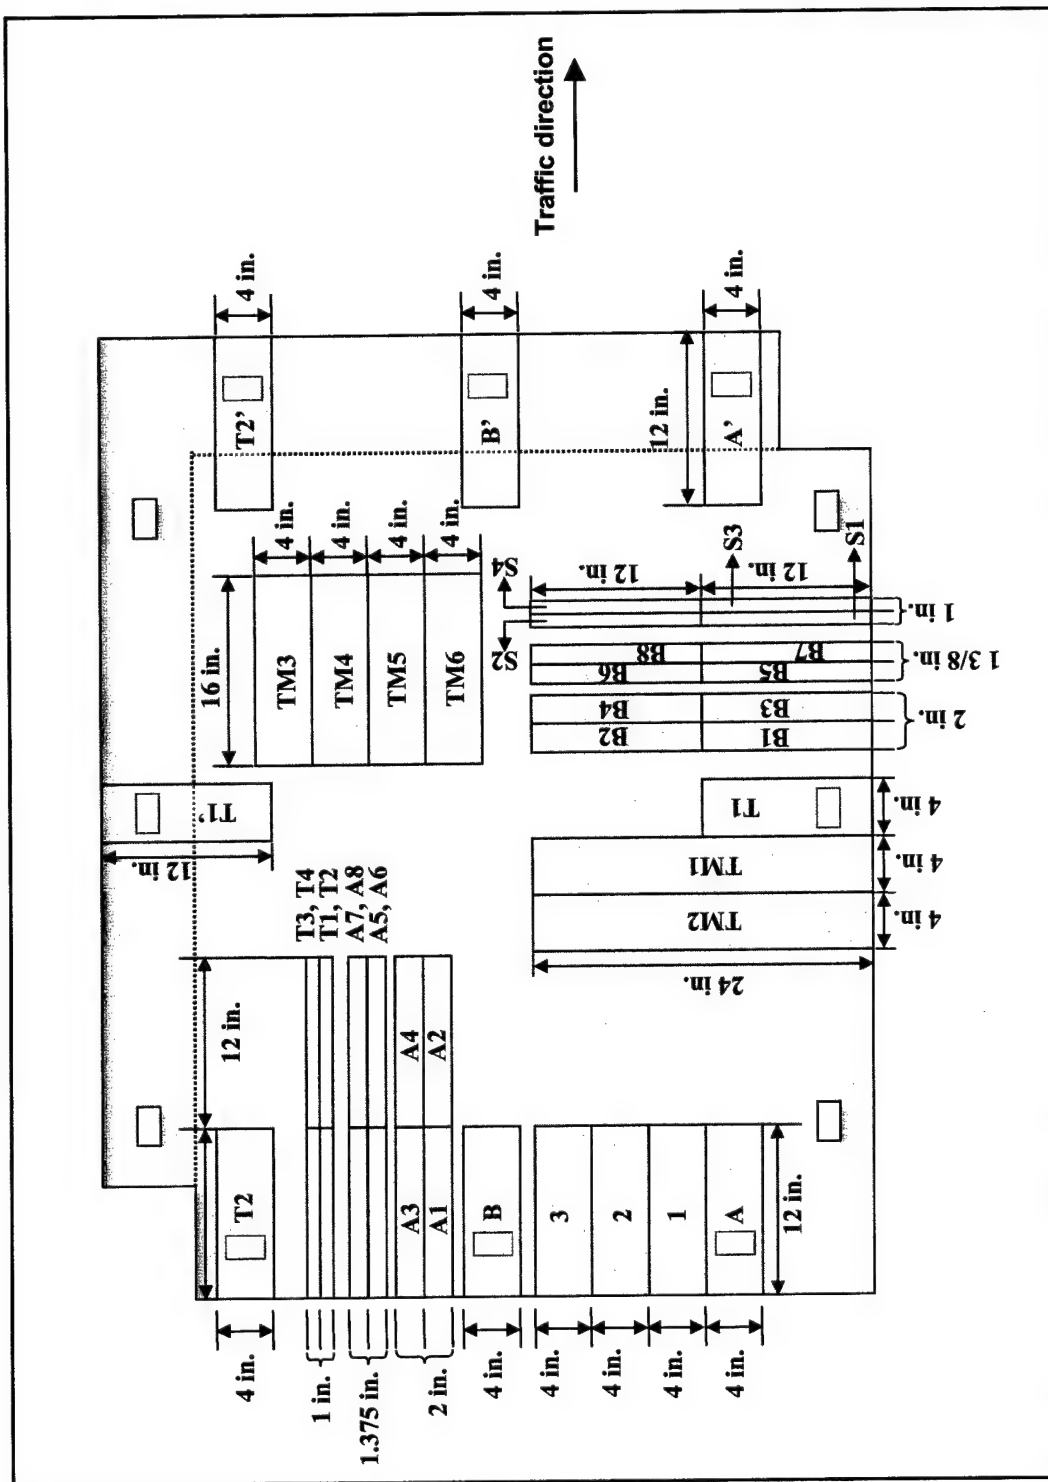


Figure 9. MP mat sample locations

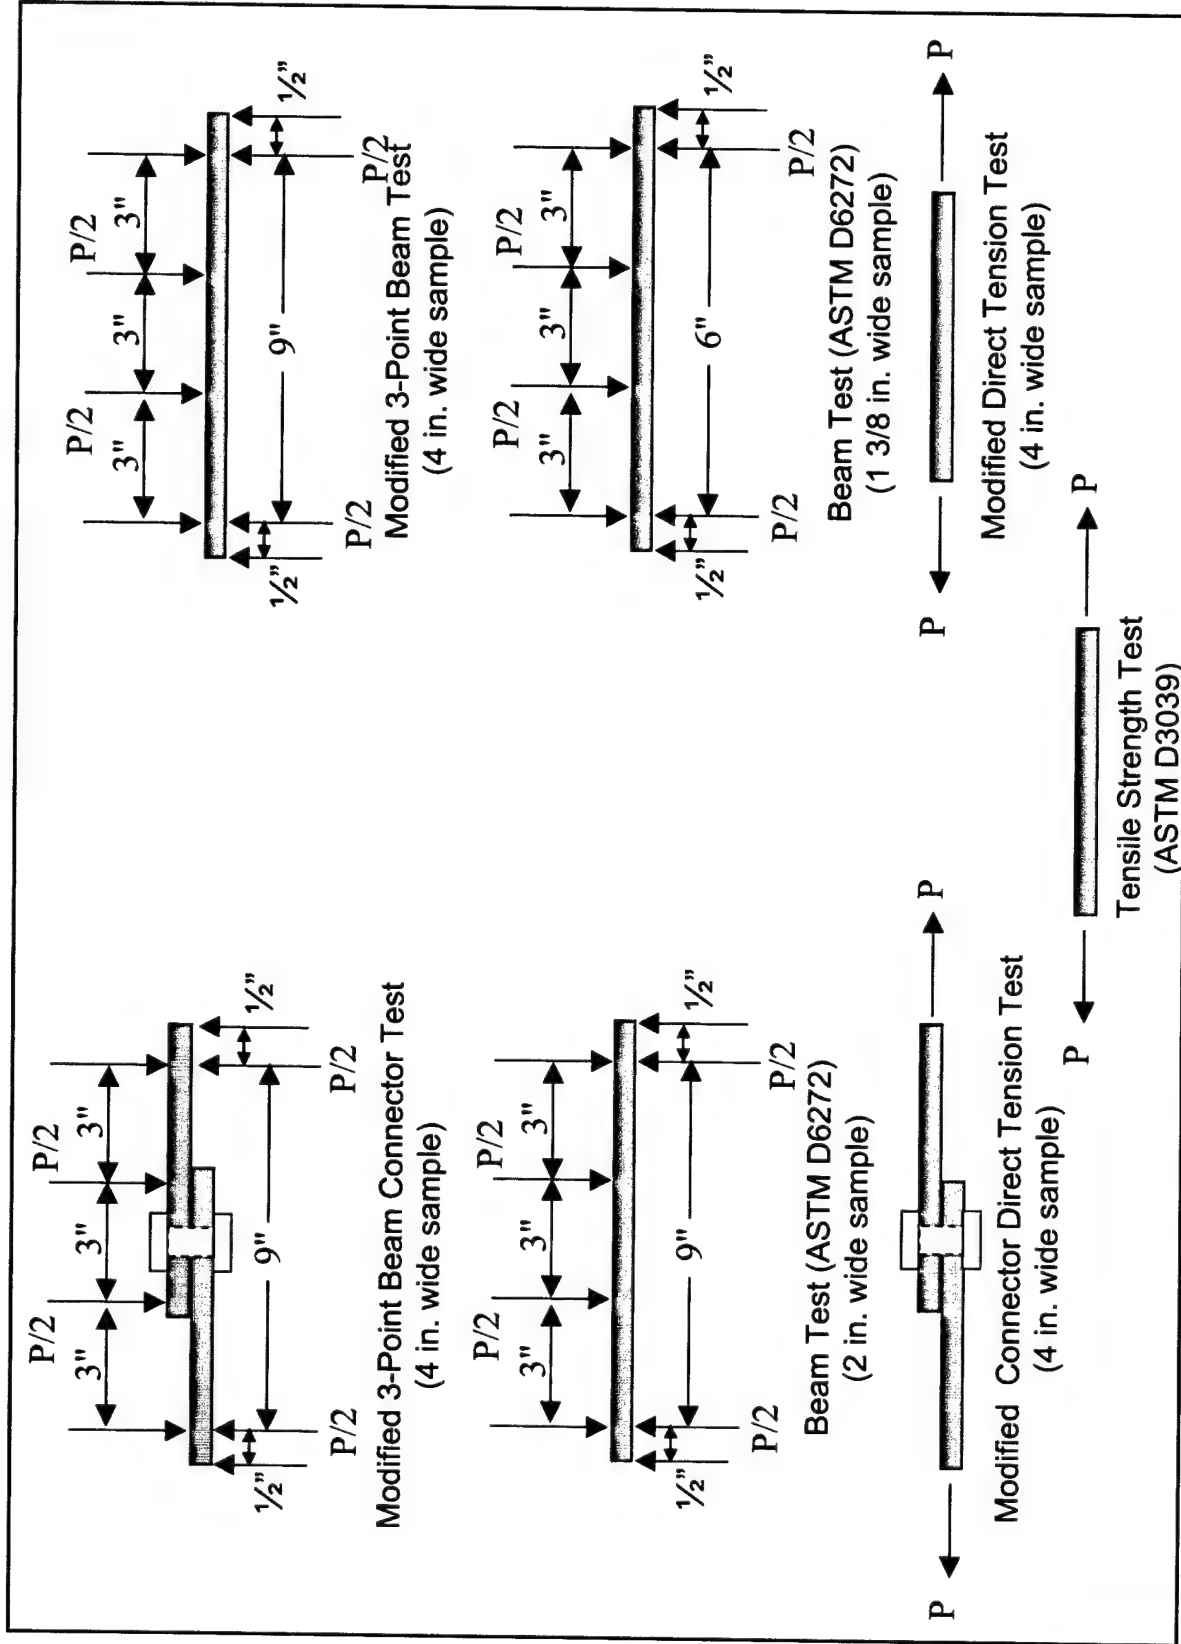


Figure 10. Test set up for the MP mat samples

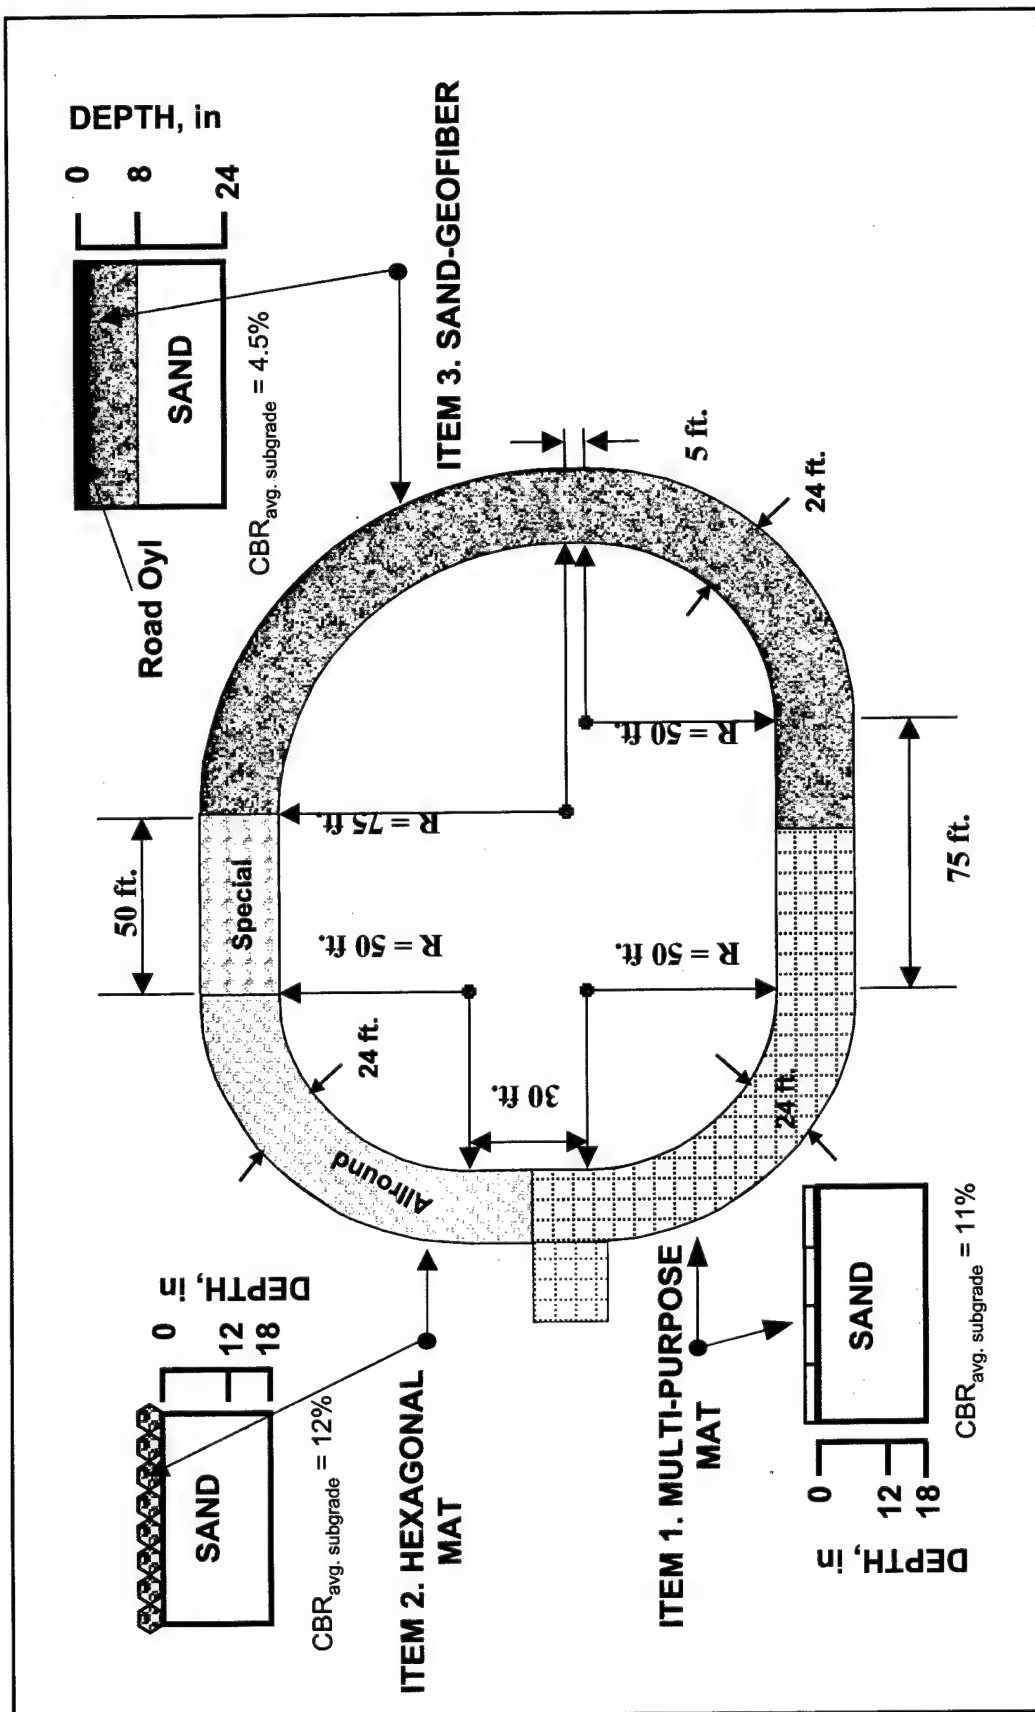


Figure 11. Full-scale field test section plan and profile view

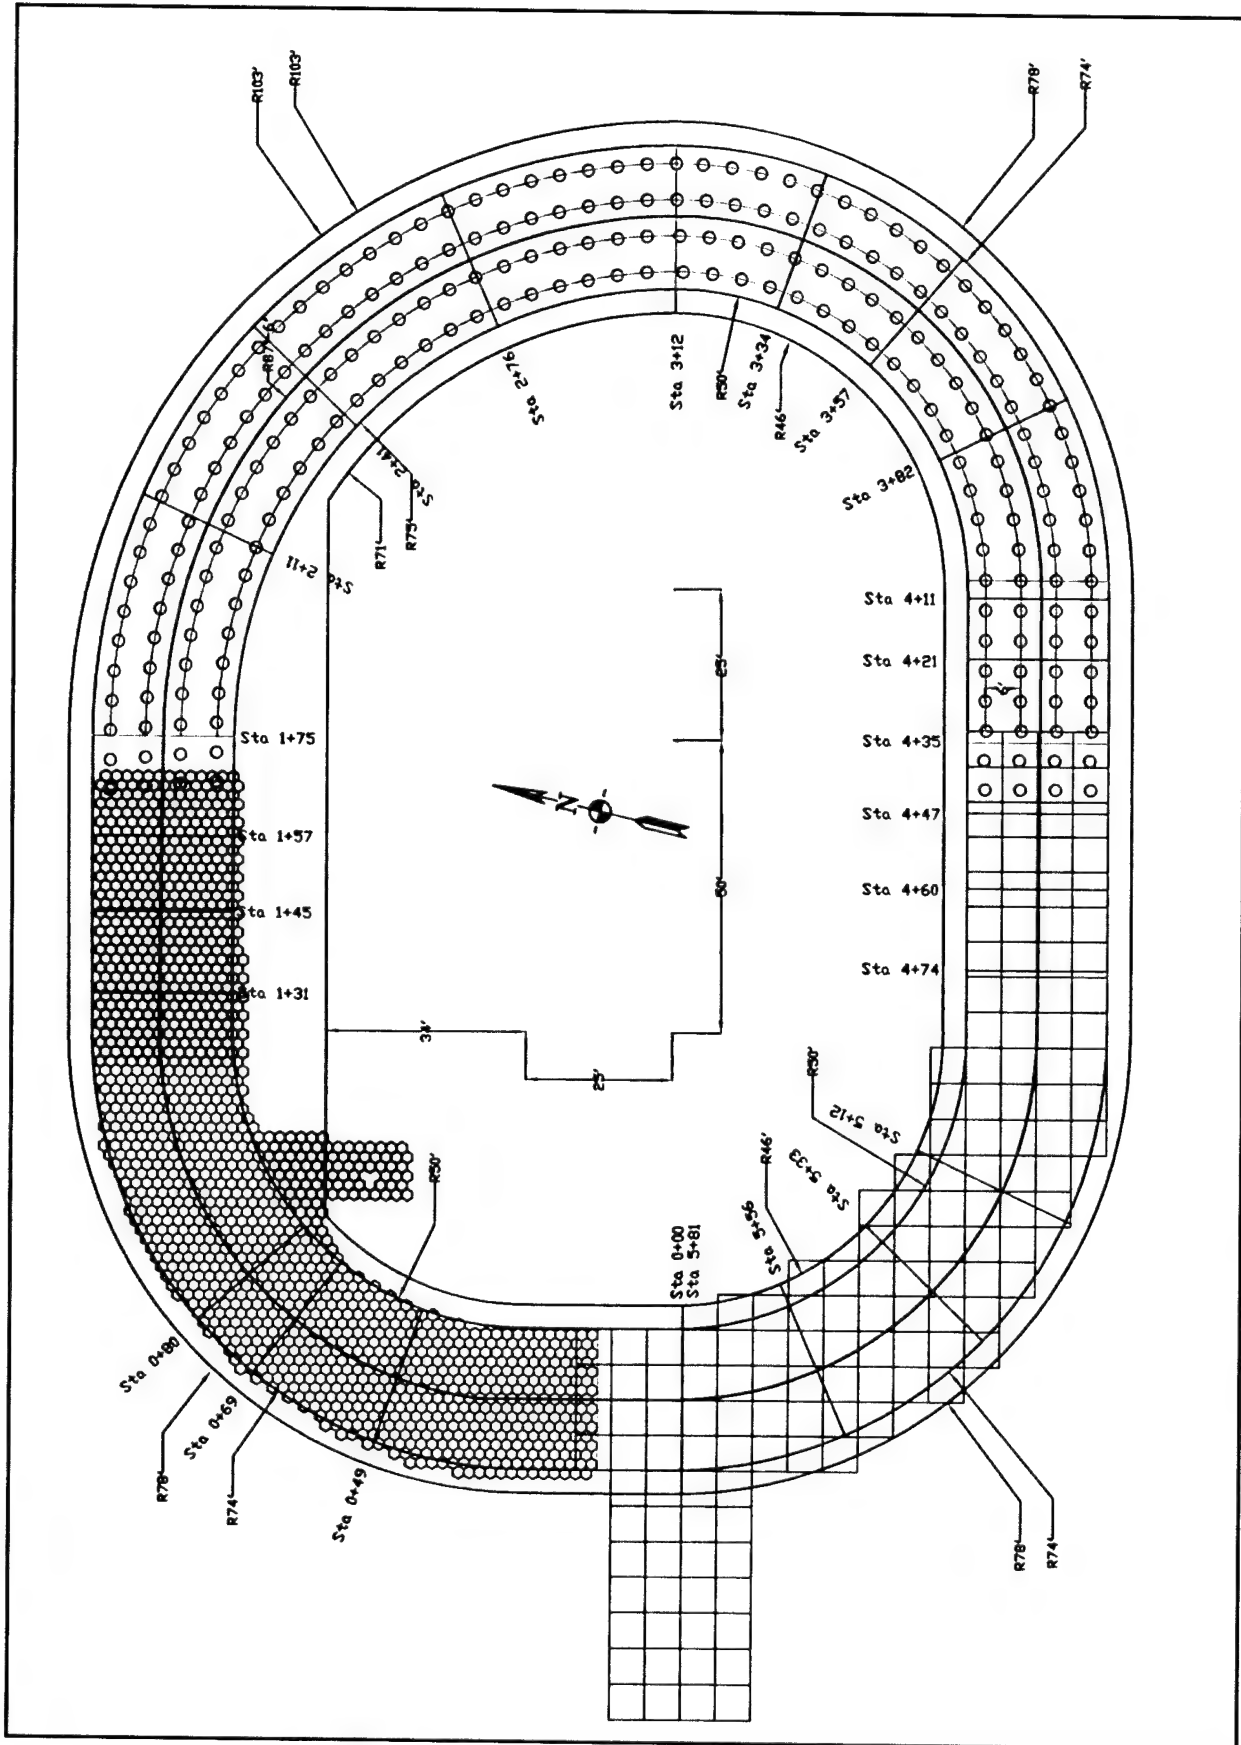


Figure 12. Plan view showing mat placement pattern

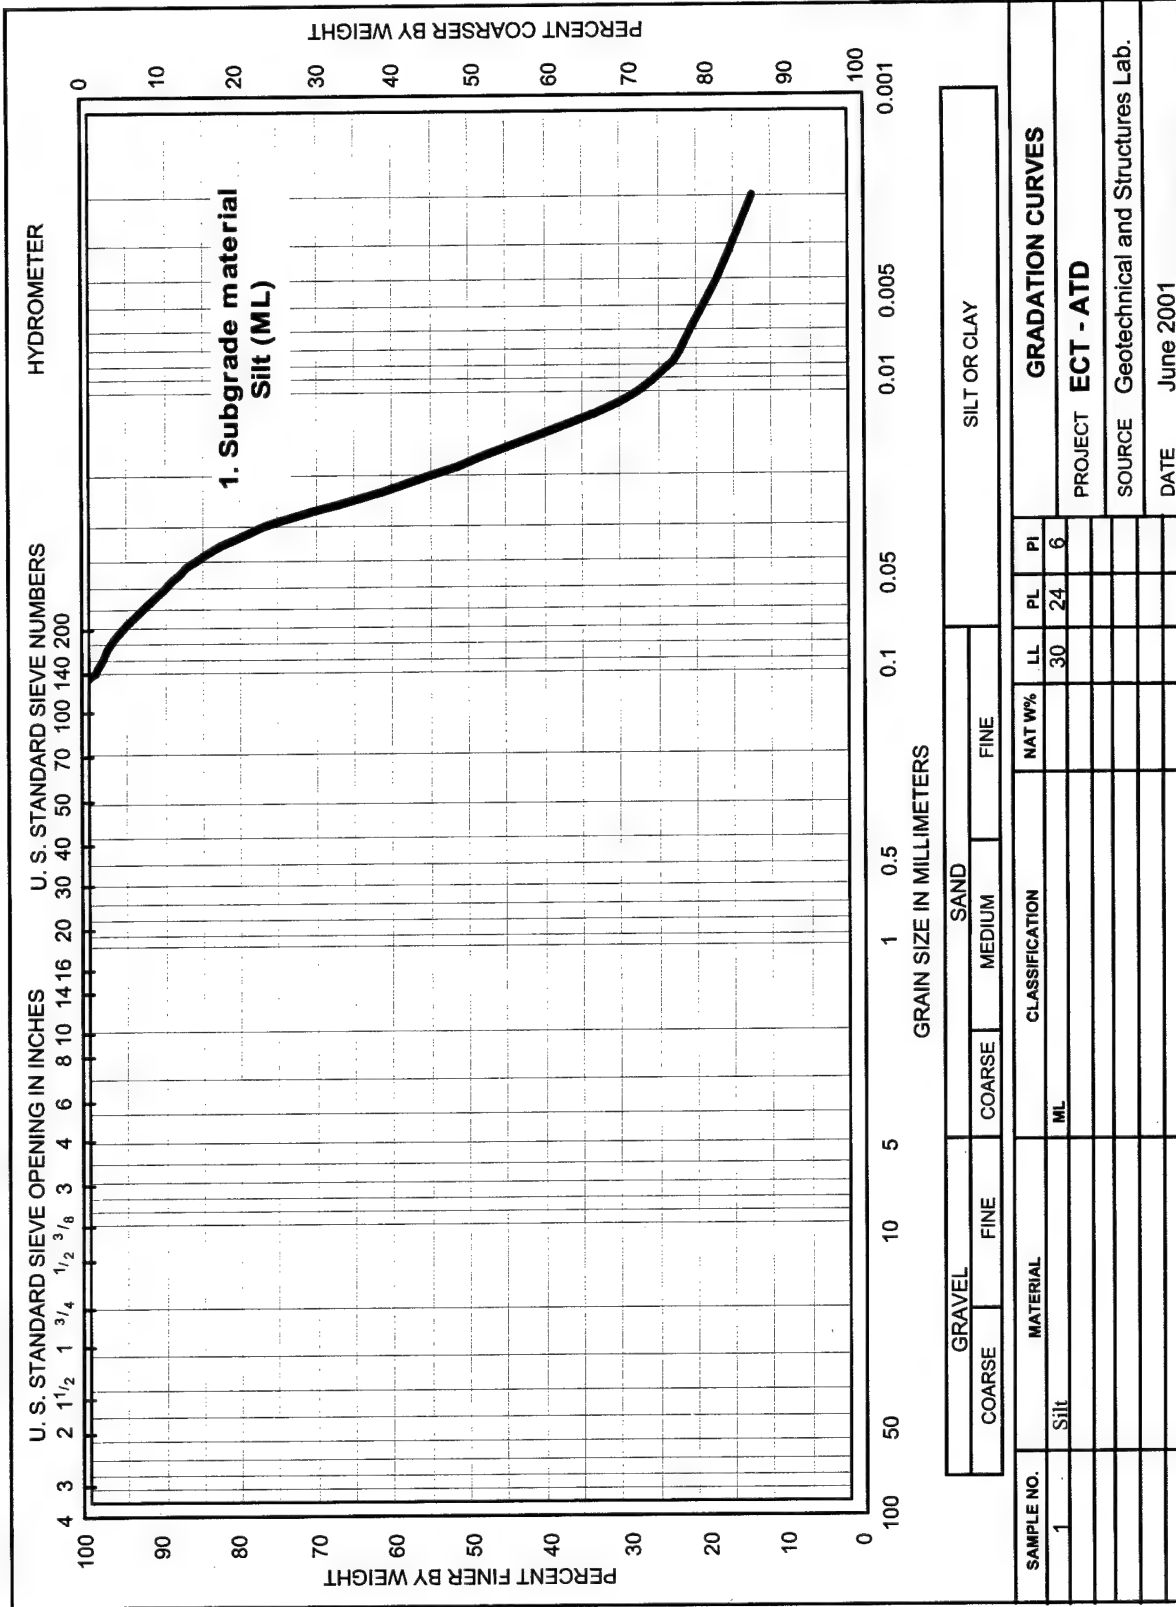


Figure 13. Classification data and gradation curve for dredge material

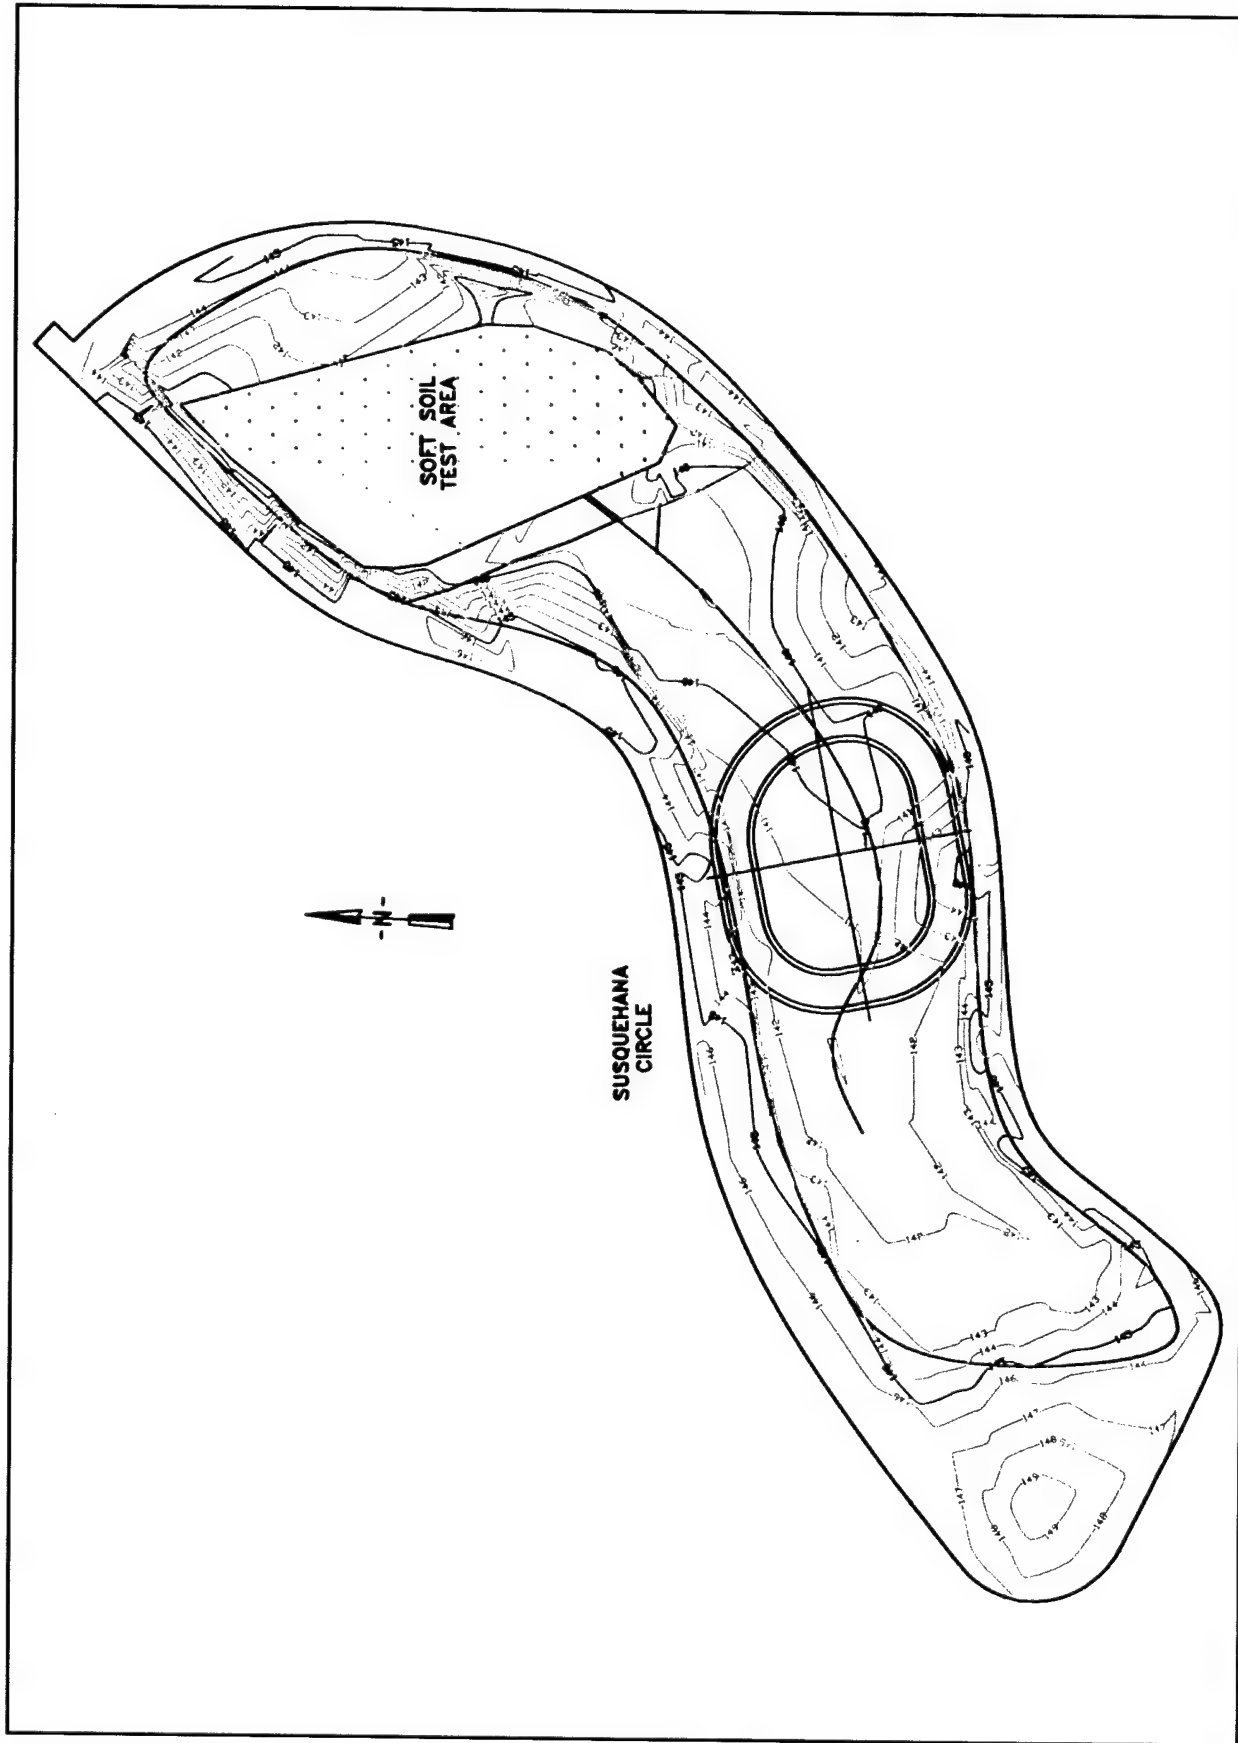


Figure 14. Elevations and plan view of the field site

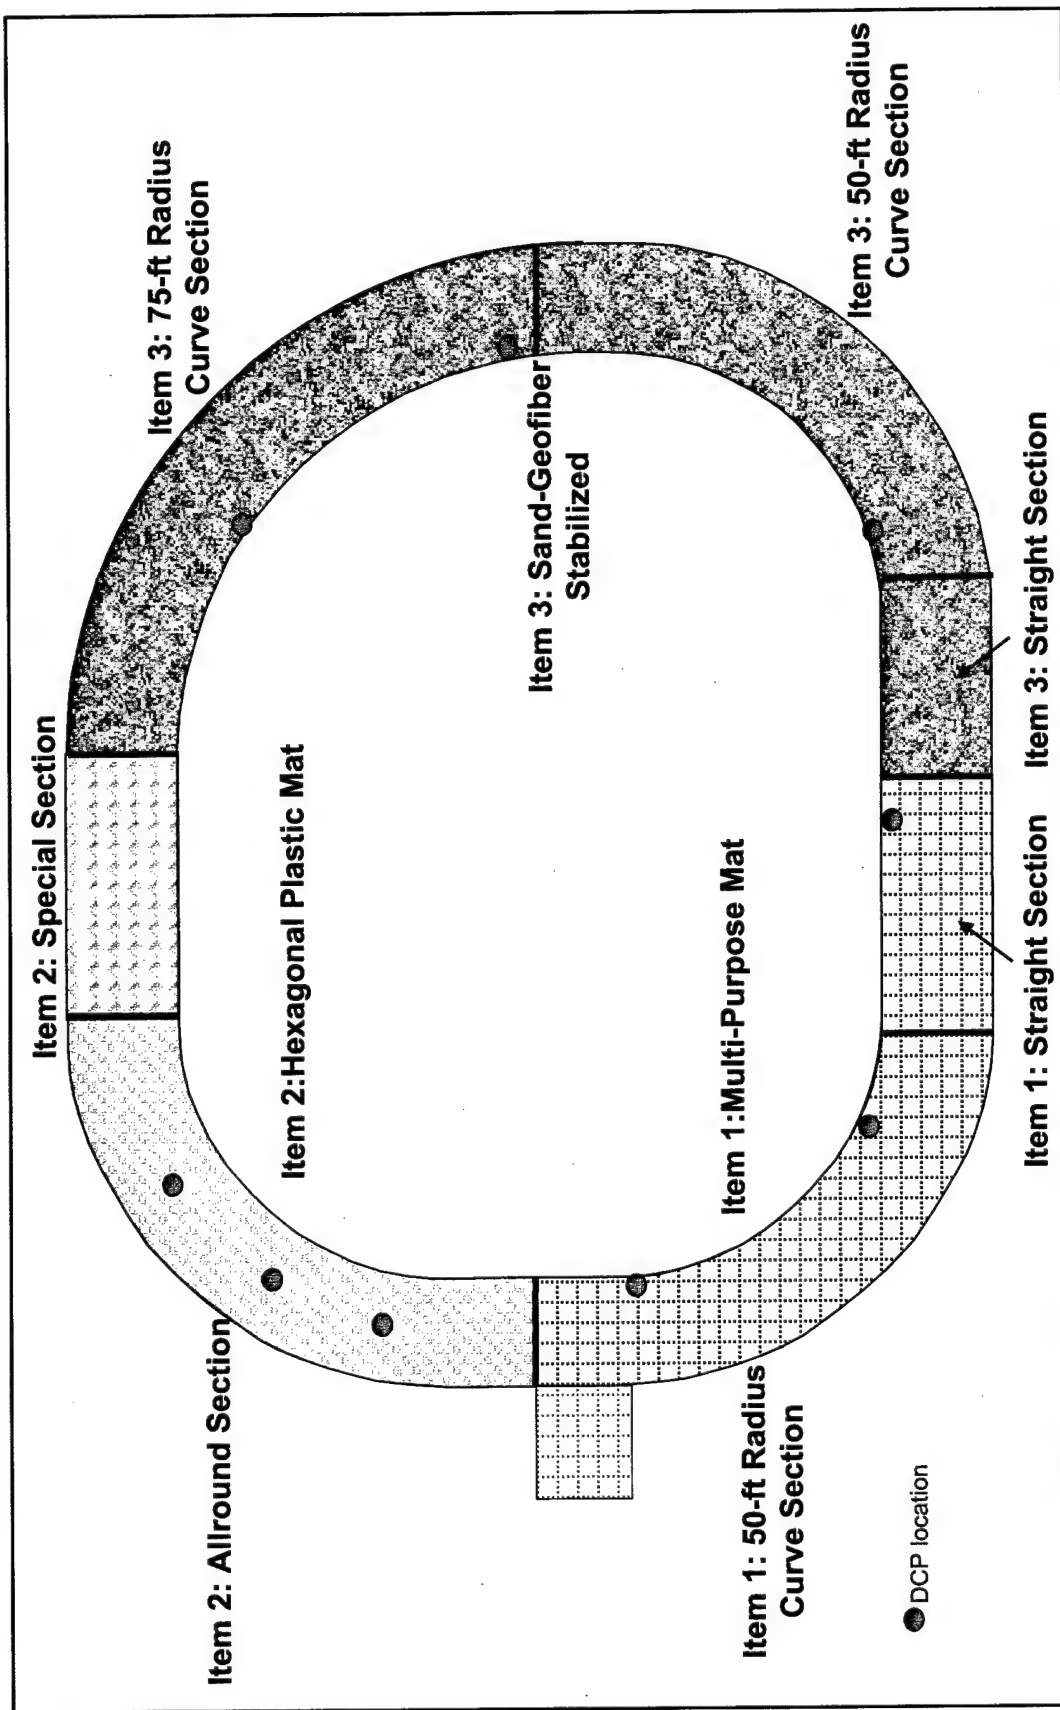


Figure 15. Item's sections layout

Connector Pin Assembly Instructions

Note: To assemble connector pin

- (1) Assemble washer on bolt and insert bolt thru top plate
- (2) Dip bottom 4 bolt threads in Loctite 242
- (3) Start bolt in bottom plate
- (4) Insert spacer guide
- (5) Hand tighten bolt to .25-in.-thick spacer guide
- (6) Remove spacer guide
- (7) Stand pin assembly on bolt head to allow loctite to cure 24 hrs.

0.25" thick Spacer Guide

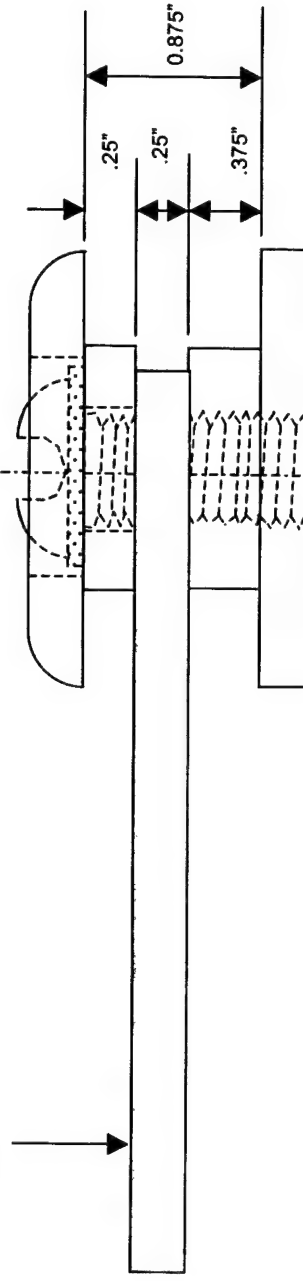


Figure 16. Connector pin assembly instructions

Pin Assembly Spacer Guide

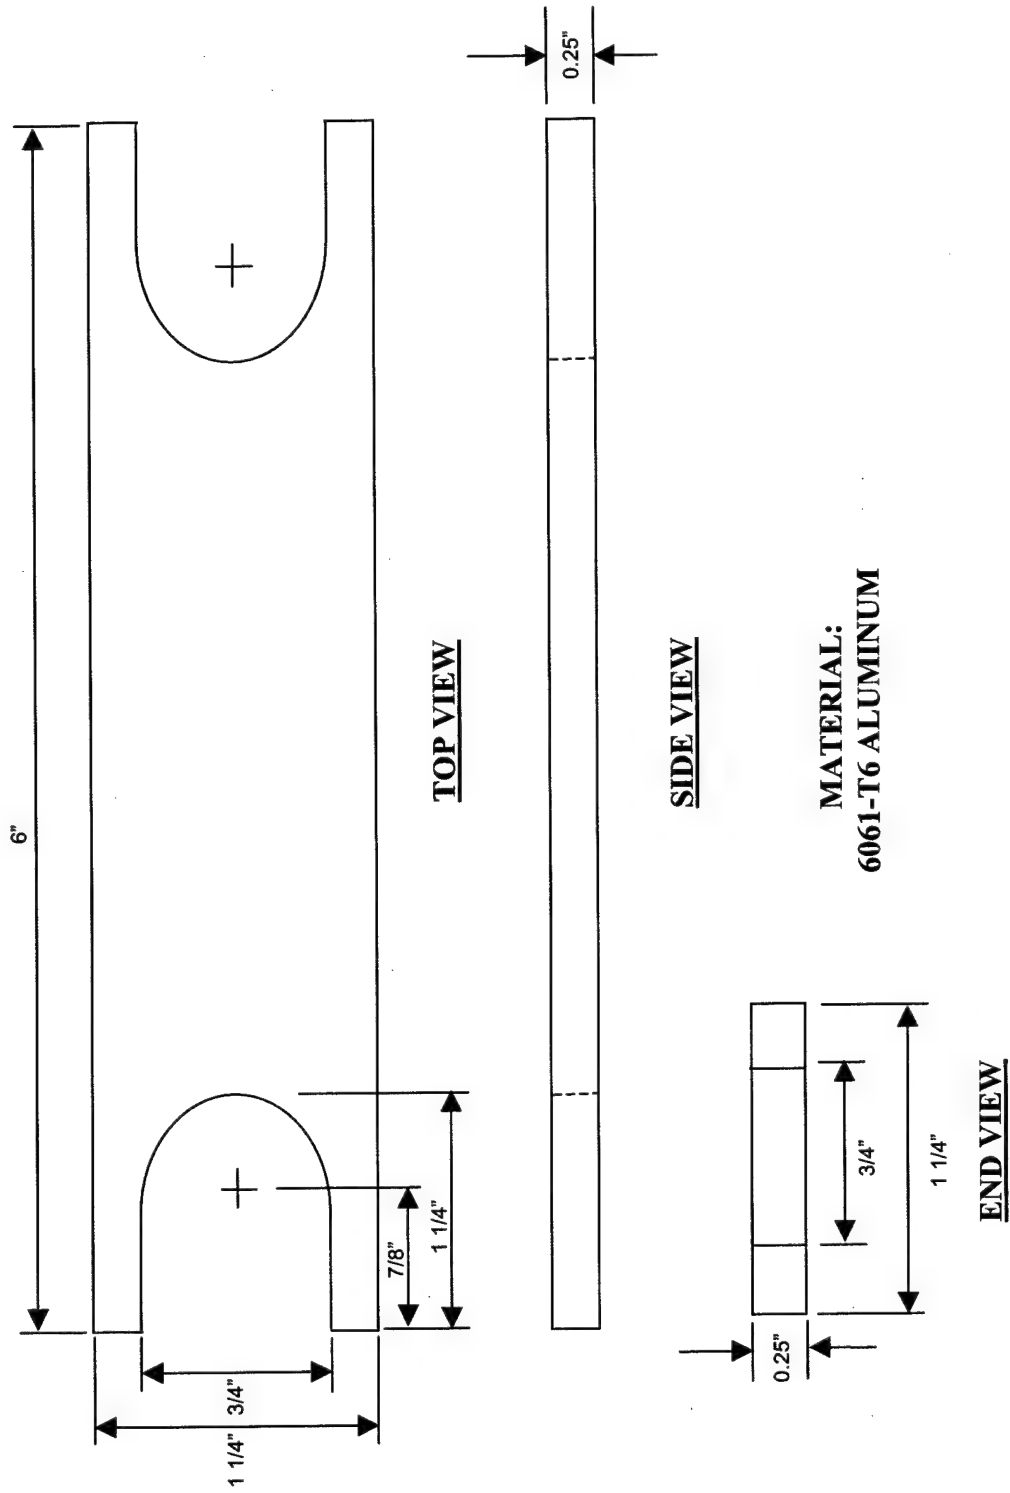


Figure 17. Spacer guide dimensions

Mat Hole Alignment Tool


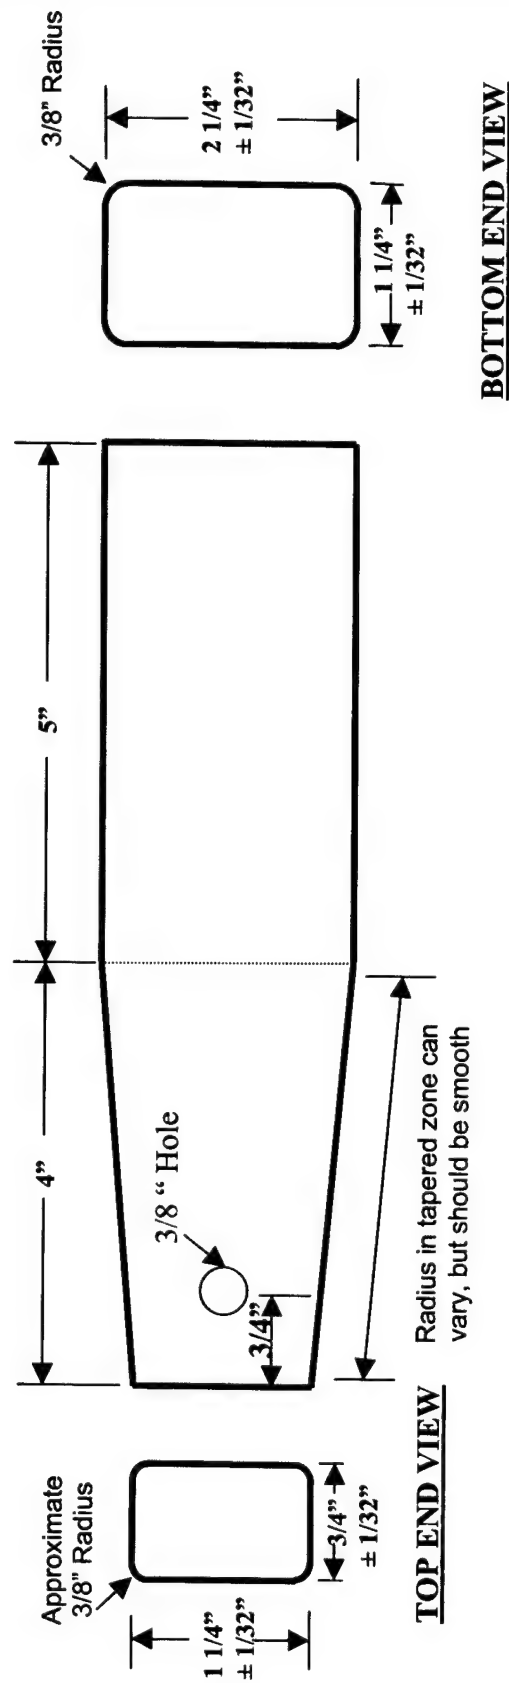


Figure 18. Alignment tool dimensions

Mats installed left to right

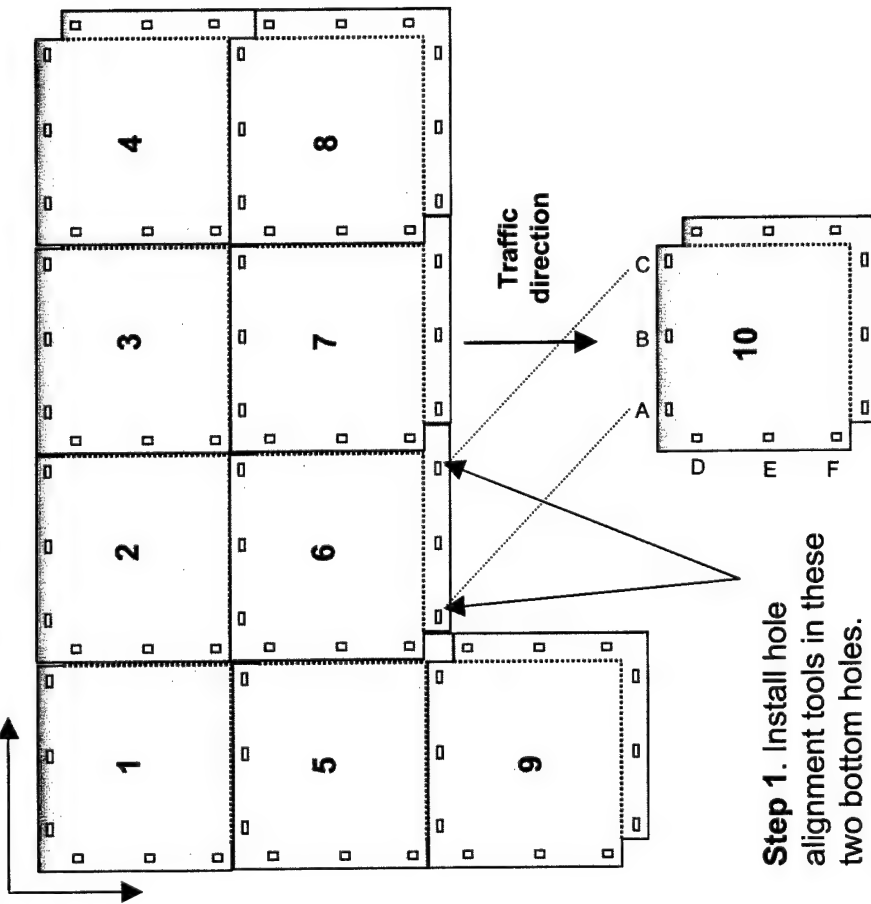

Step 5. Fully tighten pins in mats 1 thru 8 only after pins have been installed in mats 9 thru 12.

Step 4. Use alignment tools to form depression in sand and align mat holes D, E, & F. Insert pins in holes D, E, & F (tighten no more than 1 turns).

Step 3. Use alignment tools to form depression in sand and align mat holes A, B, & C. Insert pins in holes A, B, & C (tighten no more than 1 turn).

Step 1. Install hole alignment tools in these two bottom holes.

Step 2. Install new MP mat over the two hole alignment tools.

Not to Scale

Figure 19. MP mat installation procedure

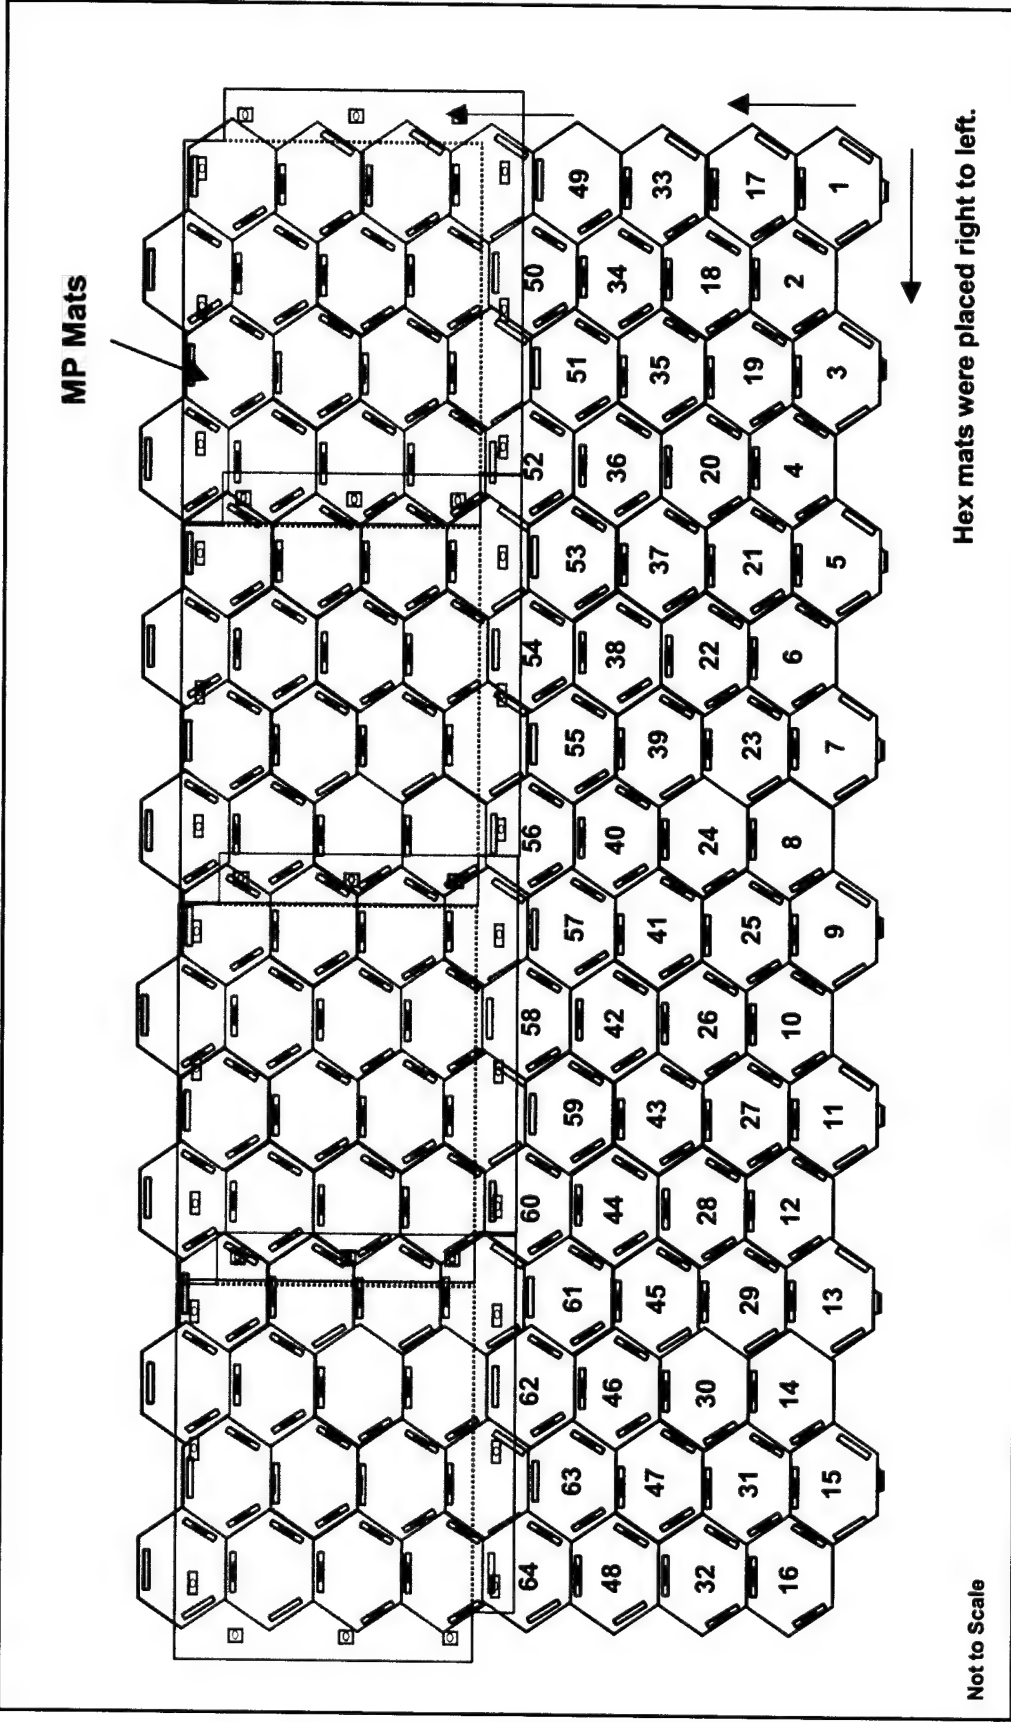


Figure 20. Placement pattern for Allround hexagonal plastic mat

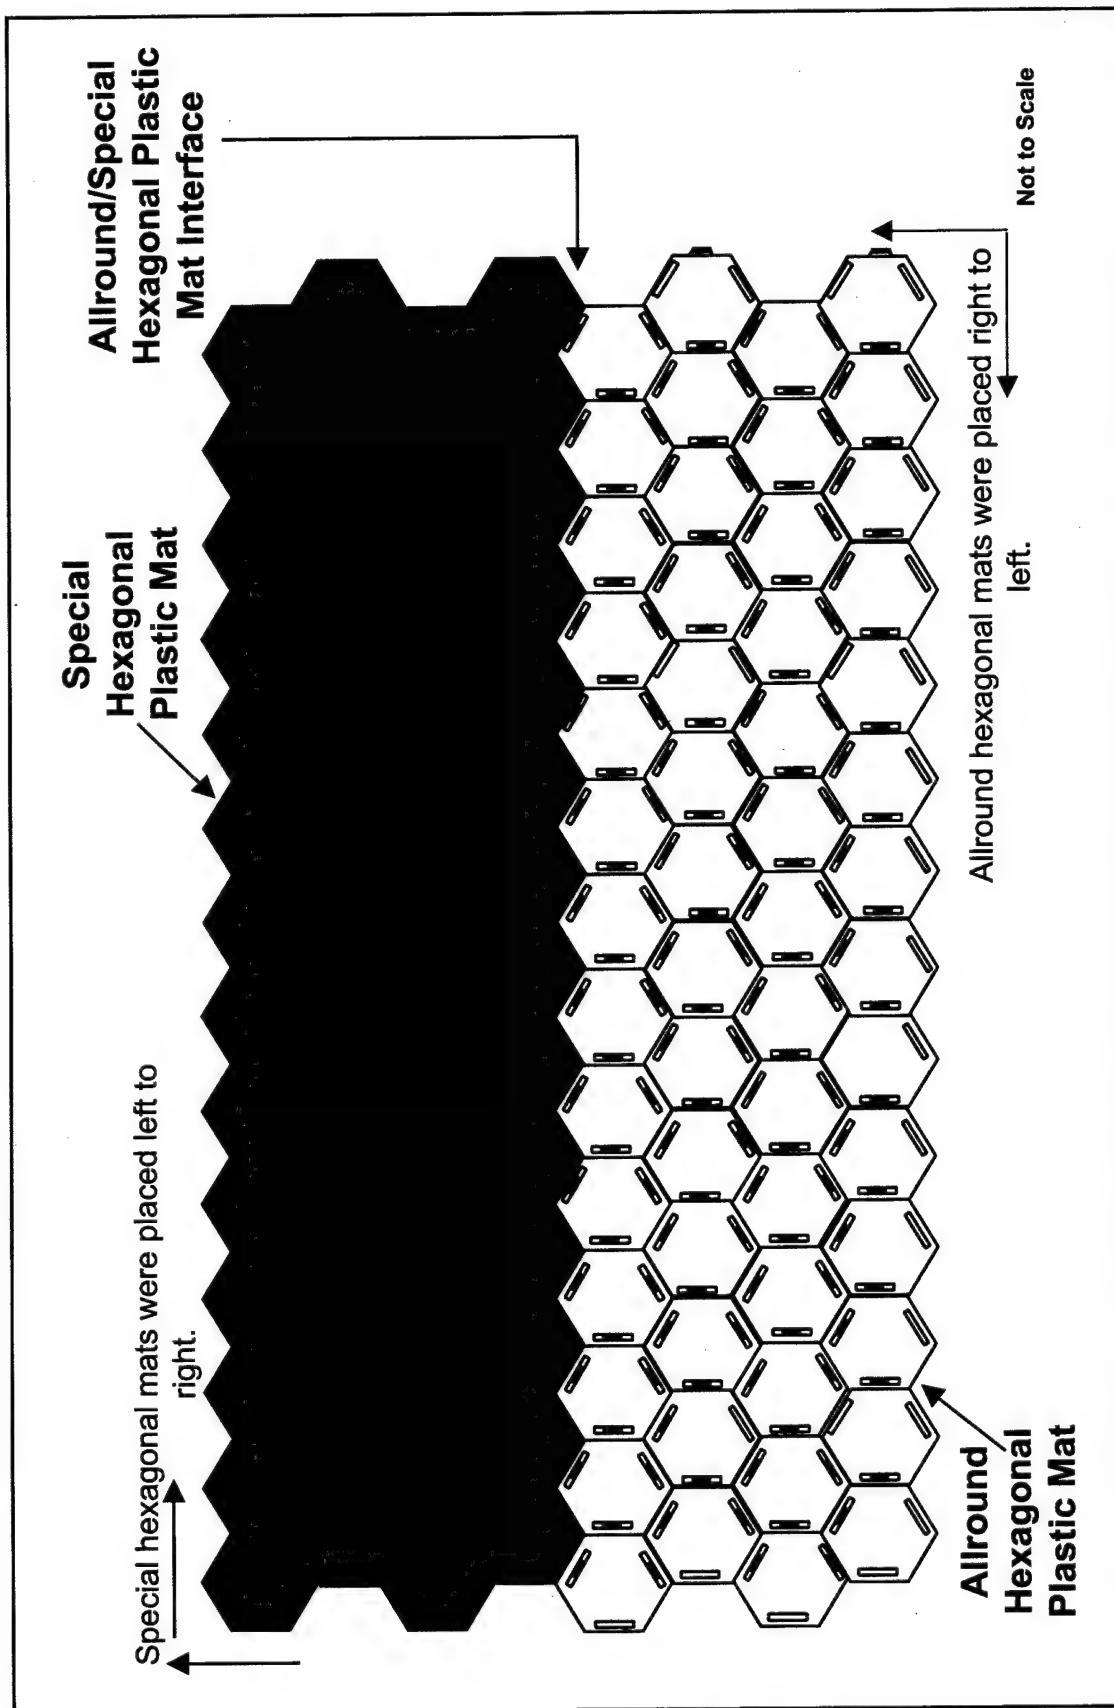


Figure 21. Placement pattern for Special hexagonal plastic mat and transition zone between mats

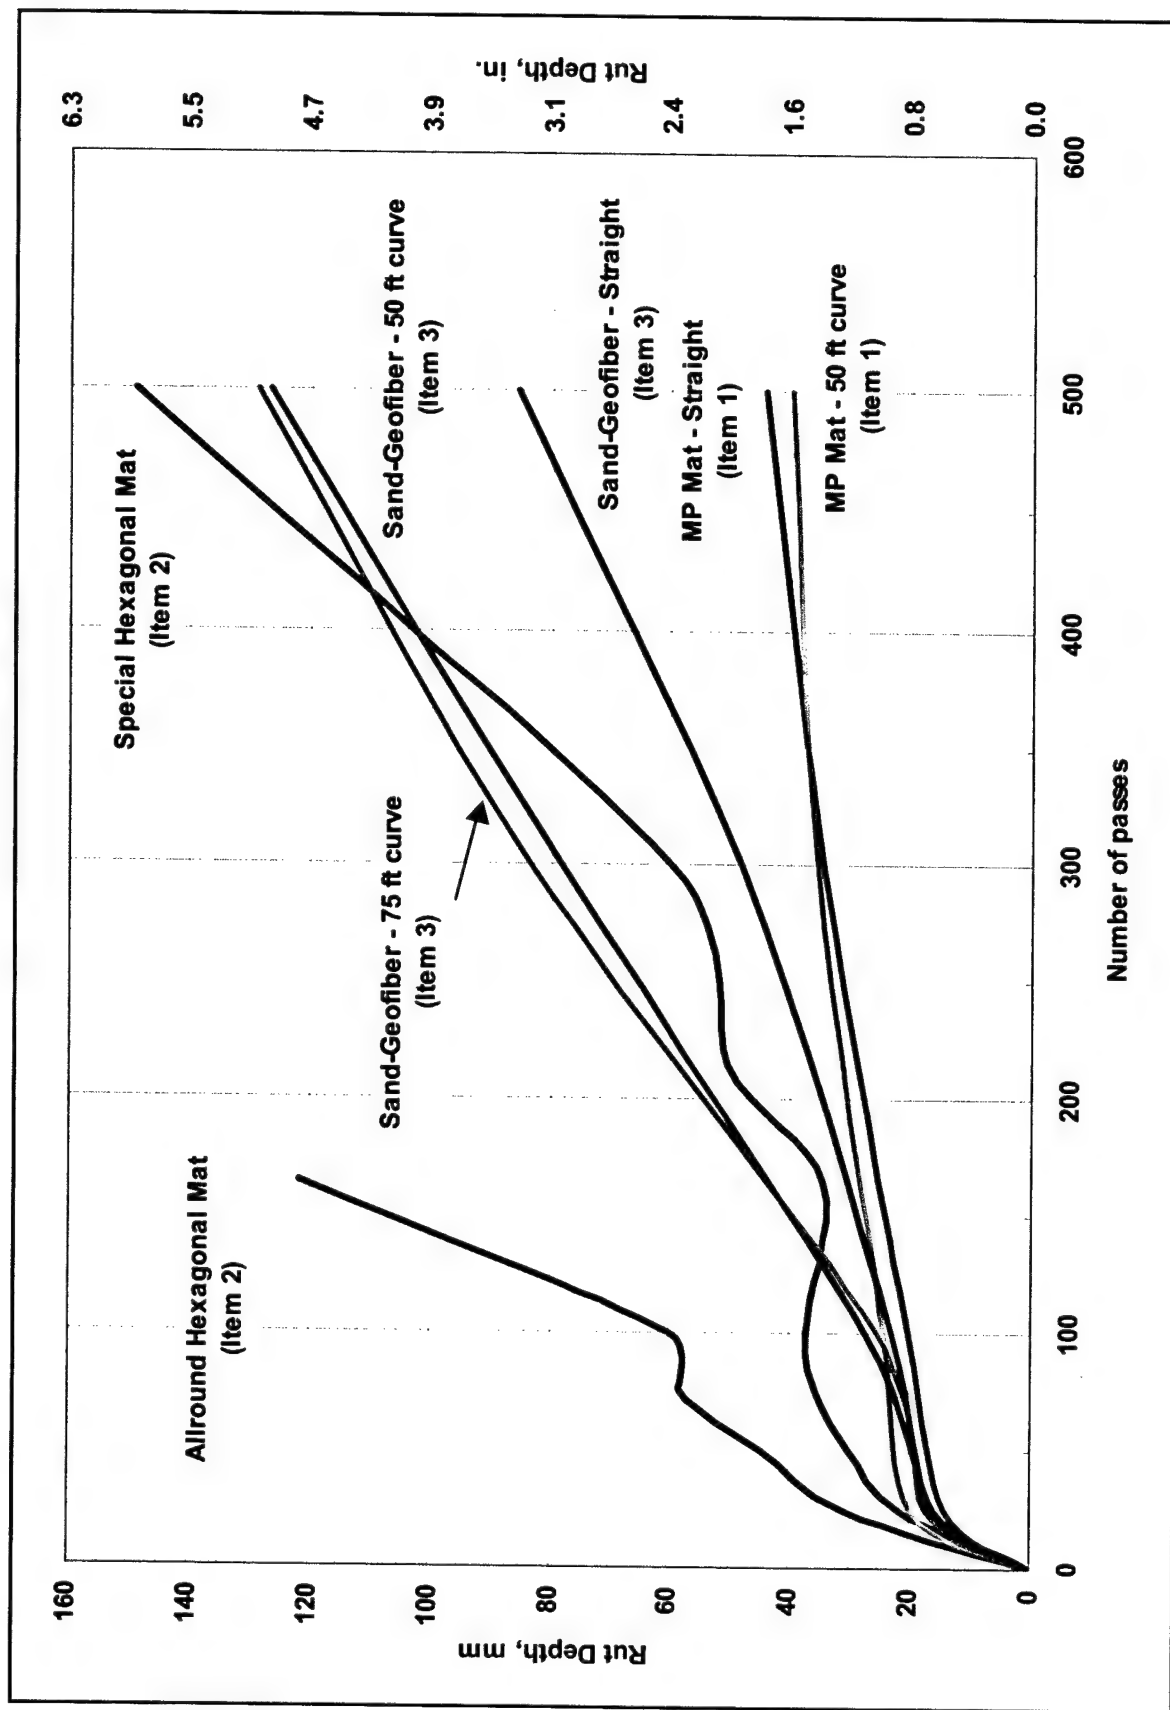


Figure 22. Rut depth measurement for Items 1 to 3

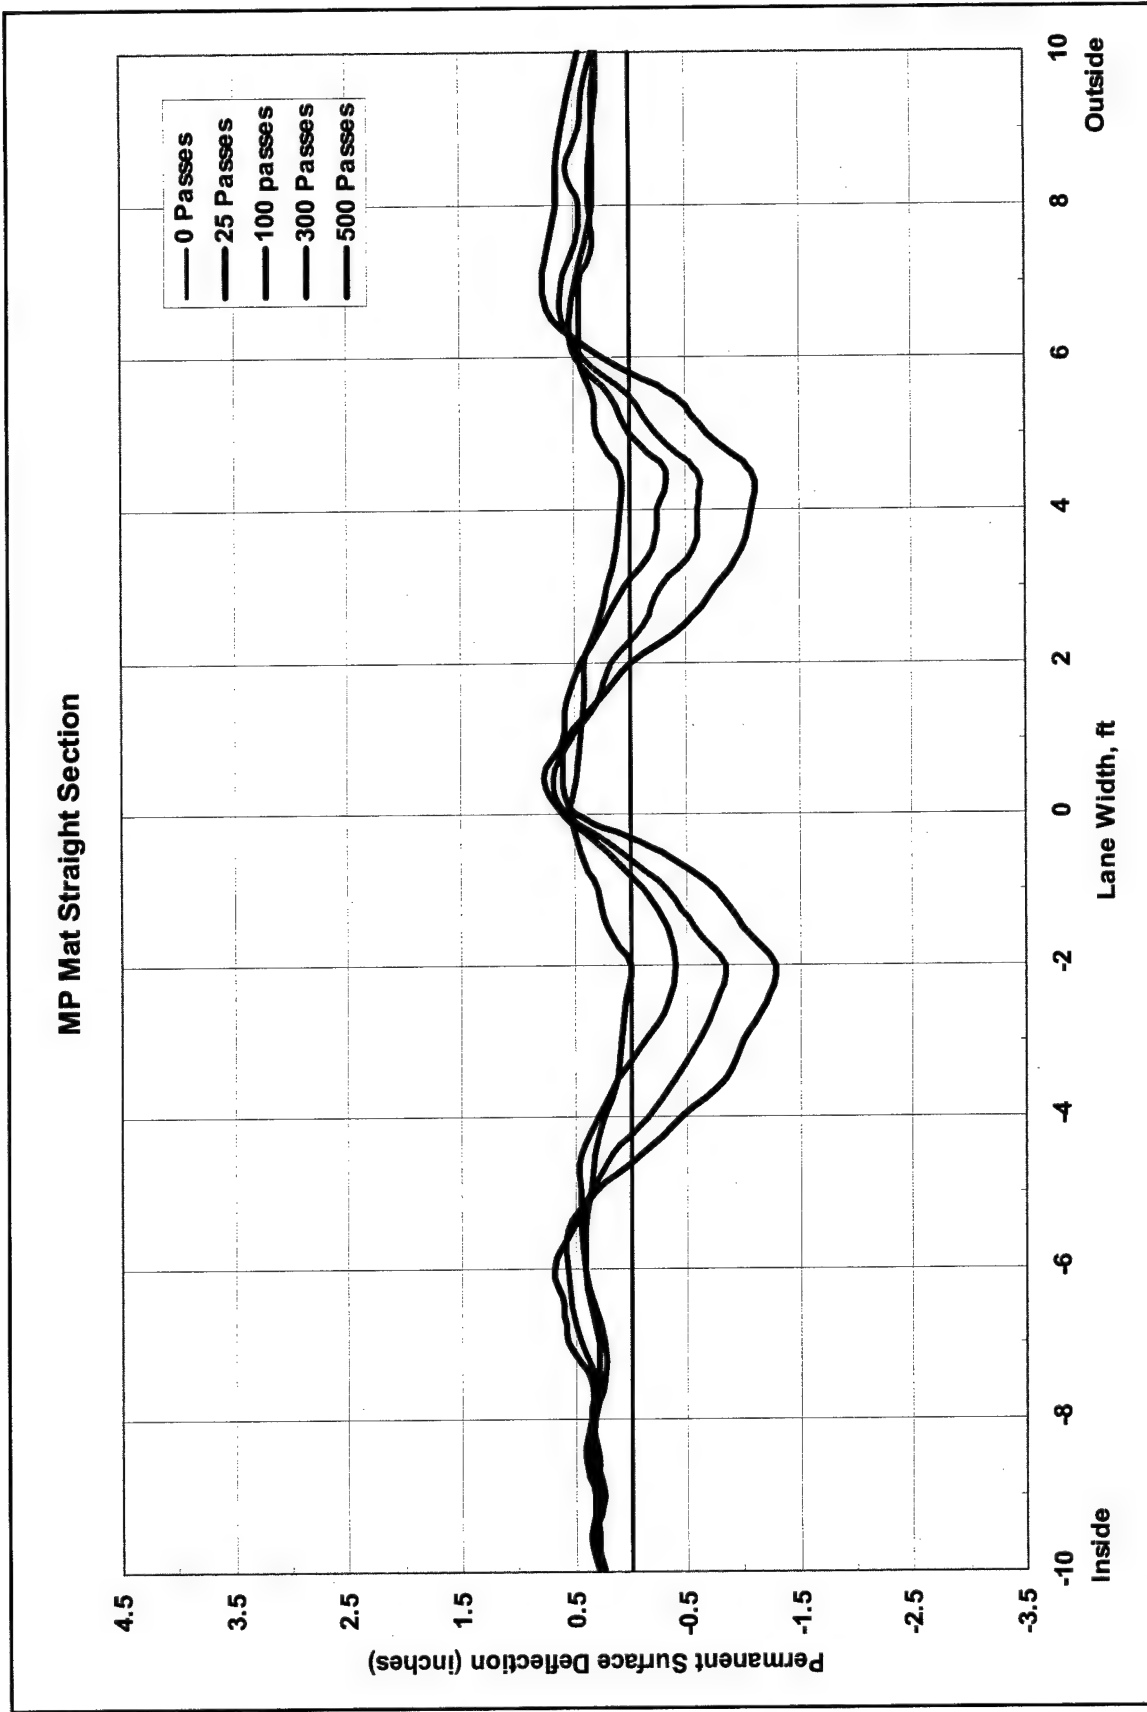


Figure 23. Cross section profile for the MP mat straight section

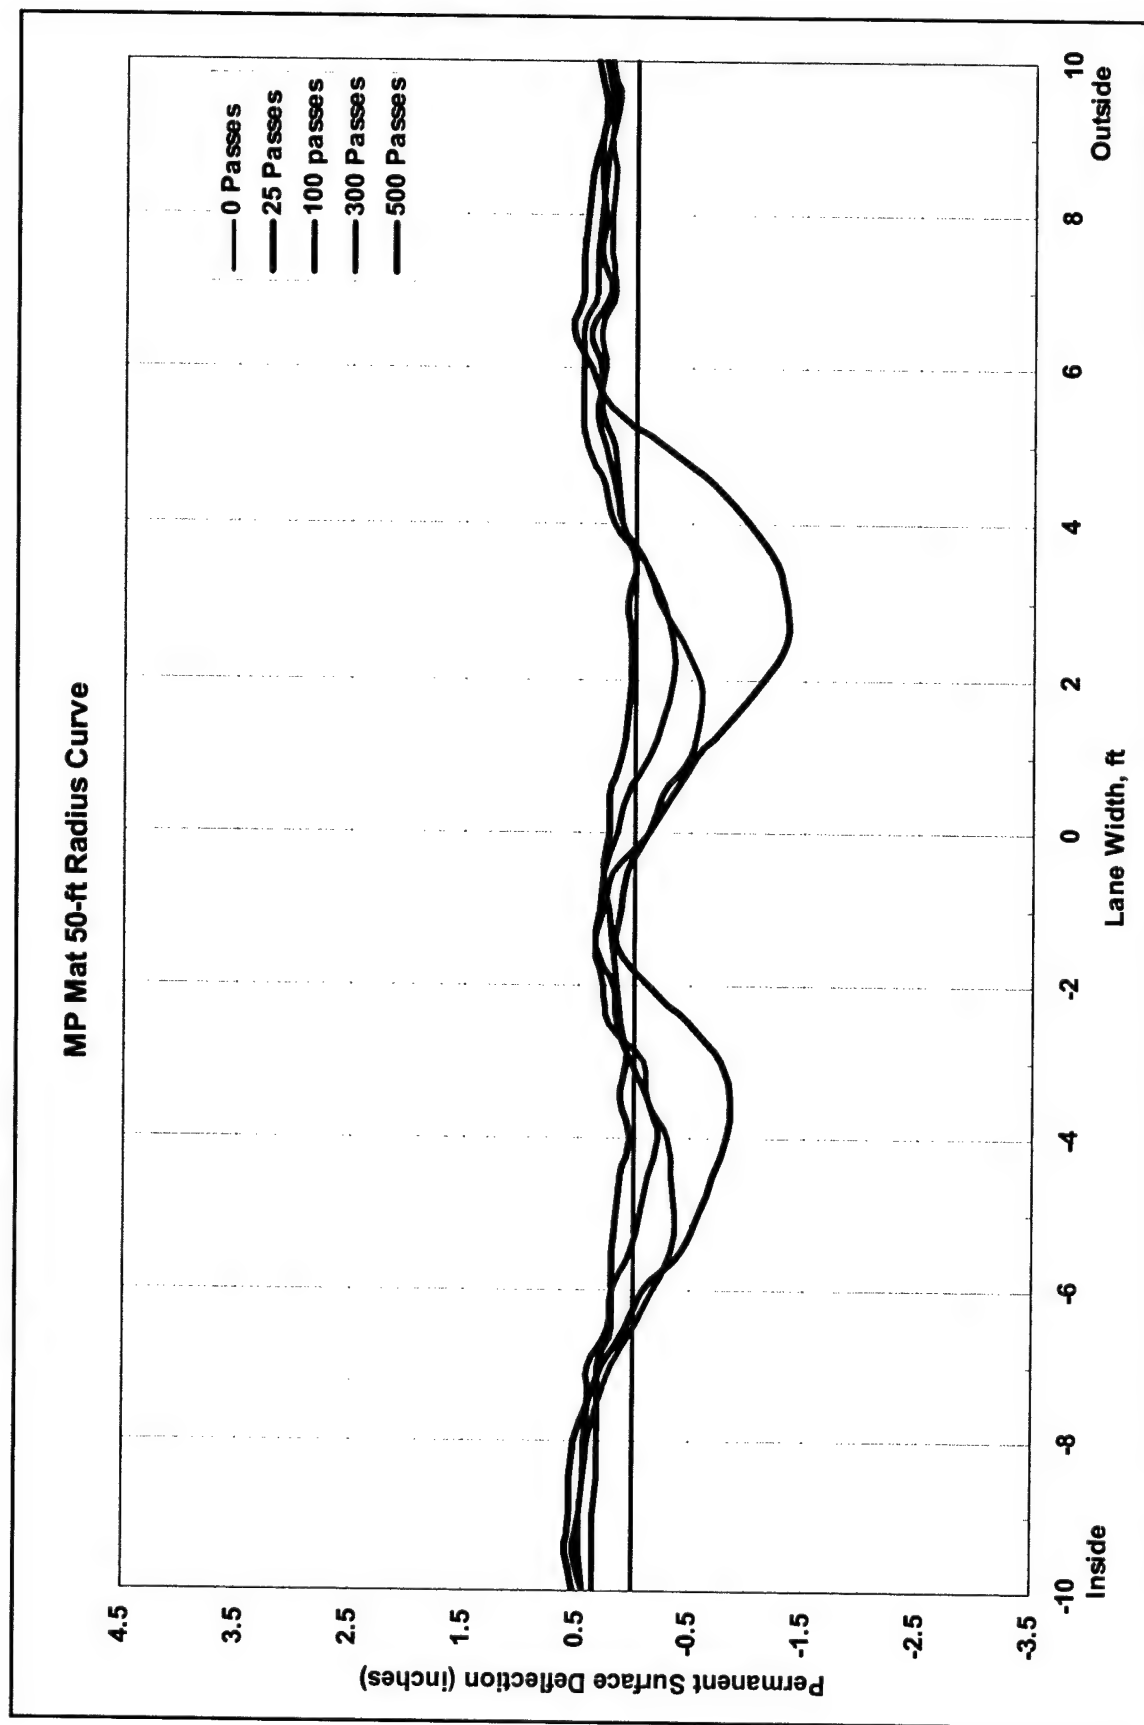


Figure 24. Cross section profile for the MP mat 50-ft radius curved section

Allround Hexagonal Plastic Mat 50-ft Radius Curve

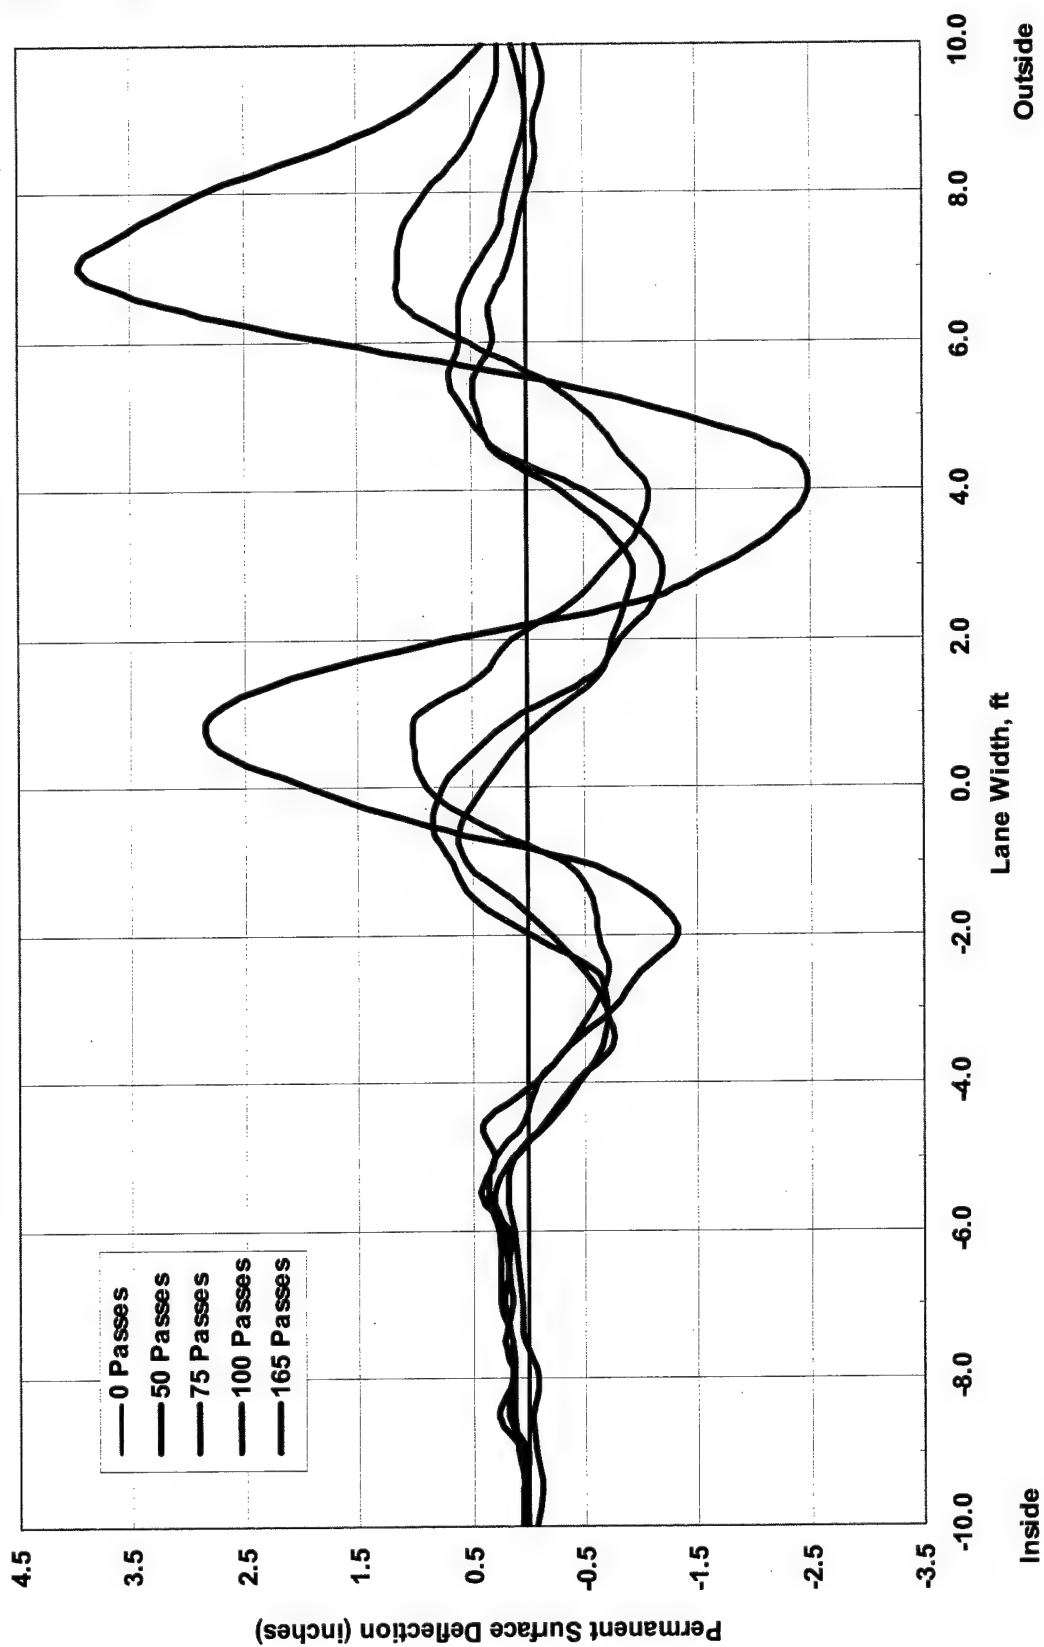


Figure 25. Cross section profile for the Allround hexagonal plastic section

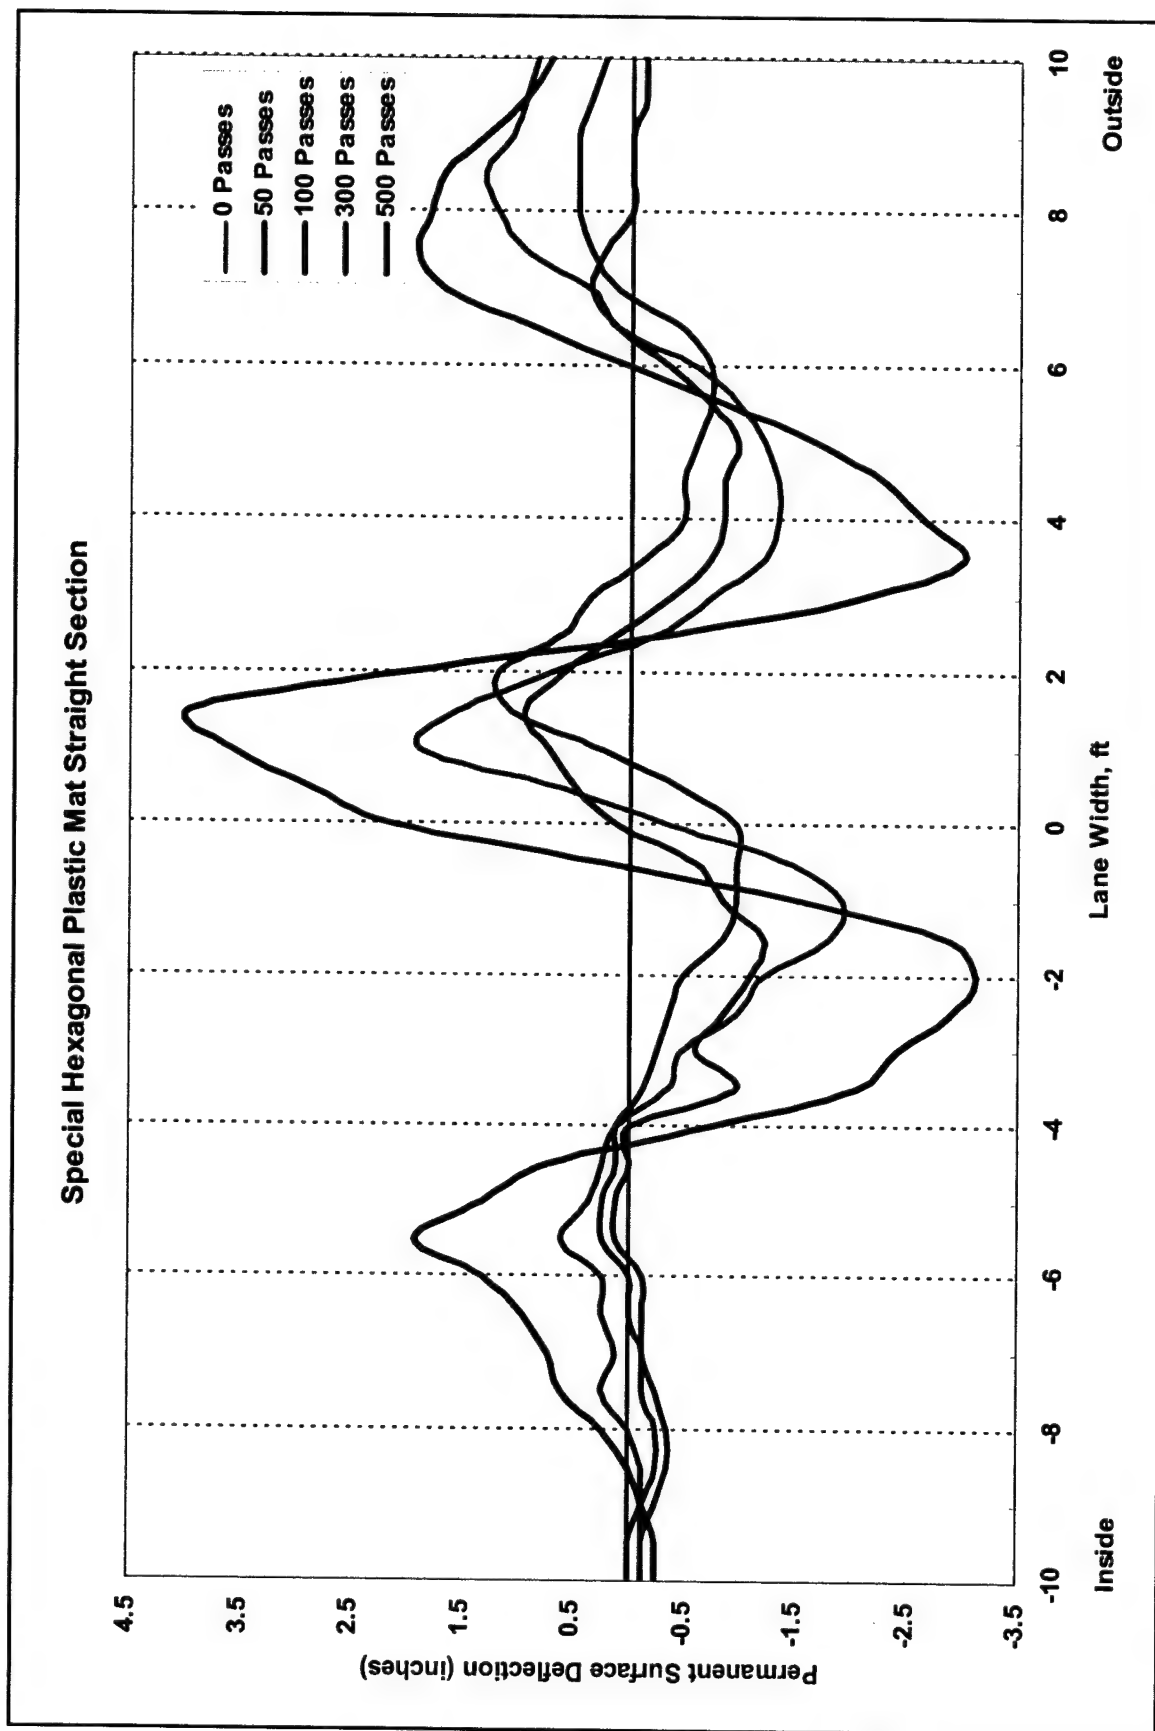


Figure 26. Cross section profile for the Special hexagonal plastic section

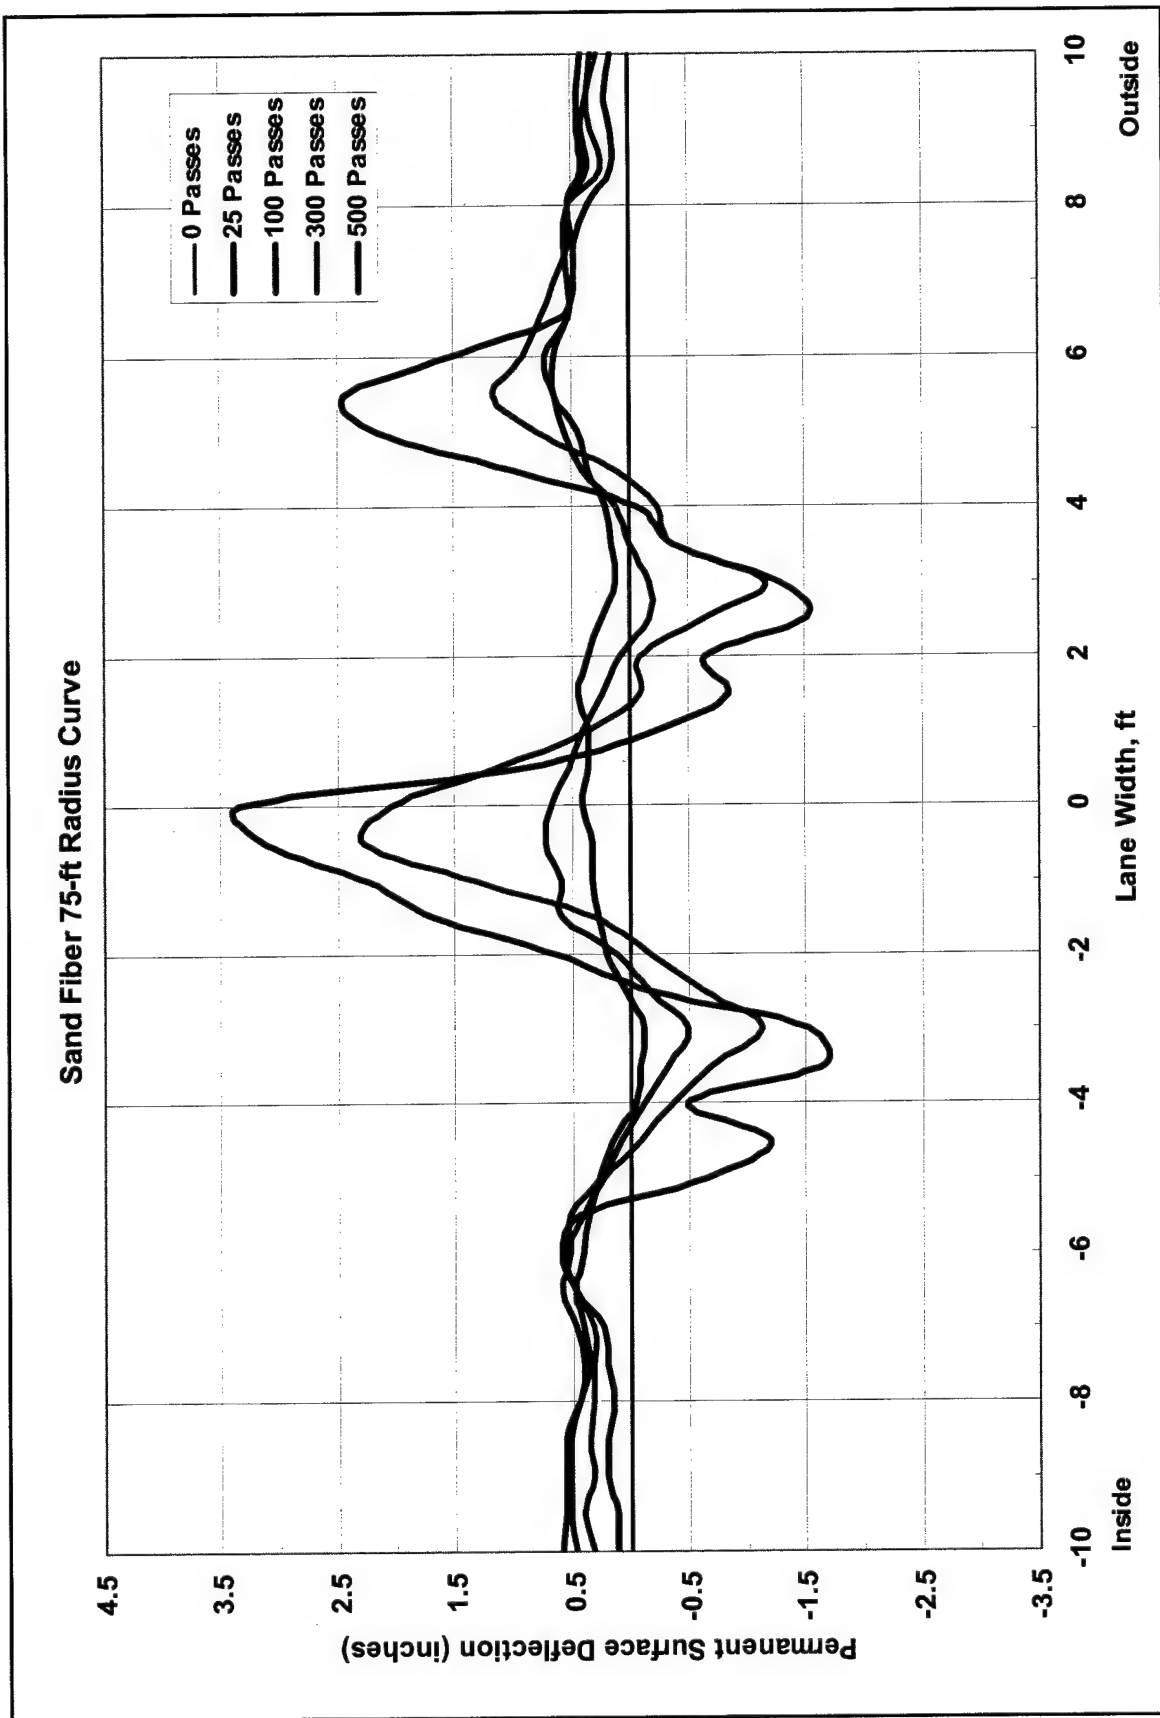


Figure 27. Cross section profile for the sand-geofiber 75-ft radius curved section

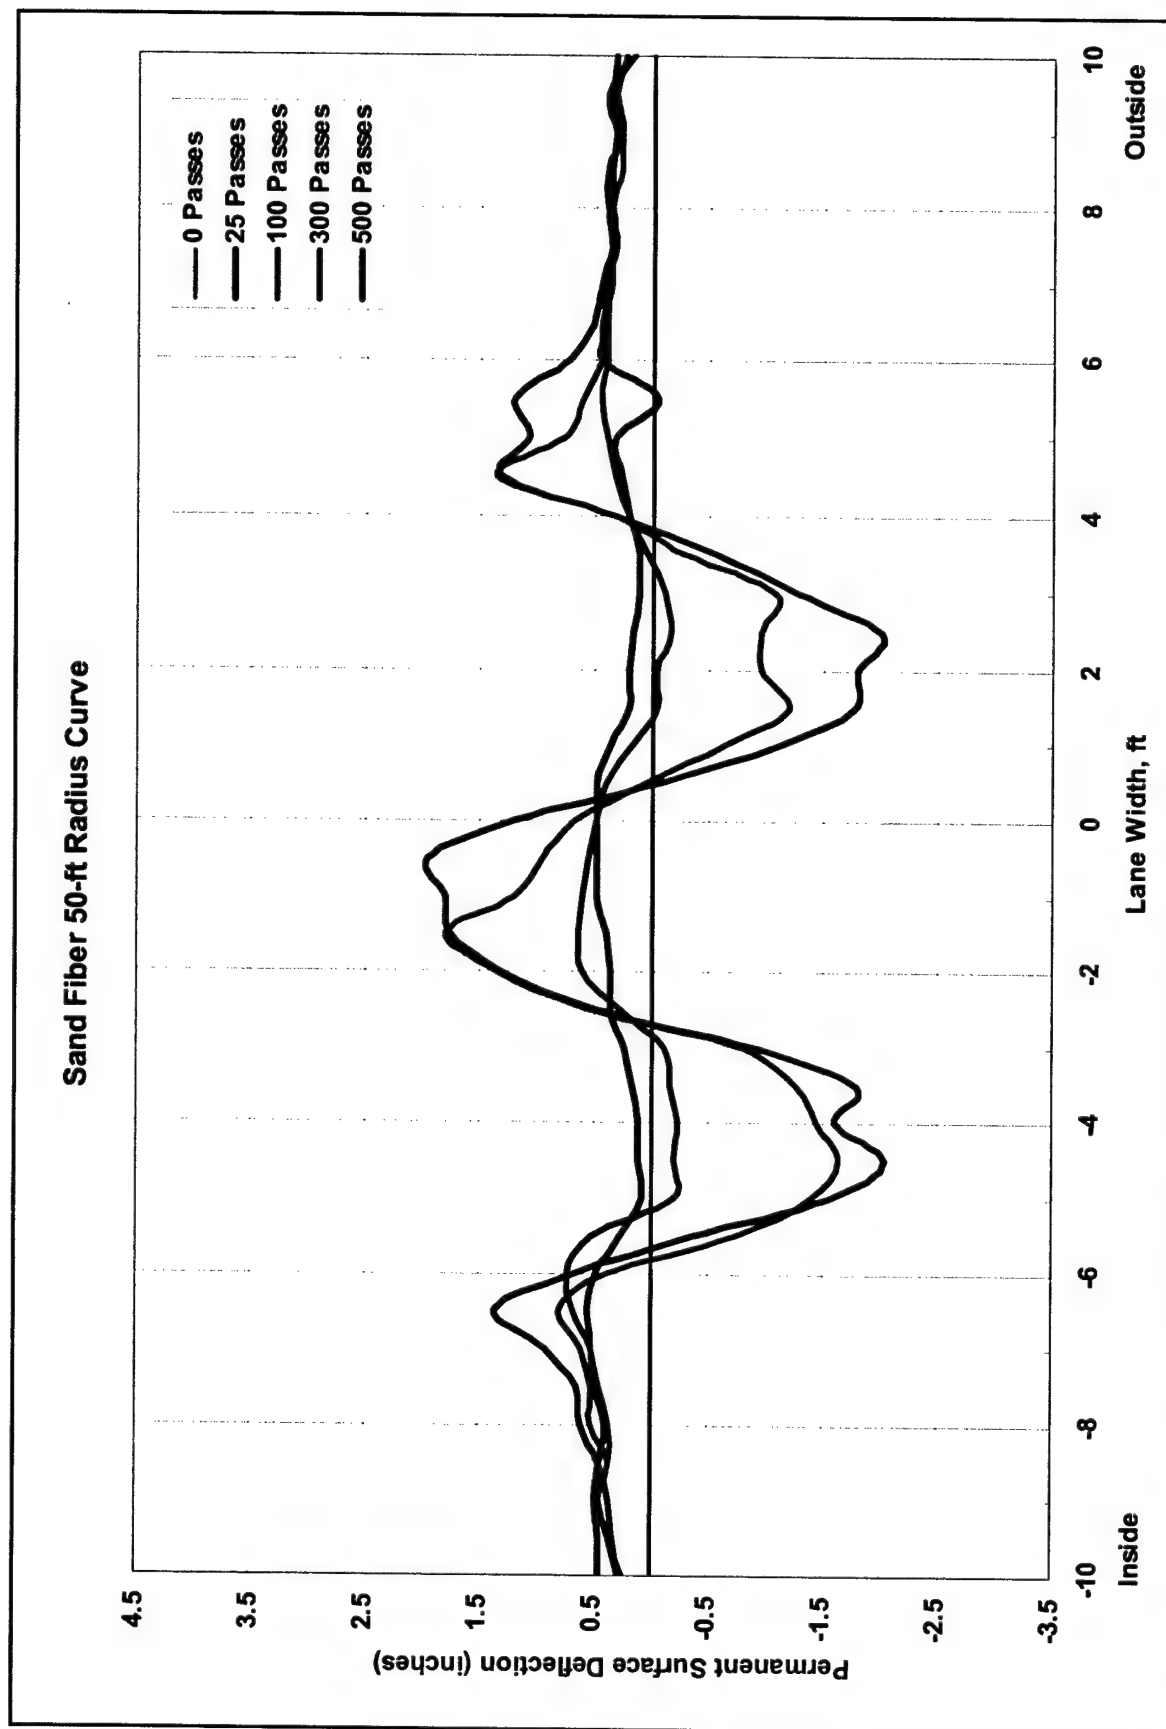


Figure 28. Cross section profile for the sand-geofiber 50-ft radius curved section

Sand Fiber Straight Section

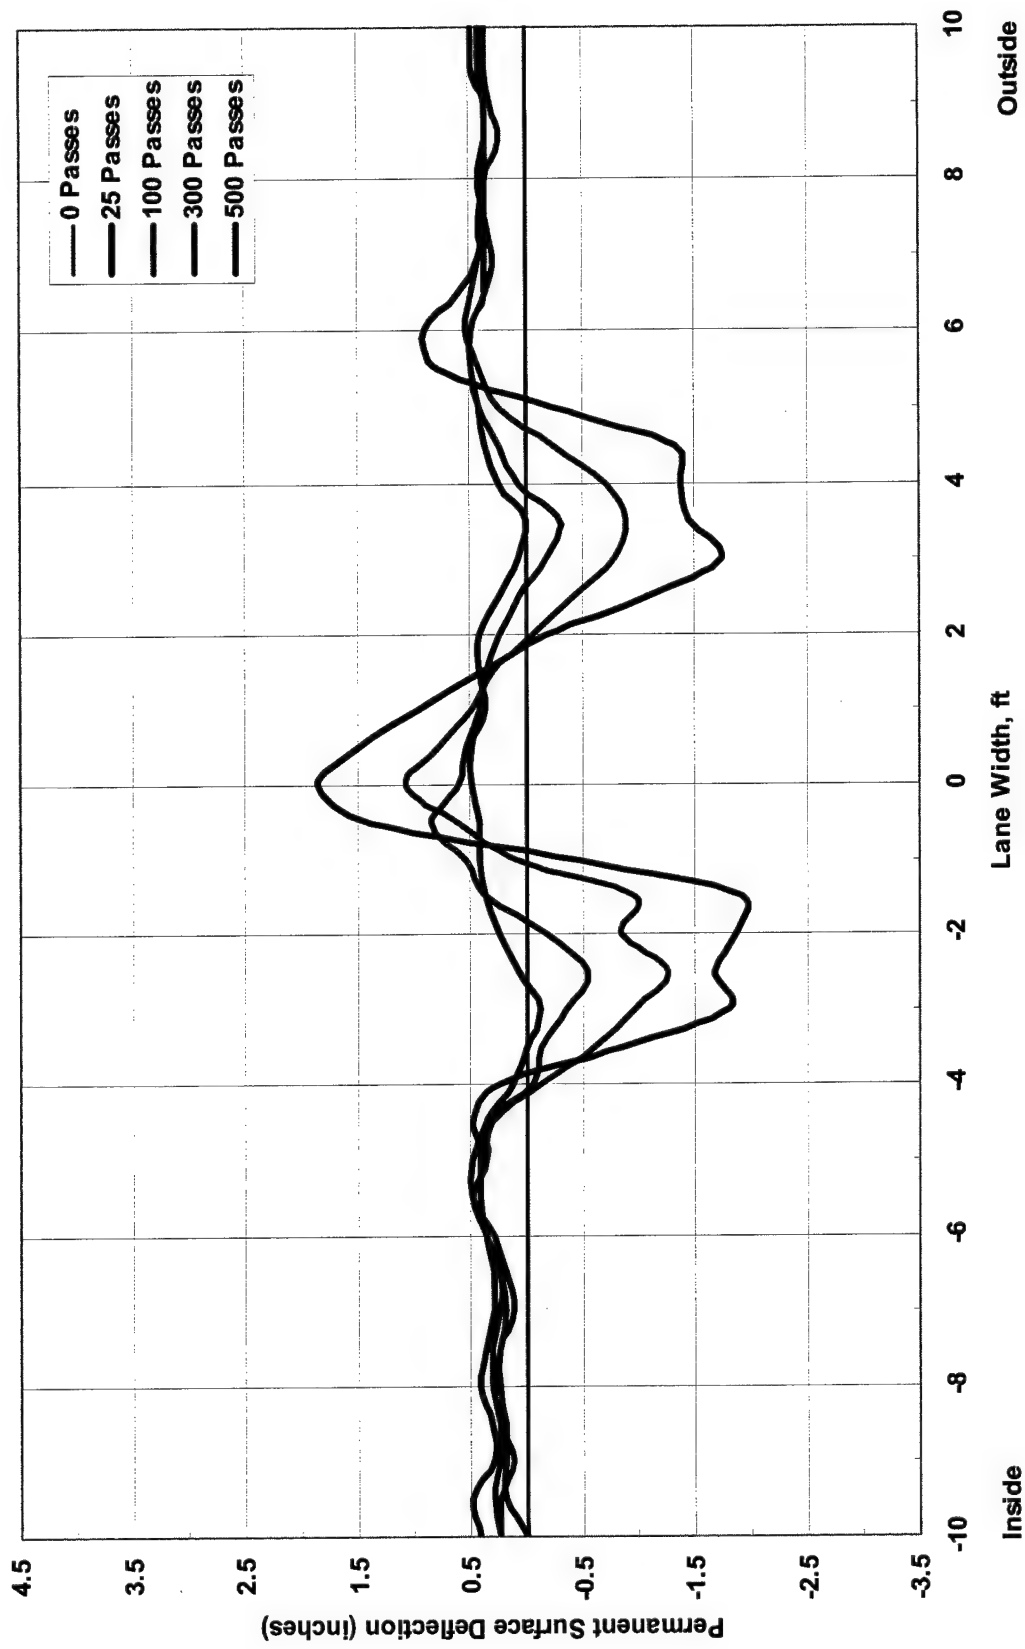


Figure 29. Cross section profile for the sand-geofiber straight section

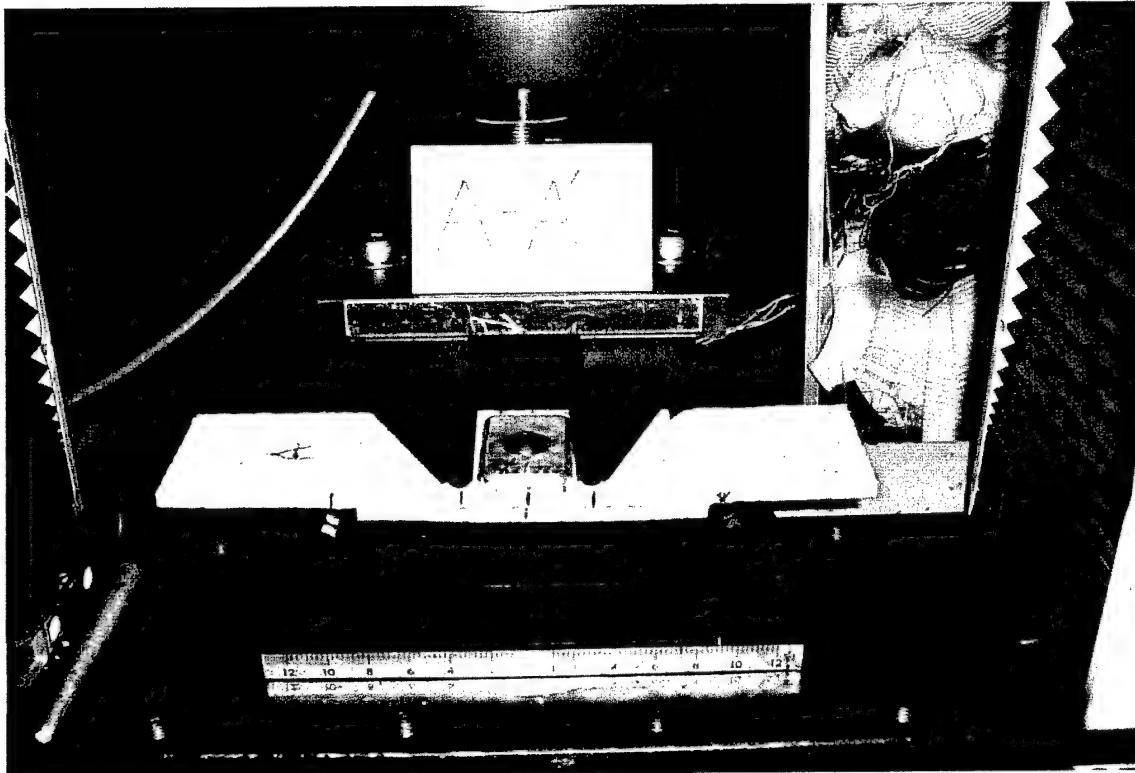


Photo 1. Modified 3-point beam connector test

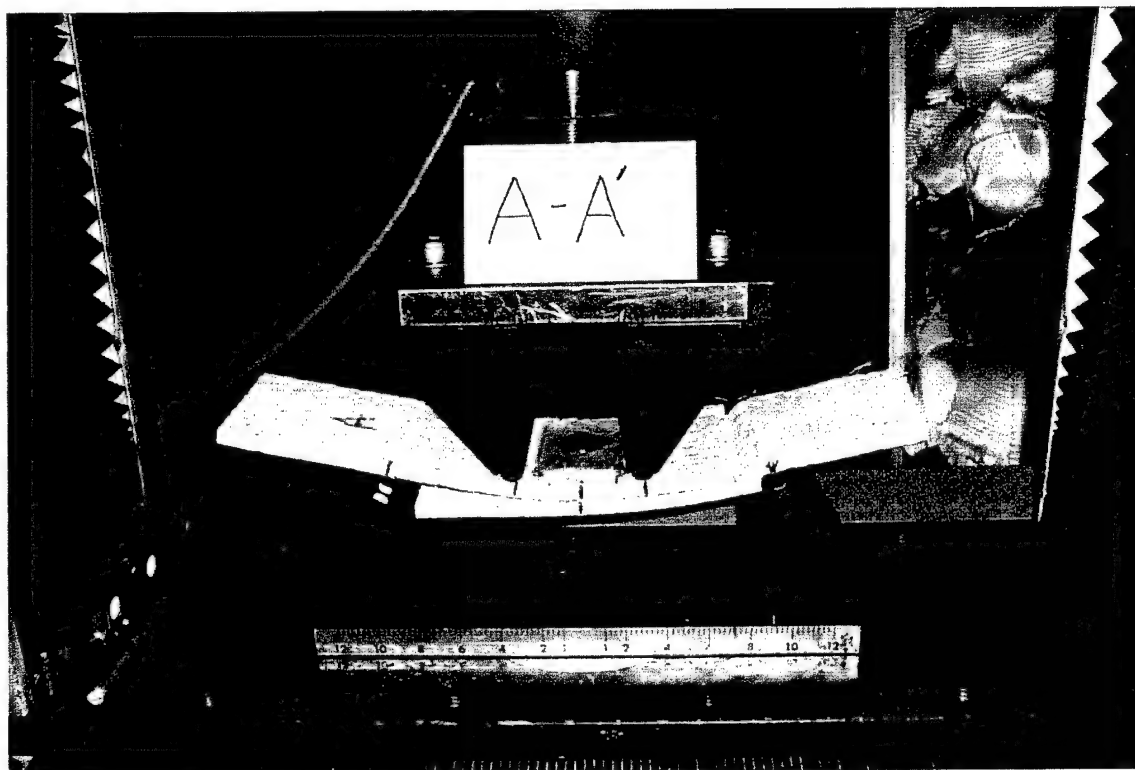


Photo 2. MP mat performance during modified 3-point beam connector test

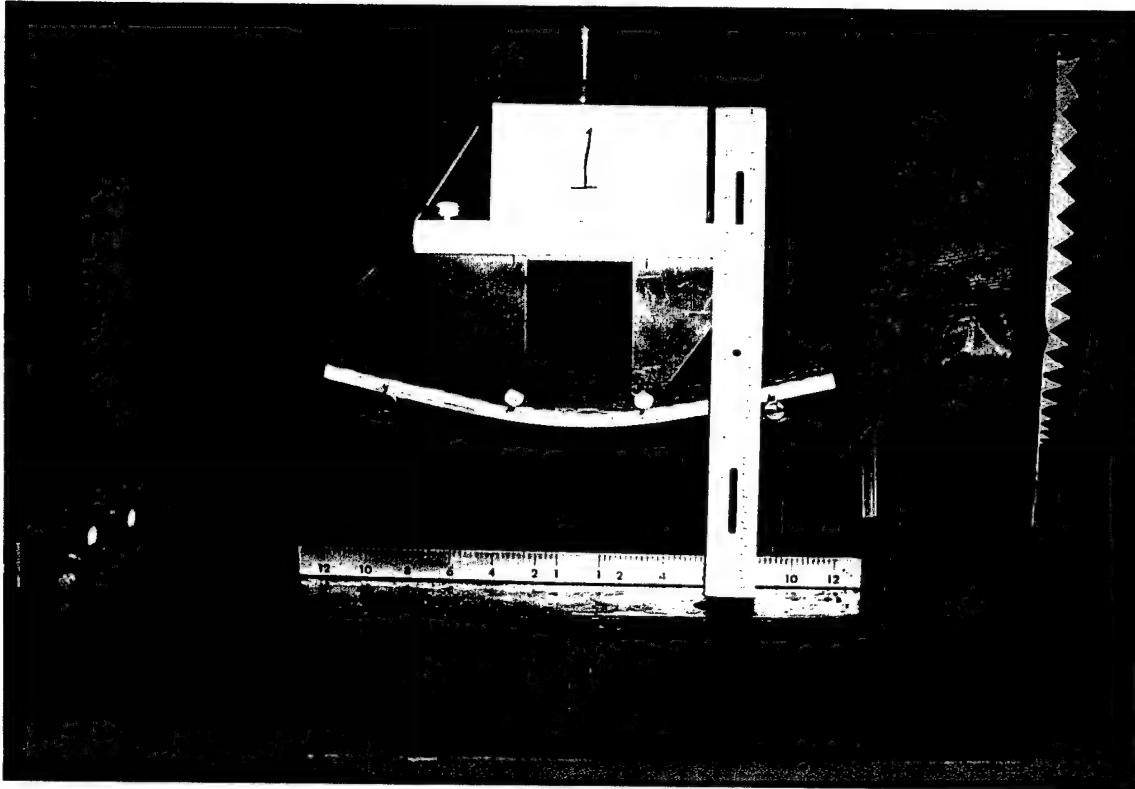


Photo 3. Modified 3-point beam test

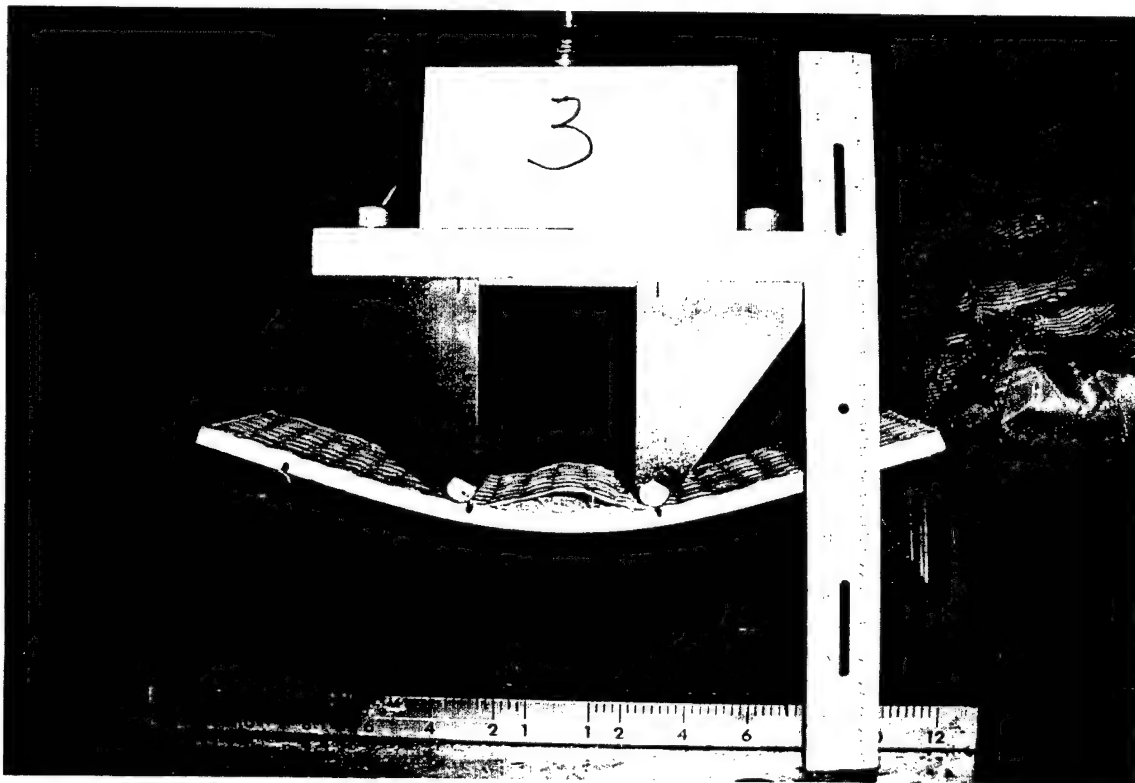


Photo 4. MP mat performance modified 3-point beam test

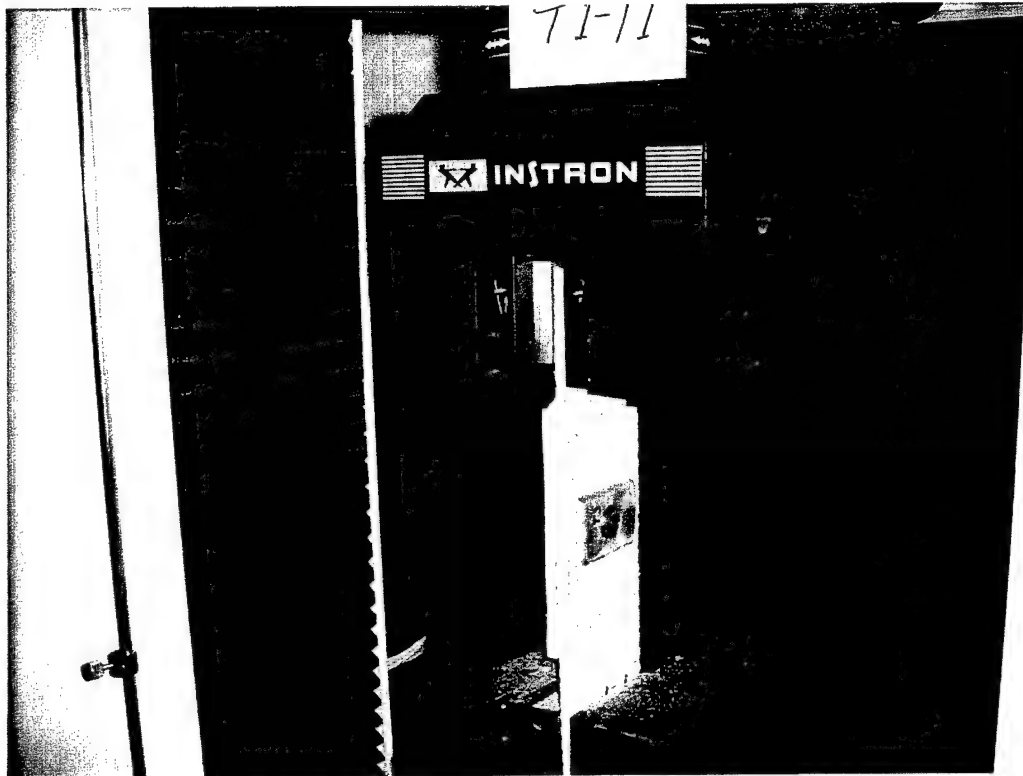


Photo 5. Modified direct connector tension test

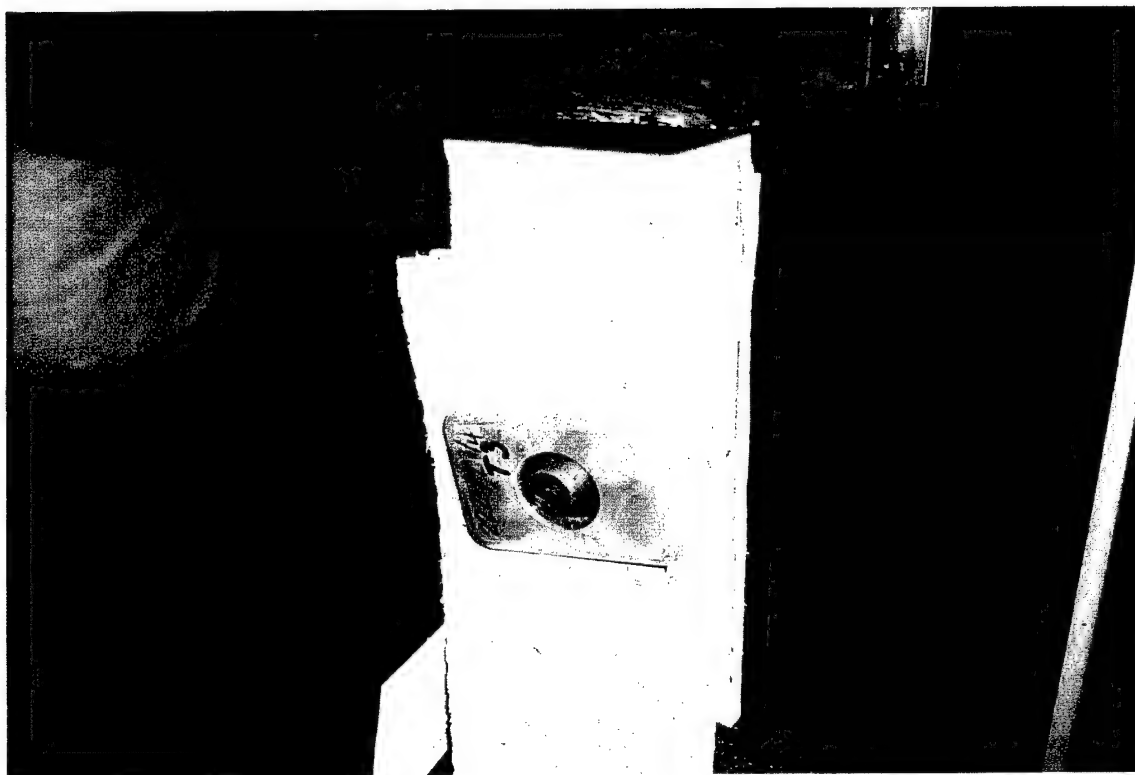


Photo 6. MP mat performance during modified direct tension test

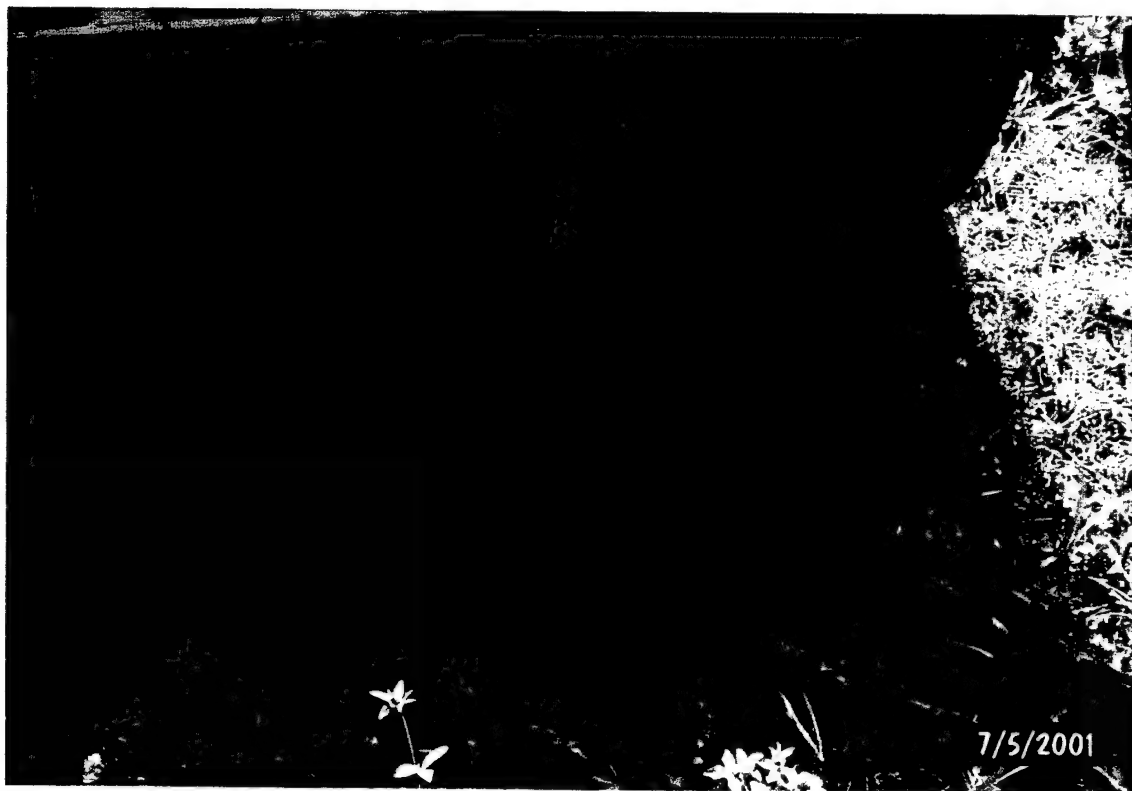


Photo 7. Hexagonal plastic mat – Special top view

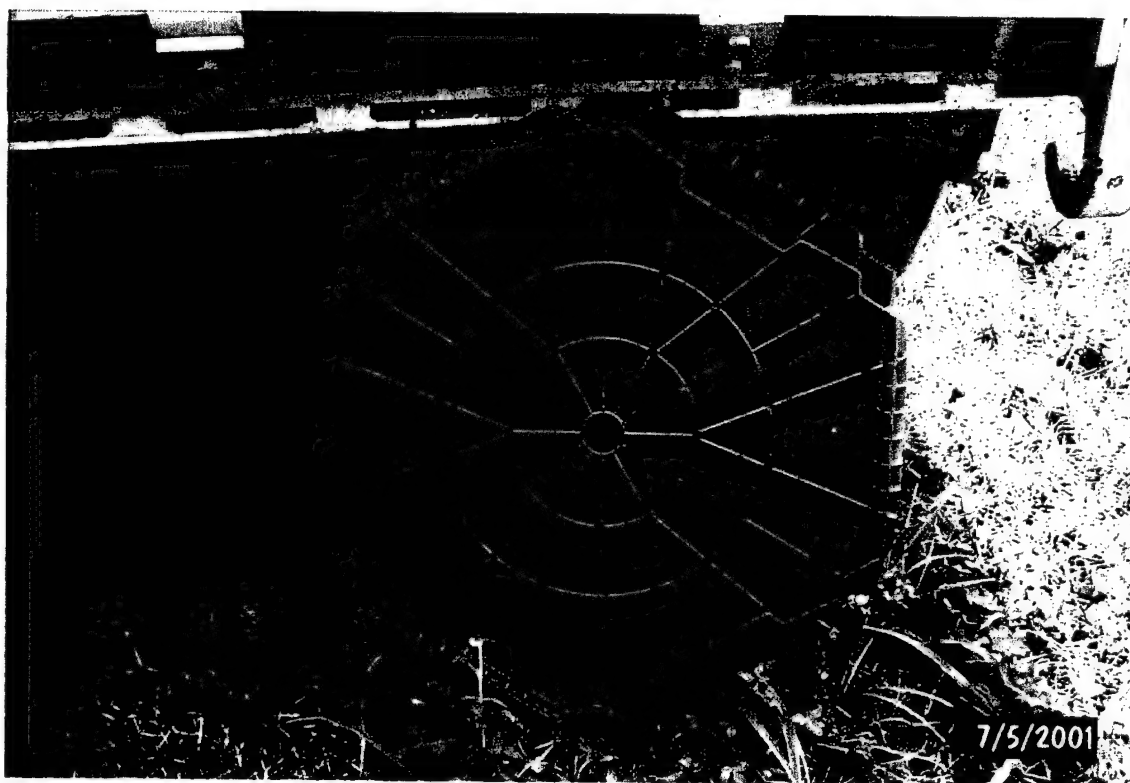


Photo 8. Hexagonal plastic mat – Special bottom view

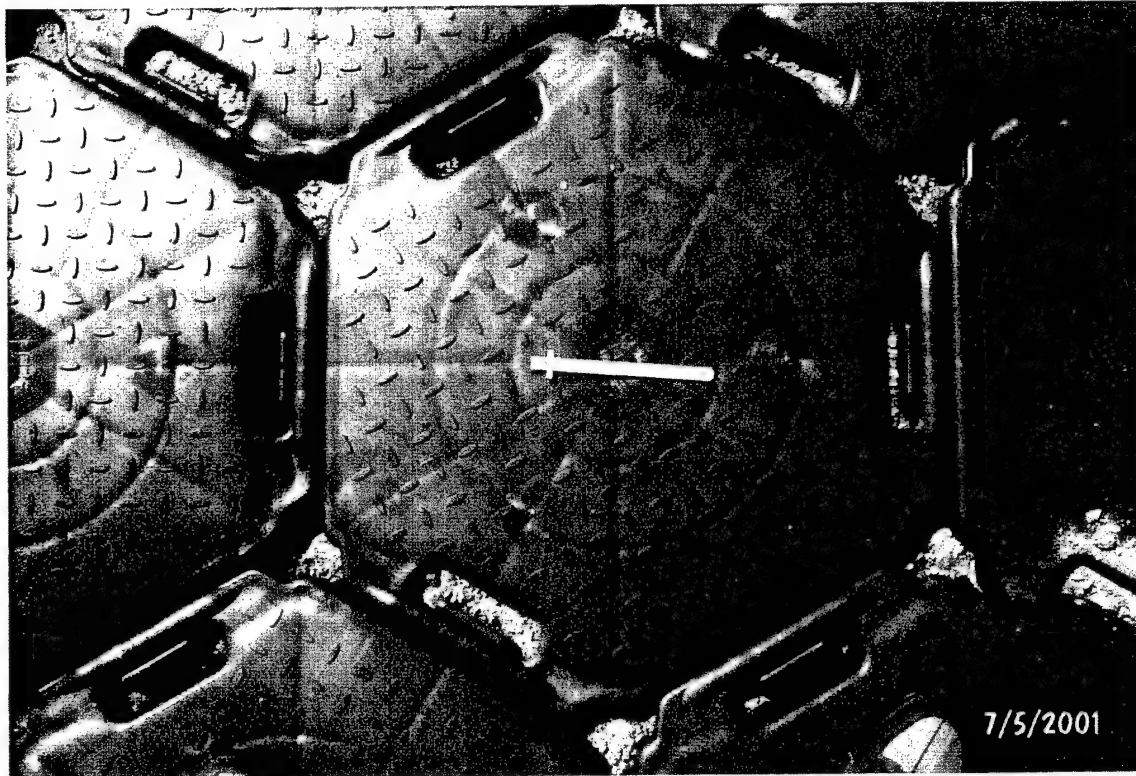


Photo 9. Hexagonal plastic mat – Allround top view

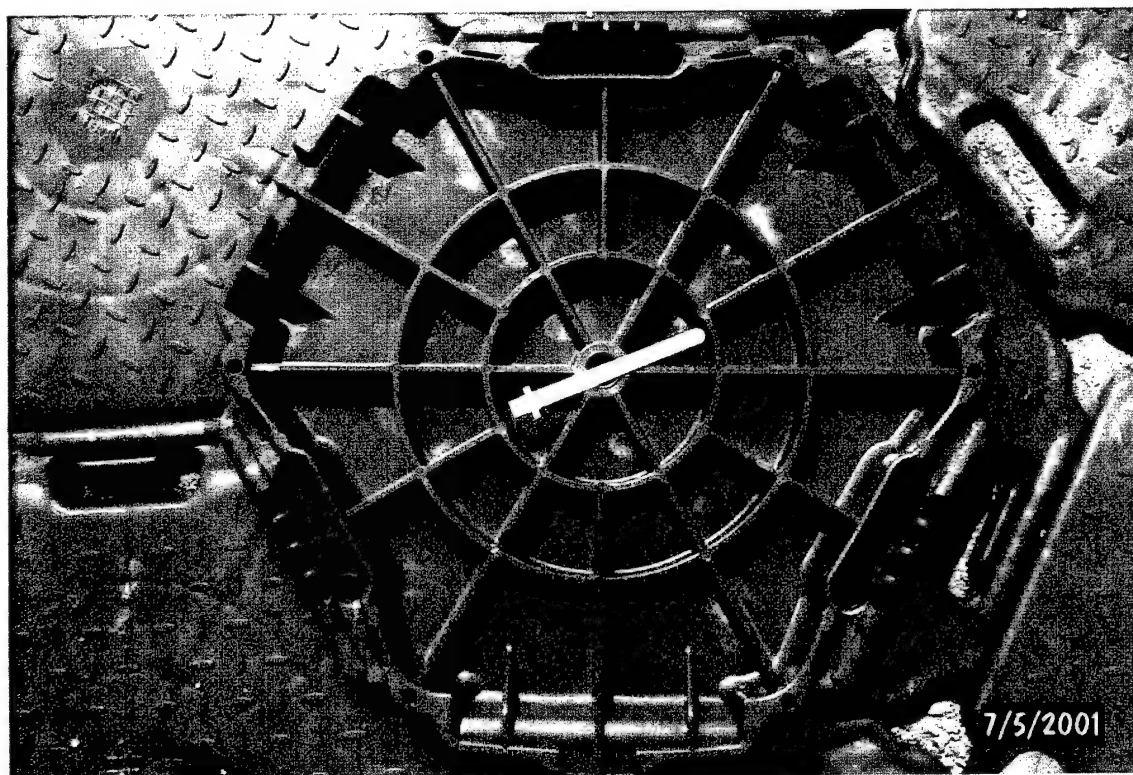


Photo 10. Hexagonal plastic mat – Allround bottom view



Photo 11. Hexagonal plastic mat –Special (left) and Allround (right), top view



Photo 12. Hexagonal plastic mat – Special (left) and Allround (right), bottom view



Photo 13. South edge cut at the Susquehanna Circle gravel road



Photo 14. North edge cut at the Susquehanna Circle gravel road

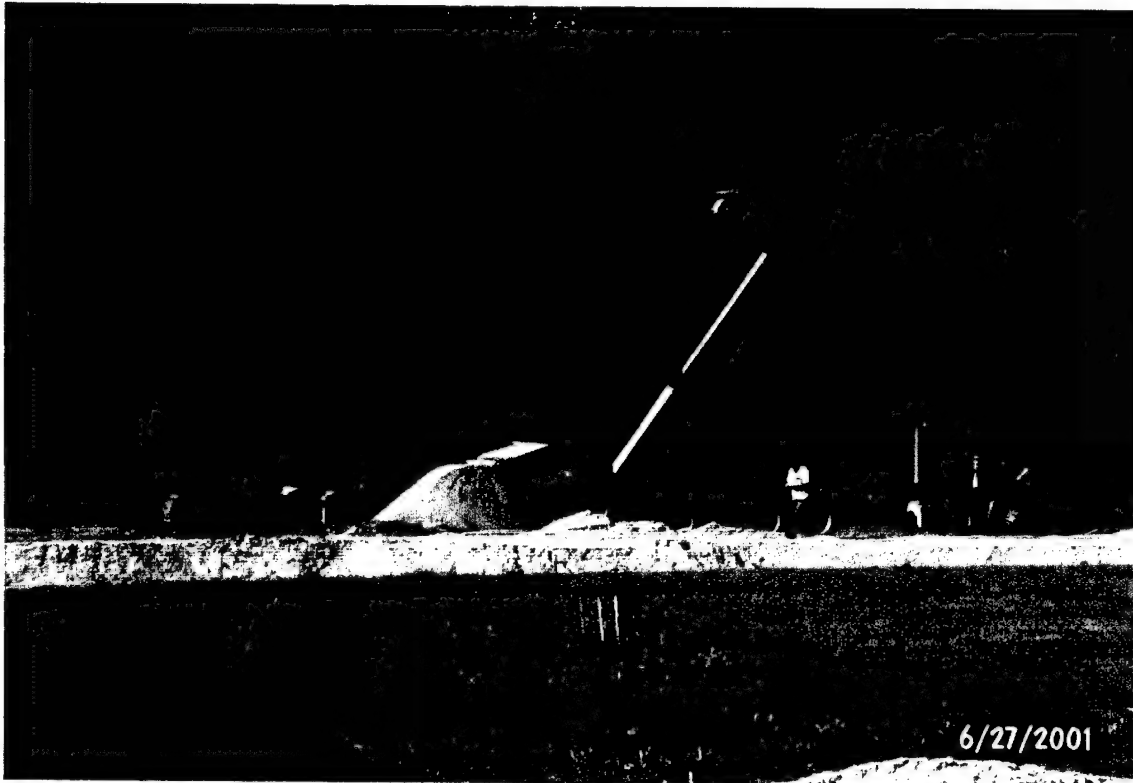


Photo 15. Placement of the sand layer



Photo 16. Back blading sand layer



Photo 17. Overall view of the sand layer



Photo 18. Placement of the drainage pipe



Photo 19. Pipe under the sand layer

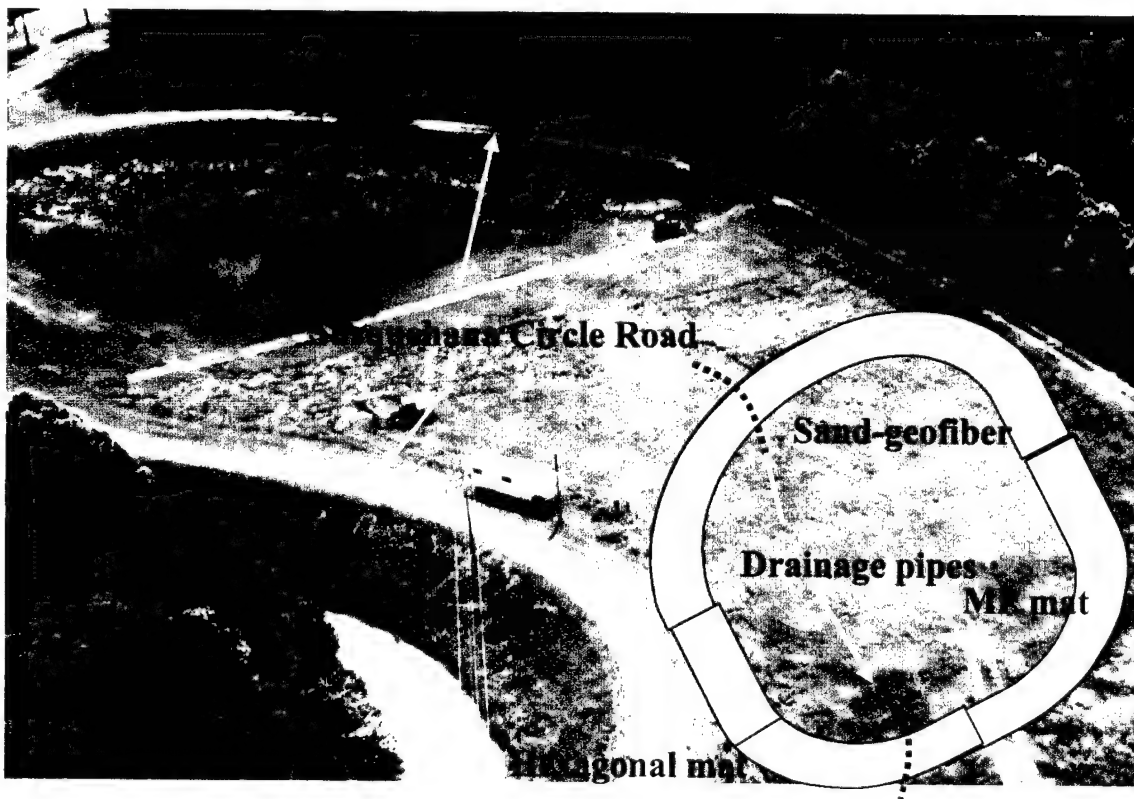


Photo 20. Aerial view of experiment site



Photo 21. Loose sand layer after 10 passes of 5-ton military truck

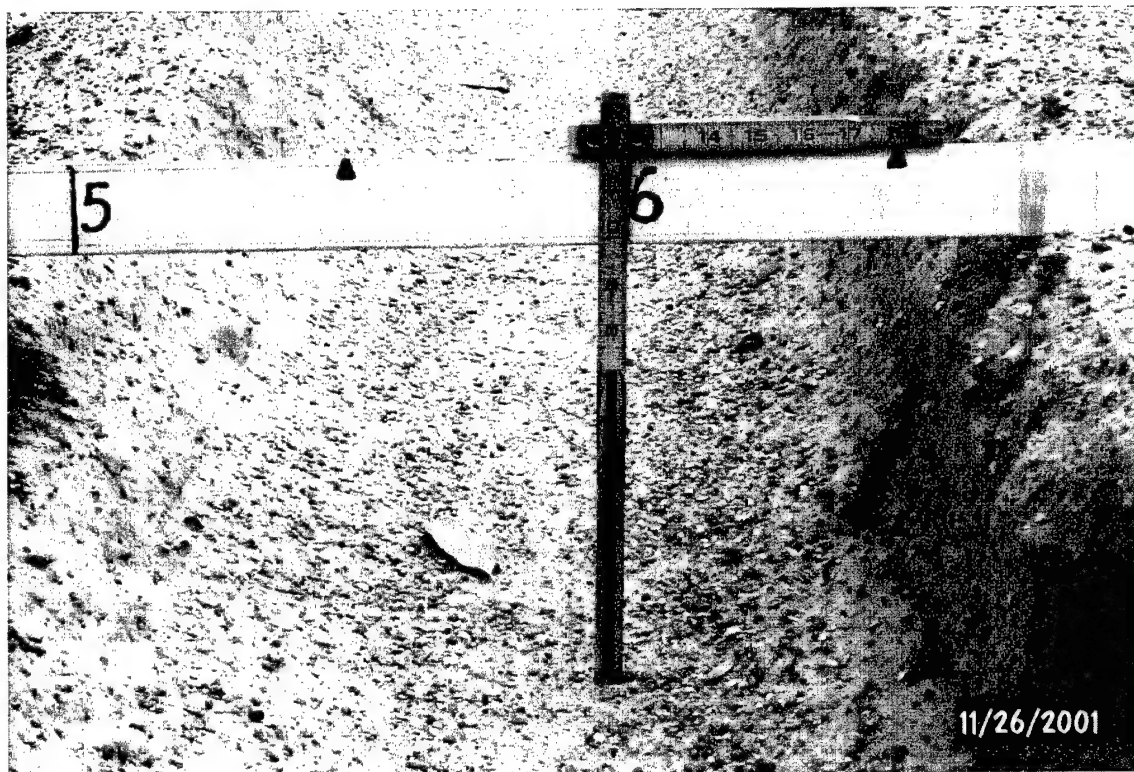


Photo 22. Close up 10 in. rut depth after 10 passes of 5-ton military truck

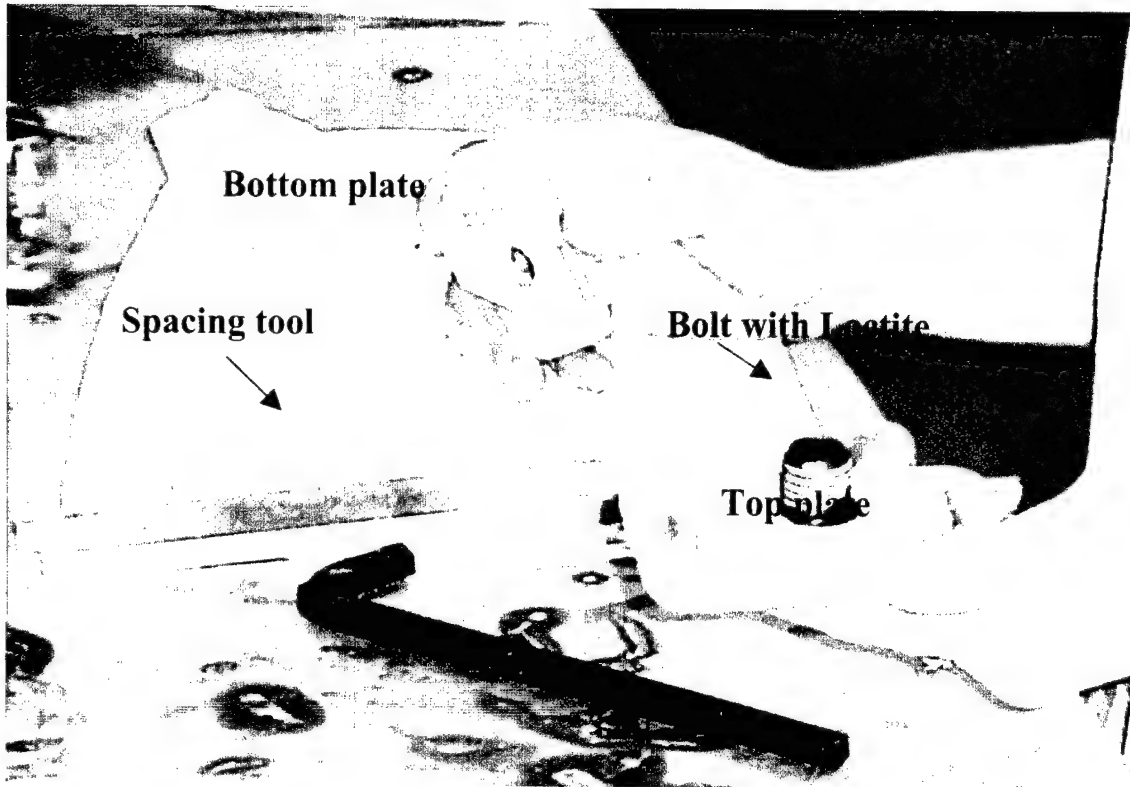


Photo 23. Assembling top and bottom plates of the connector pin

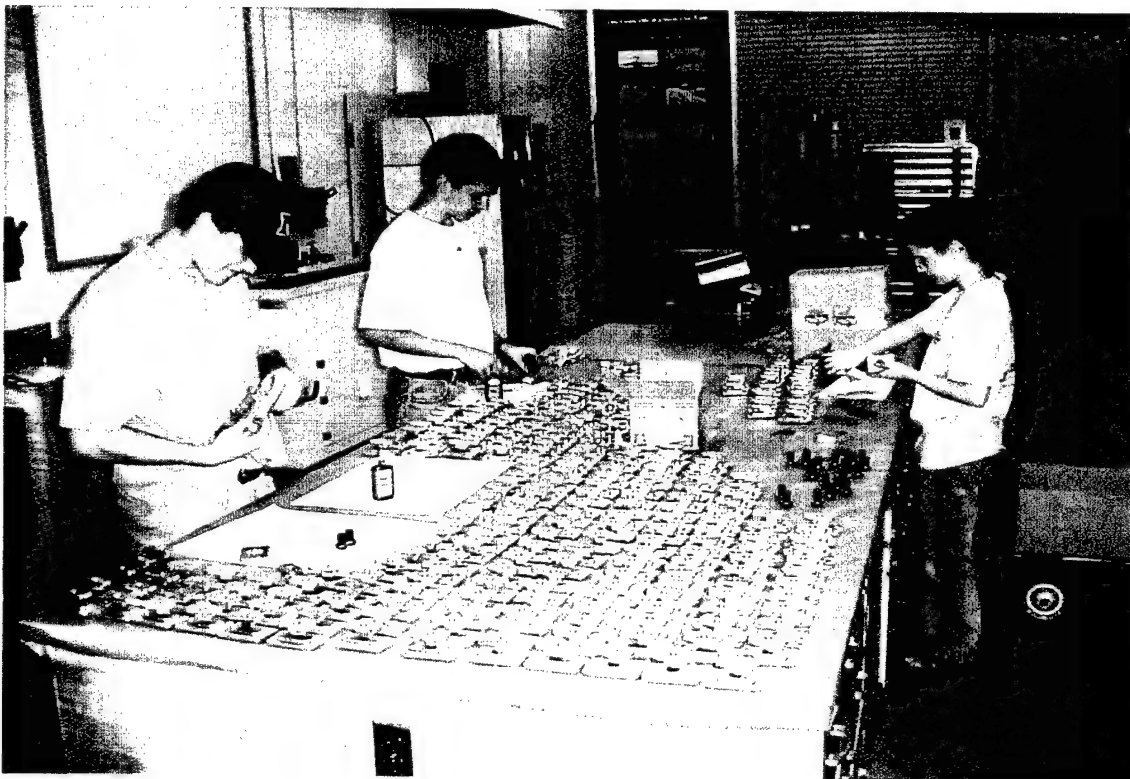


Photo 24. Connector pin assembly line



Photo 25. MP mat access ramp connection to the main Item 1 sections

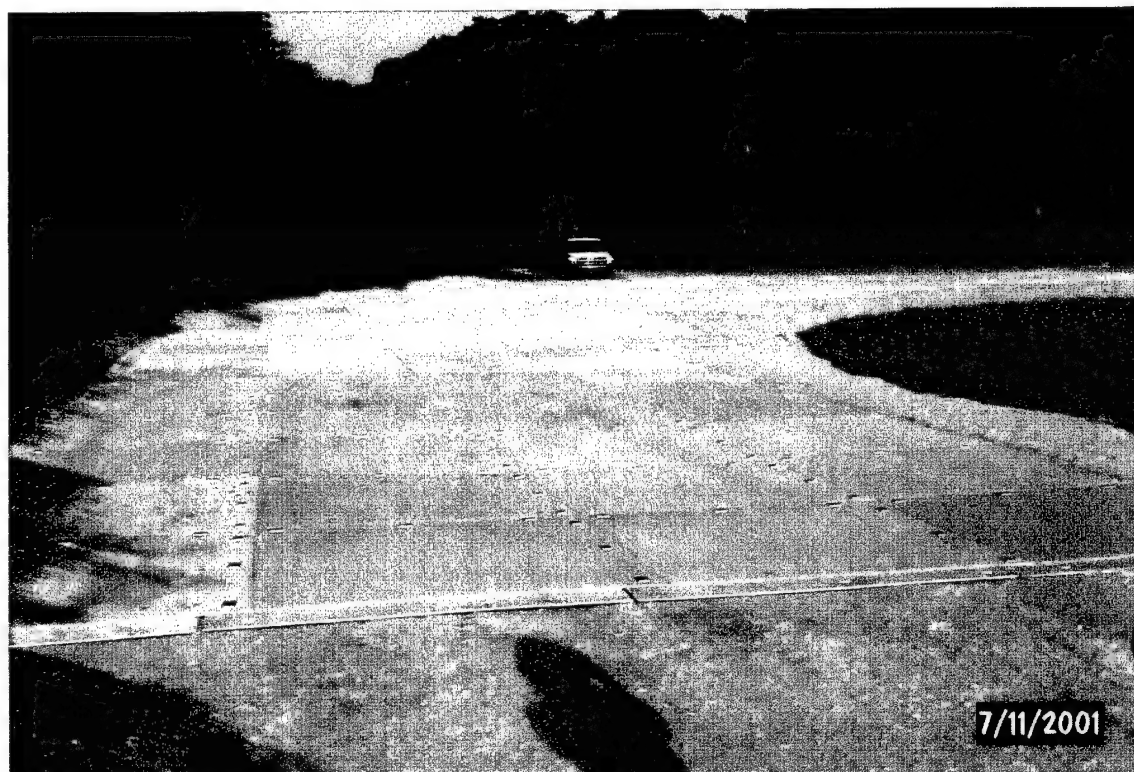


Photo 26. Item 1 straight section



Photo 27. Item 1 50-ft radius curve section

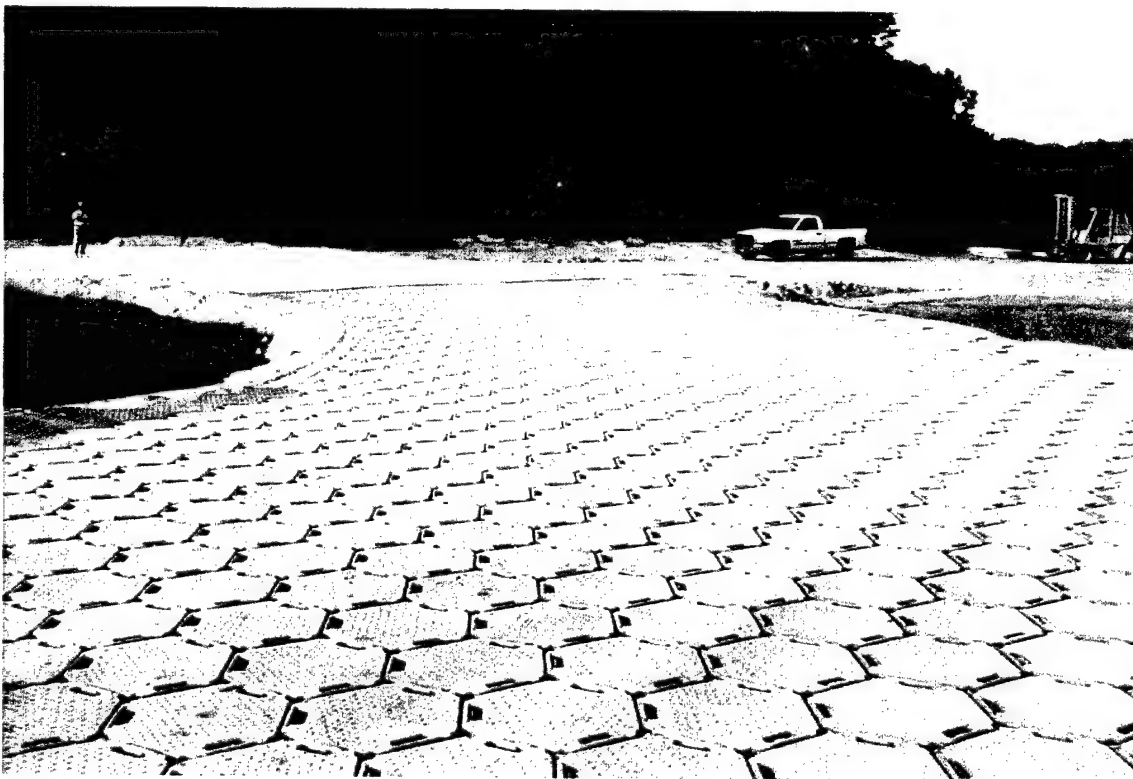


Photo 28. Item 2 50-ft radius curve section



Photo 29. Item 2 Special hexagonal plastic mat section



Photo 30. Item 3 75-ft radius curve section



Photo 31. Item 3 50-ft radius curve section



Photo 32. Item 3 straight section

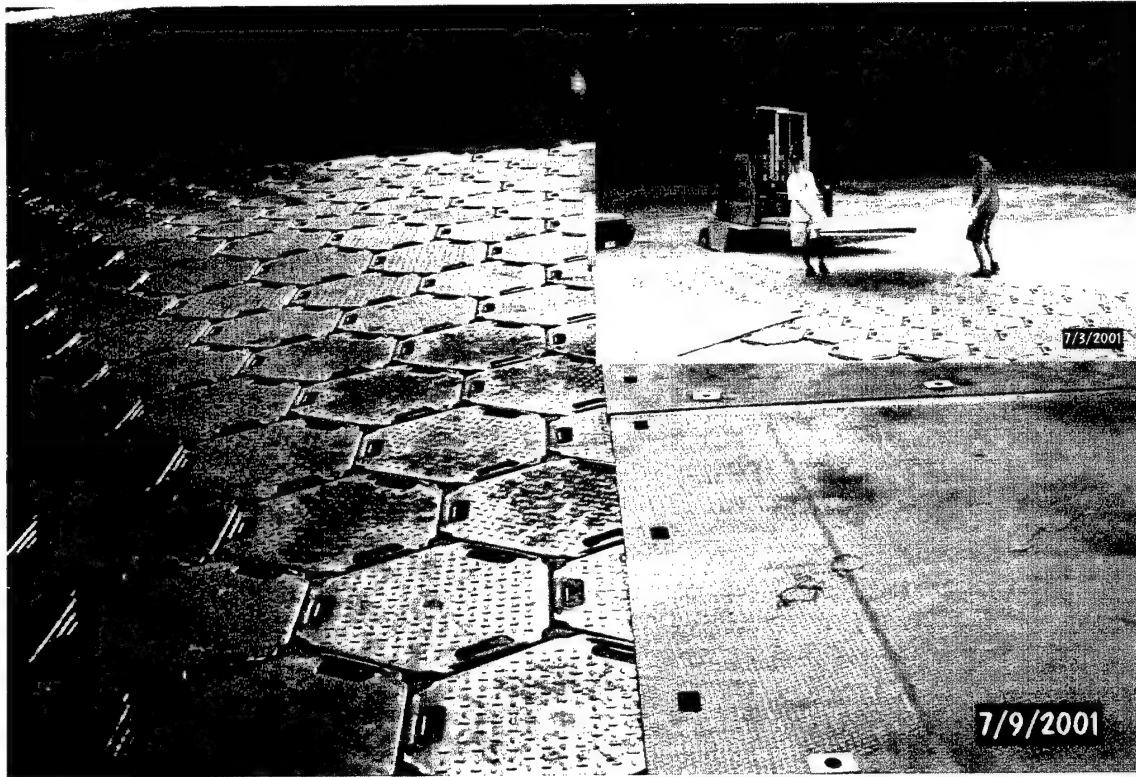


Photo 33. MP mat 50-ft radius curve section and Allround hexagonal plastic mat transition zone



Photo 34. Special hexagonal plastic mat and 75-ft radius curve sand-geofiber section transition zone

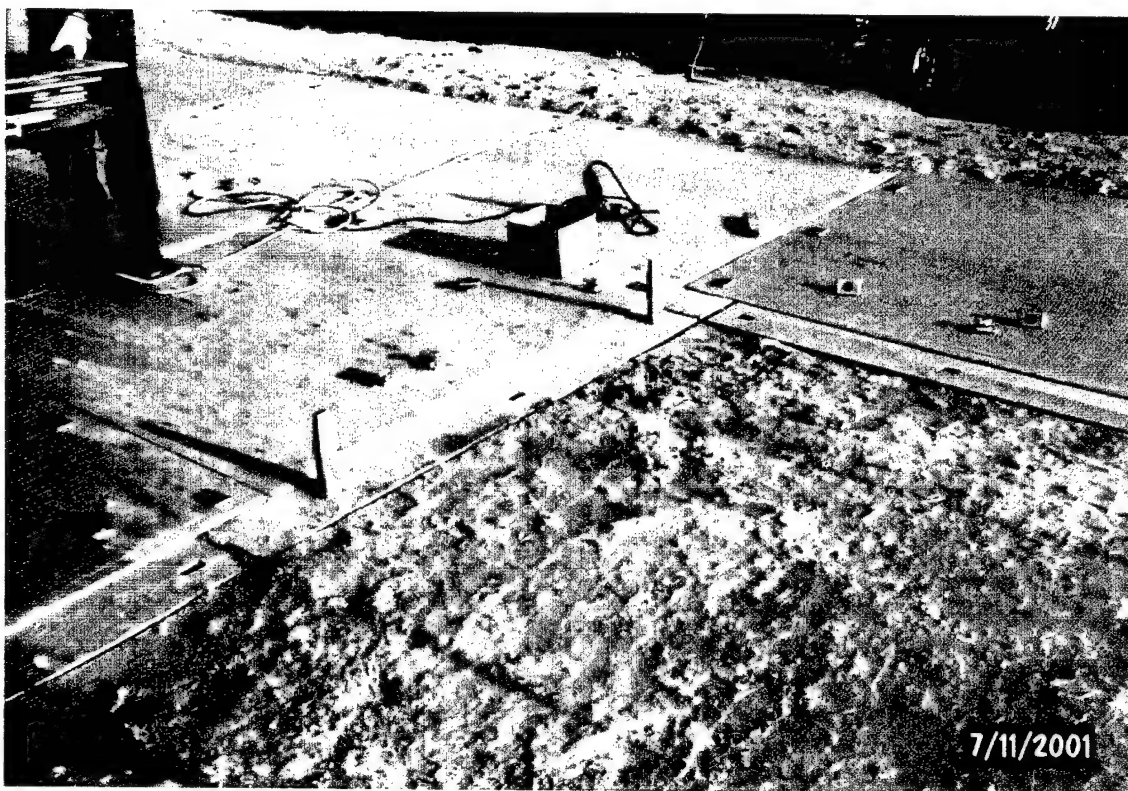


Photo 35. MP mat 50-ft radius curve section and Allround hexagonal plastic mat transition zone

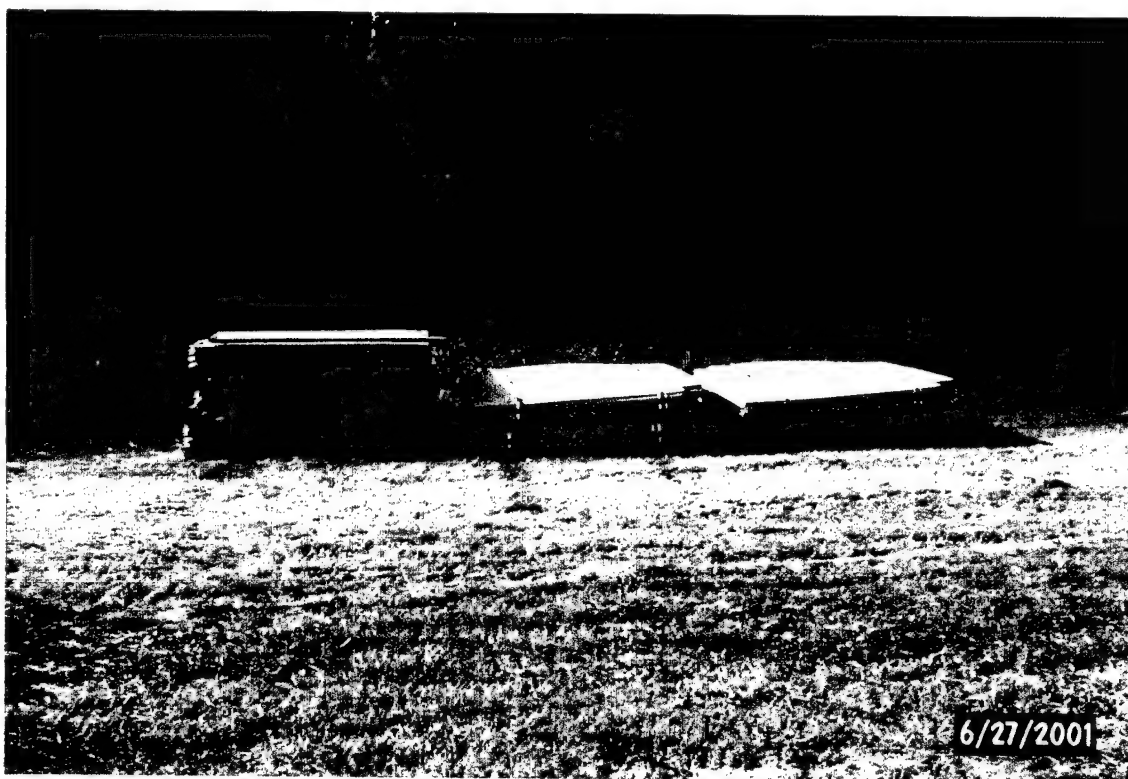


Photo 36. MP mats on shipping pallets



Photo 37. Forklift delivering MP mats to installation site

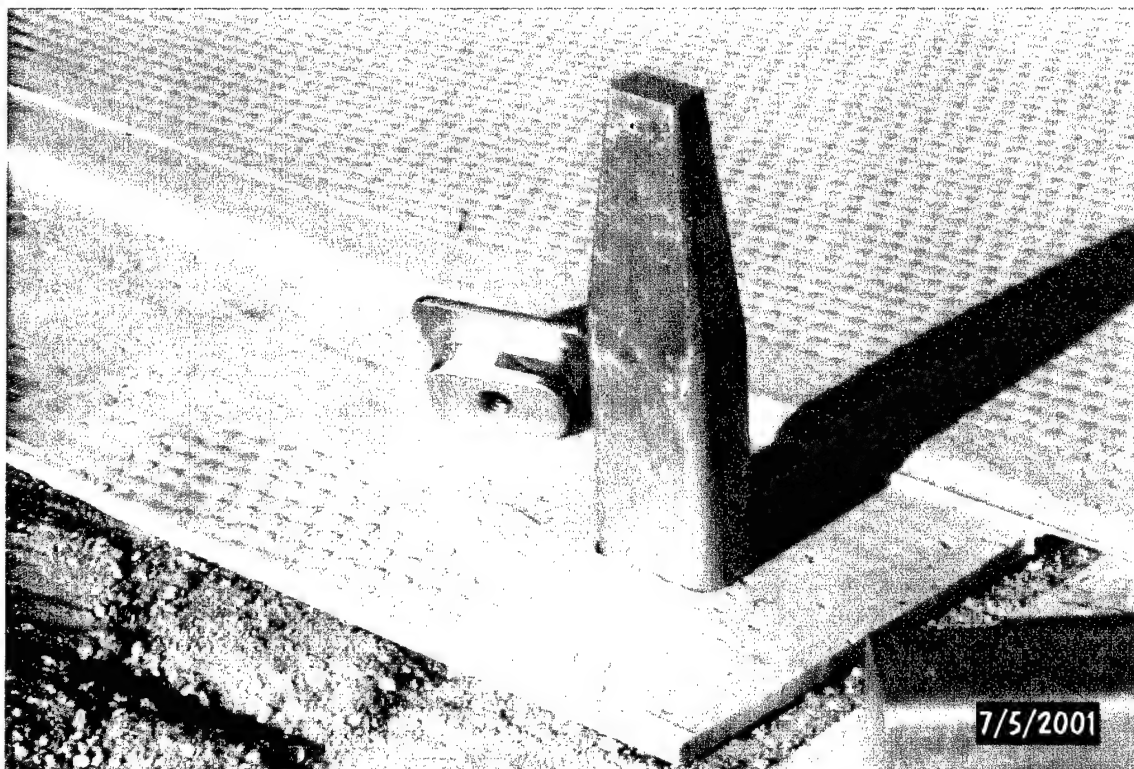


Photo 38. Close-up view of alignment tool positioned in panel ledge

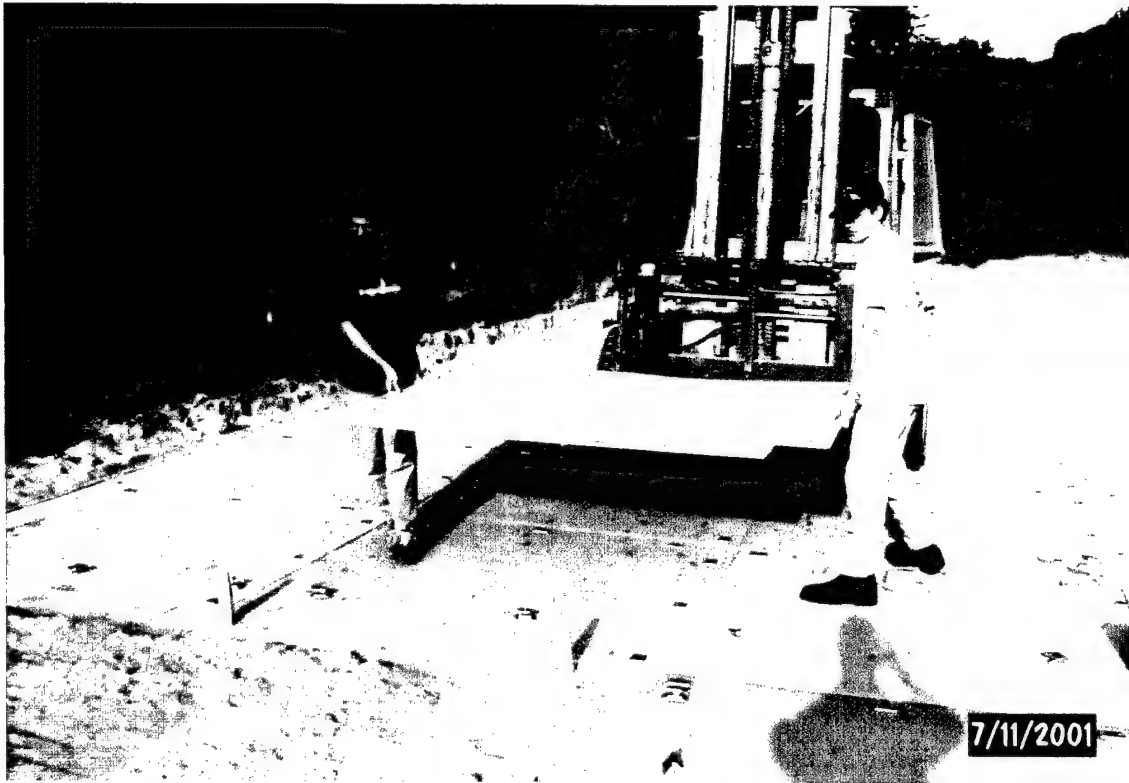


Photo 39. Two alignment tools positioned to guide new MP mat panel

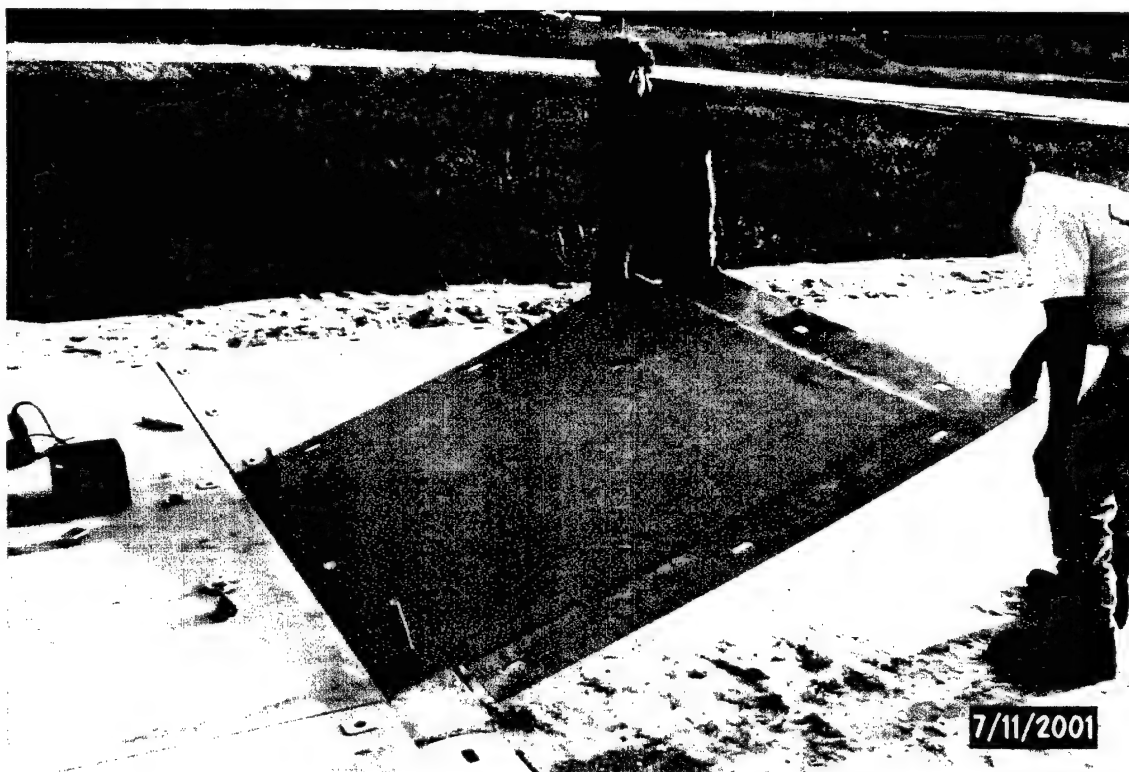


Photo 40. Using alignment tools to guide new panel into position



Photo 41. Aligning mat panel holes using alignment tool



Photo 42. Aligning final set of mat holes on installed panel

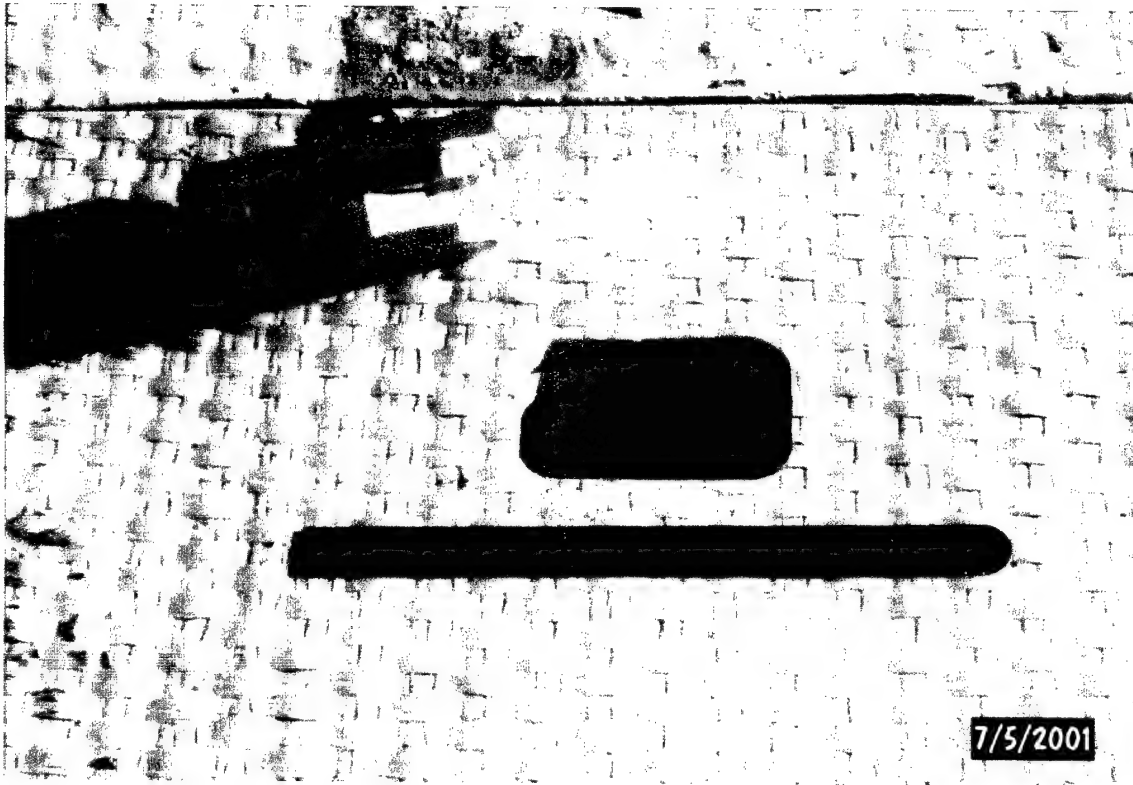


Photo 43. Close-up view of aligned holes ready for pin insertion

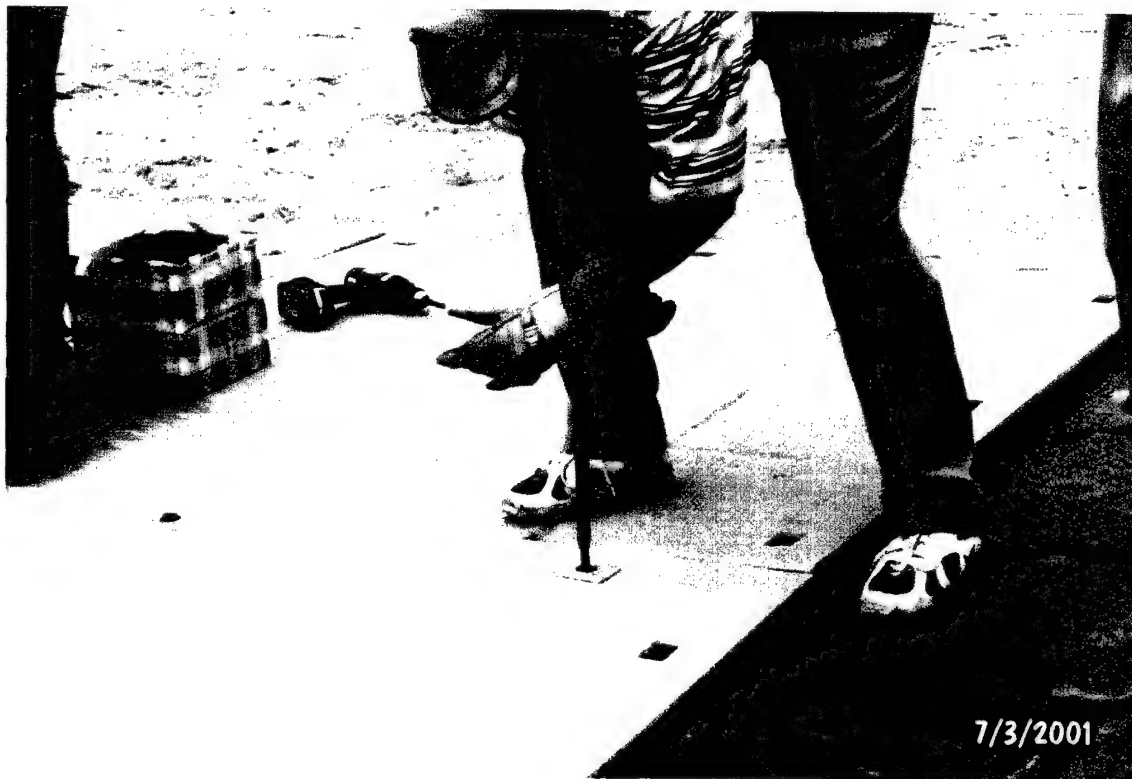


Photo 44. Connector pin pre-tightening using hand tool



Photo 45. Final tightening of connector pins

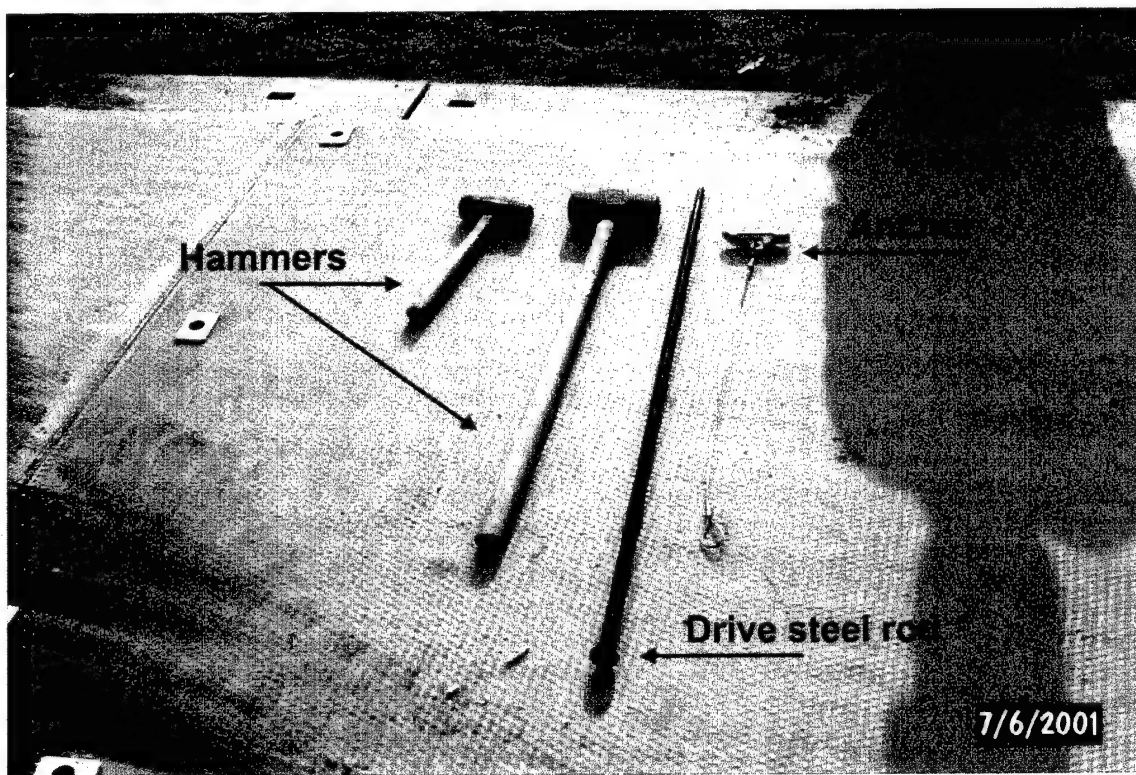


Photo 46. Duckbill anchor system



Photo 47. Anchor cable inserted throughout the mat hole

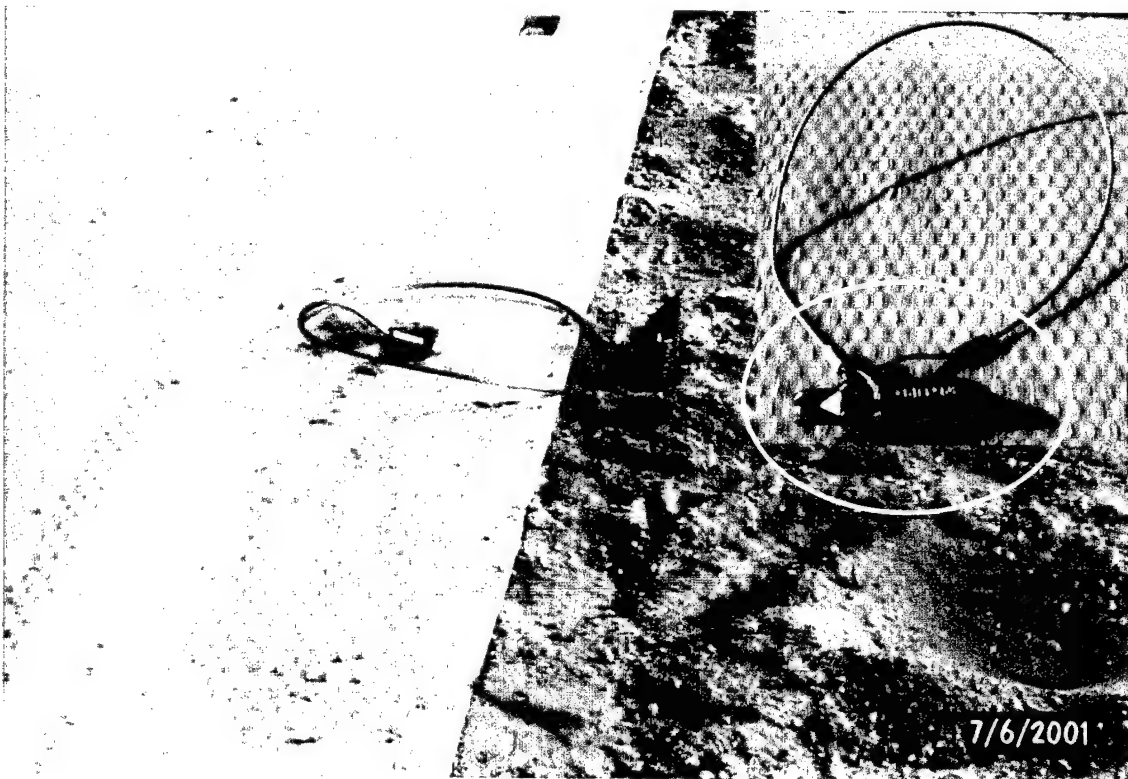


Photo 48. Anchor passed throughout the cable's eye

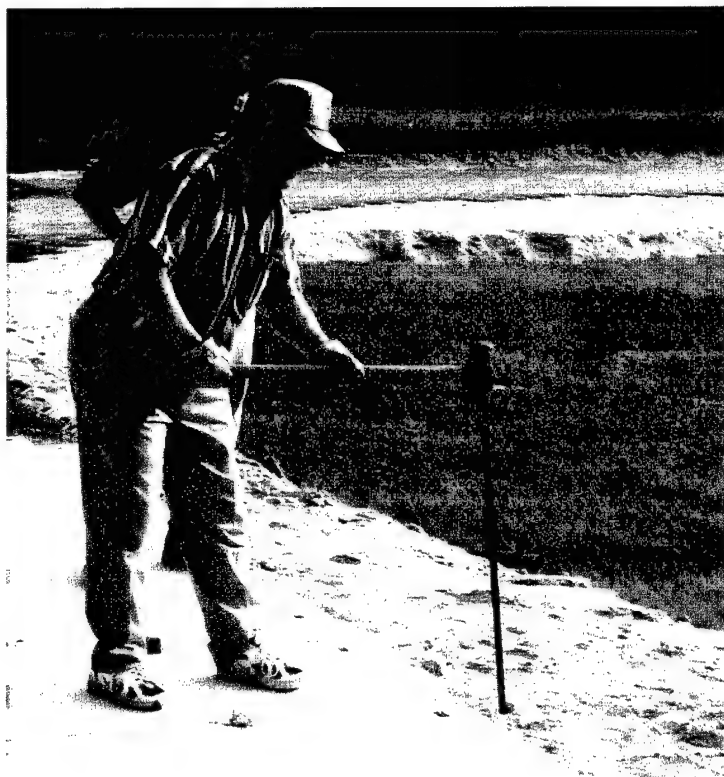


Photo 49. Driving the anchor using the steel driver rod

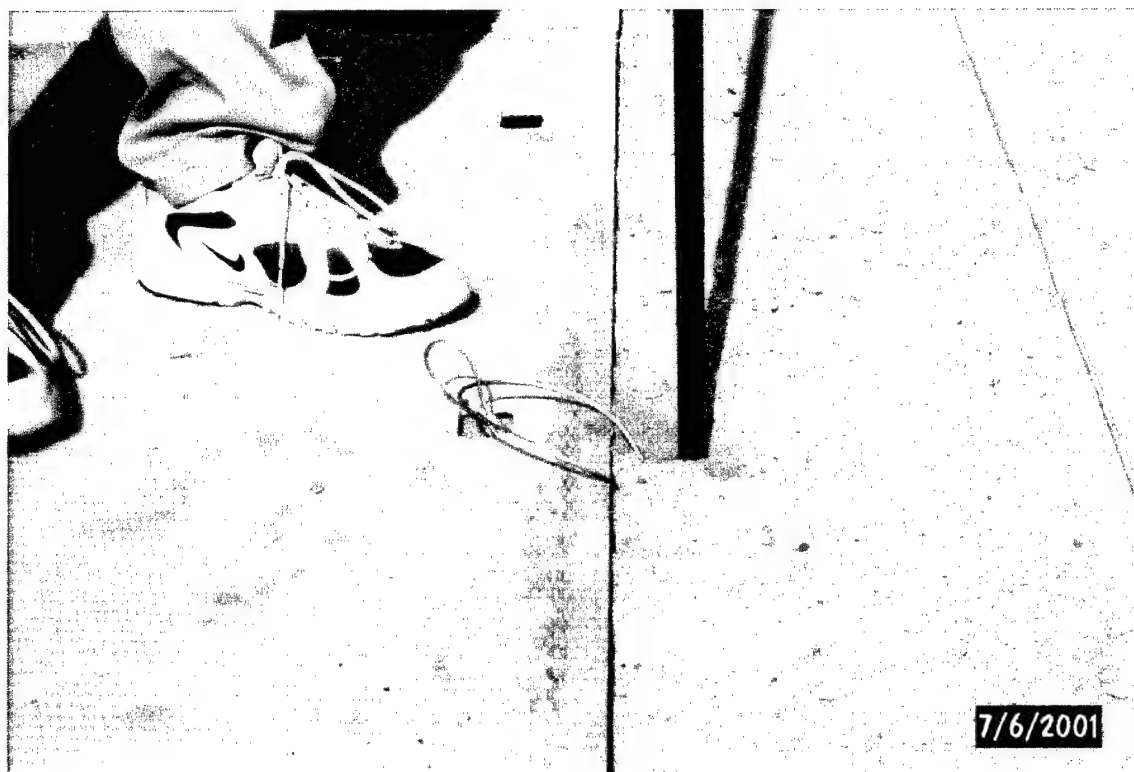


Photo 50. Close-up of the anchor driven into the ground



Photo 51. Hexagonal plastic mat on pallets



Photo 52. Forklift delivering Allround hexagonal mats to installation site

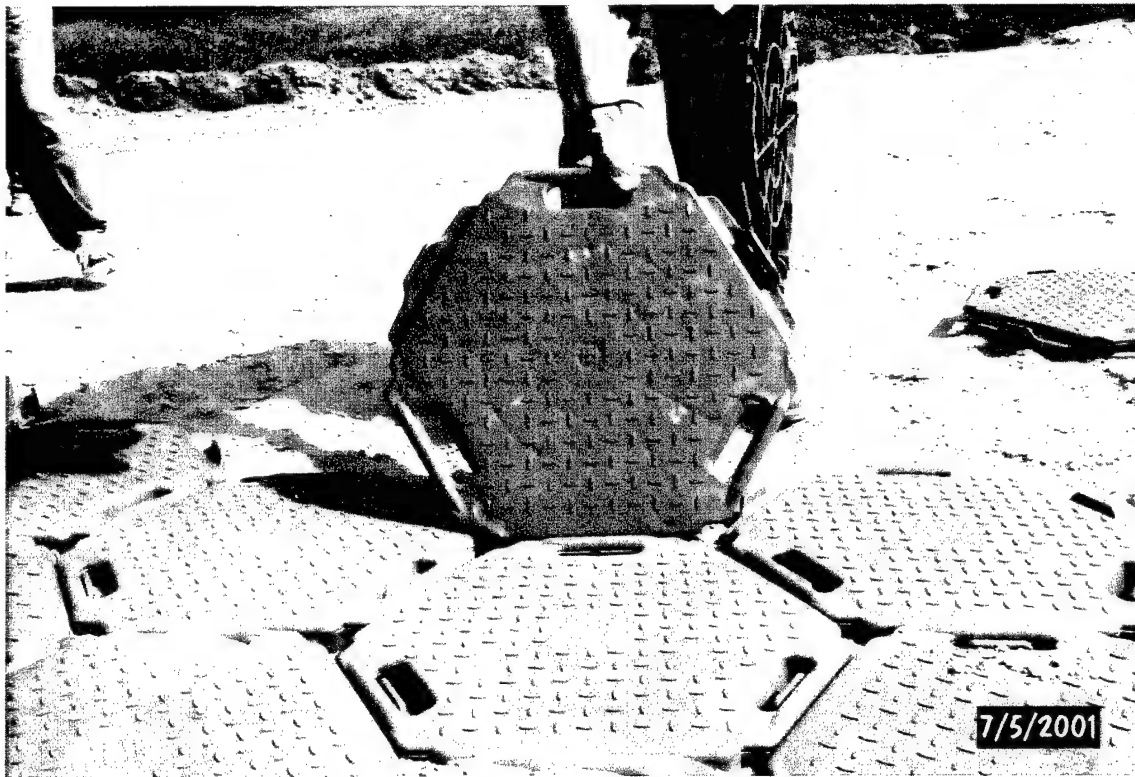


Photo 53. Allround hexagonal plastic installation – Step 1



Photo 54. Allround hexagonal mats installation - Step 2



Photo 55. Allround hexagonal plastic mat installation – Step 3



Photo 56. Allround hexagonal mats installation progress



Photo 57. Overview of Allround hexagonal plastic mat section



Photo 58. Completion of Allround hexagonal mat section



Photo 59. Special hexagonal plastic mat installation – Step 1



Photo 60. Special hexagonal plastic mat – Step 2 and 3

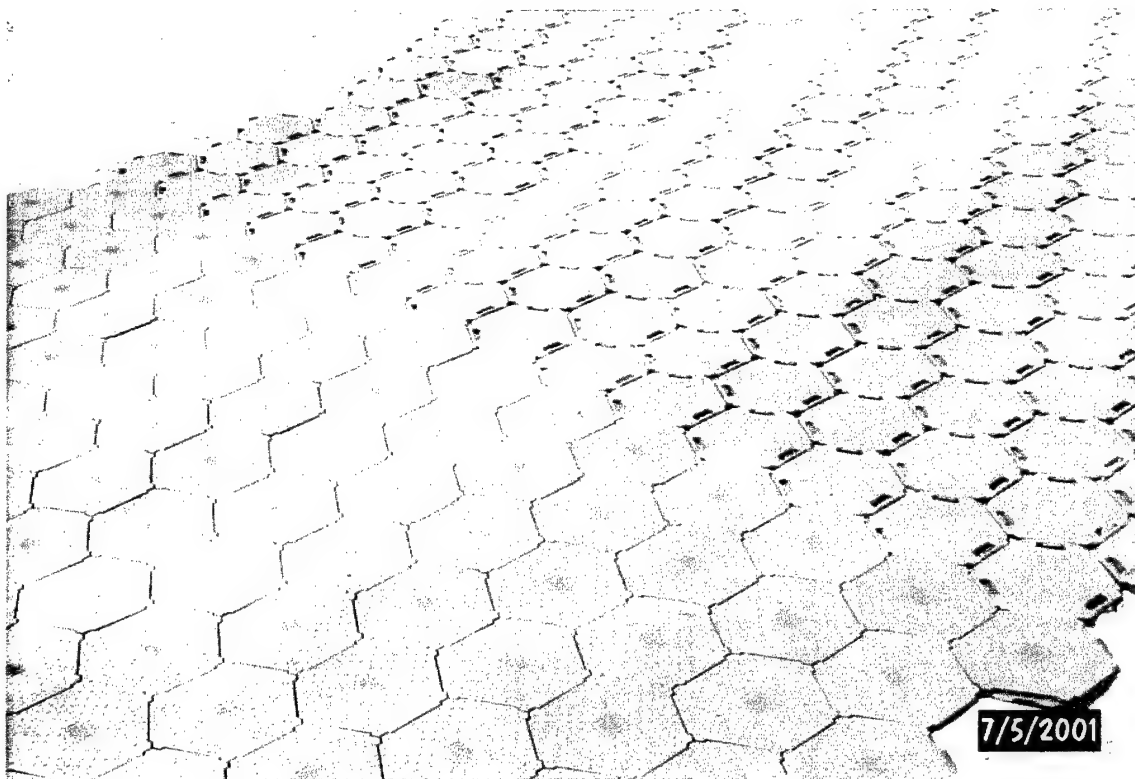


Photo 61. Special Allround hexagonal plastic mats transition zone

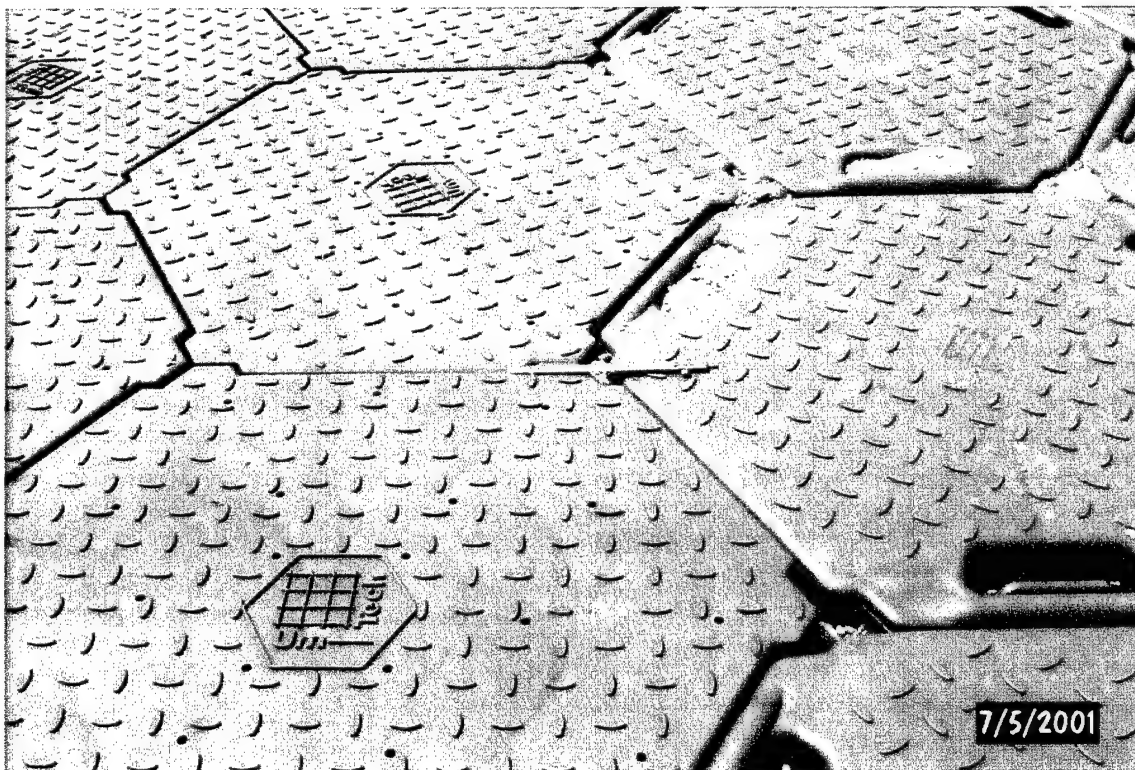


Photo 62. Hexagonal plastic mats transition zone close-up



Photo 63. Compaction of Item 2 - Hexagonal plastic mat sections



Photo 64. 300-lb boxes of geofibers delivered to construction site



Photo 65. Longitudinal marking for geofiber bag placement



Photo 66. Geofiber bag placement



Photo 67. Spreading geofibers over the sand layer



Photo 68. Item 3 after spreading the geofiber and prior mixing



Photo 69. Mixing geofibers into the sand with self-propelled rotary mixer



Photo 70. Sand-geofiber item after 4 passes of the rotary mixer



Photo 71. D4 dozer leveling/smoothing the sand-geofiber sections



Photo 72. Watering sand-geofiber item prior compaction



Photo 73. Compaction of the sand-geofiber item

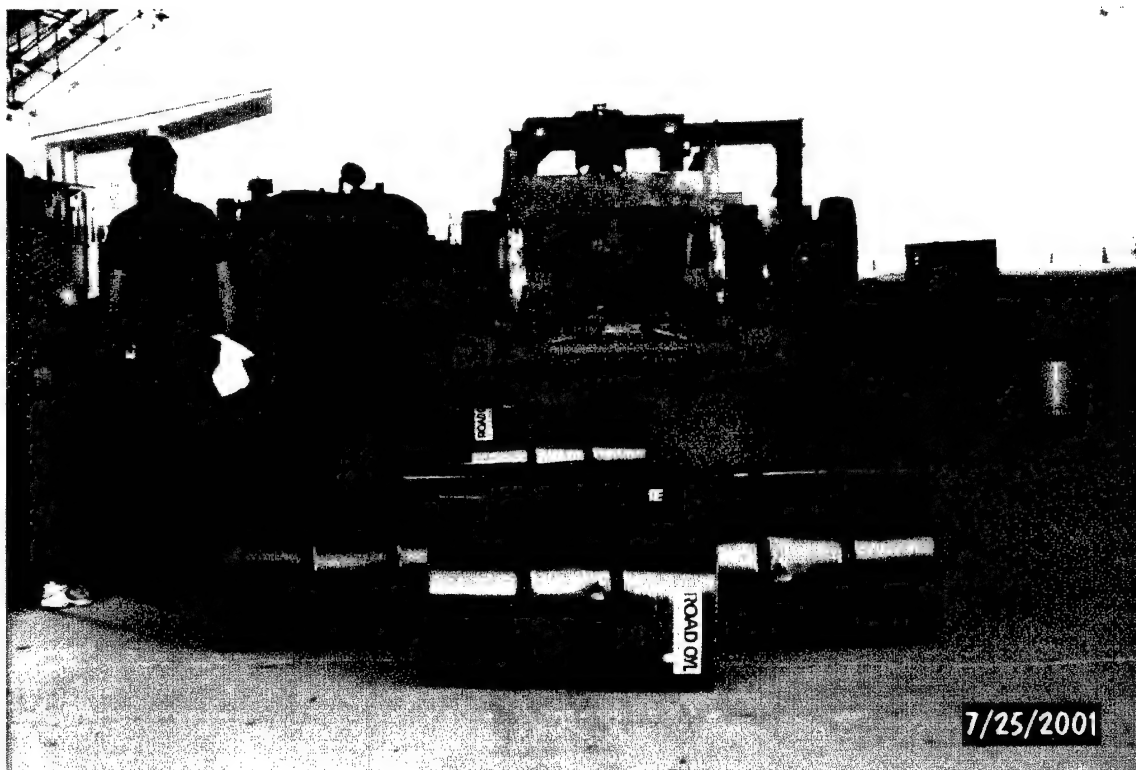


Photo 74. Shaking of Road Oyl drums



Photo 75. Pumping the Road Oyl into the asphalt distributor tank



Photo 76. Spraying Road Oyl over the sand-geofiber



Photo 77. Patching with sand-geofibers



Photo 78. Compaction to seal the sand-geofiber surface

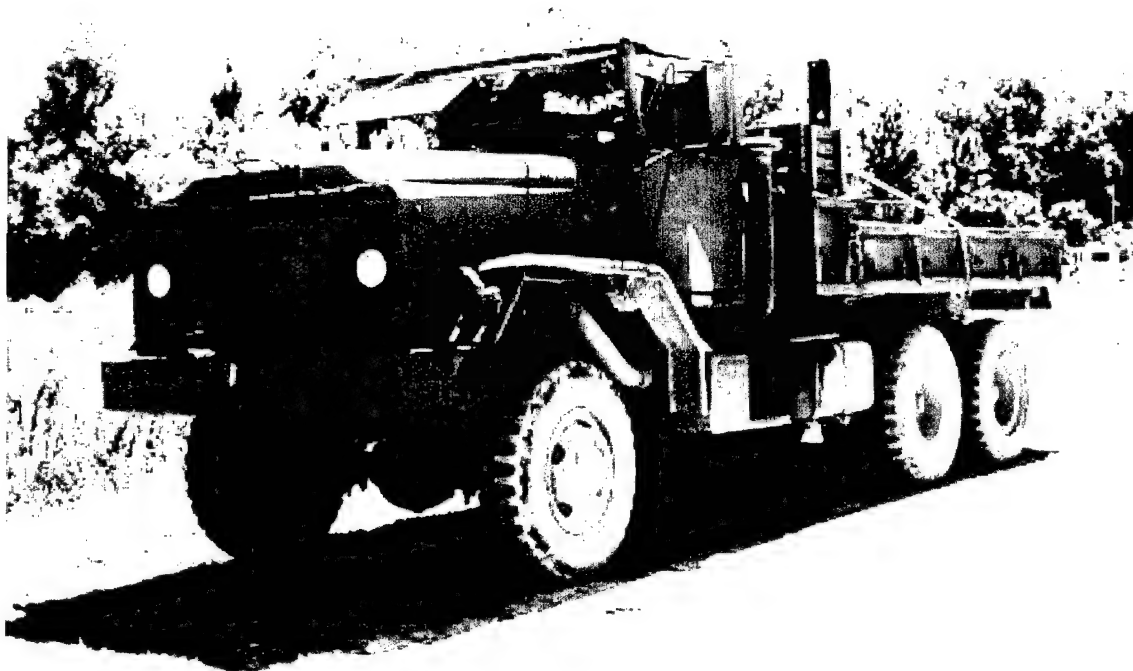


Photo 79. M923 5-ton military truck

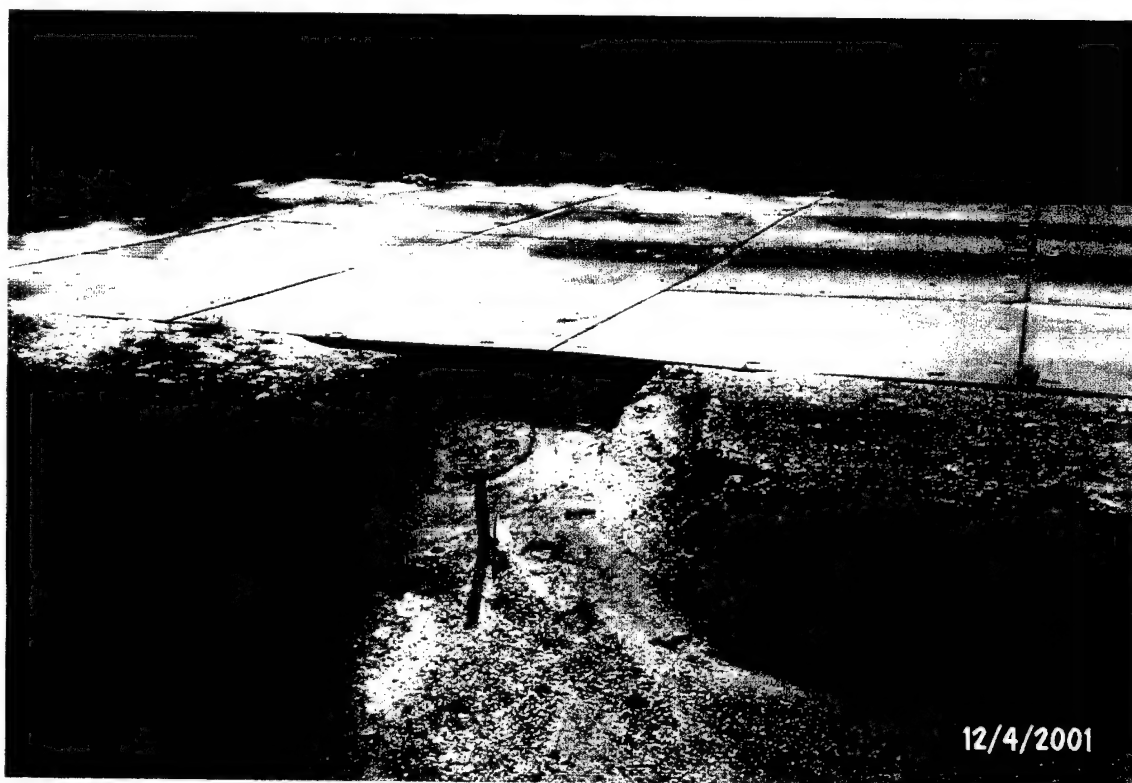


Photo 80. Shoulder's erosion due to heavy rains



Photo 81. Repair shoulder with sand-geofiber

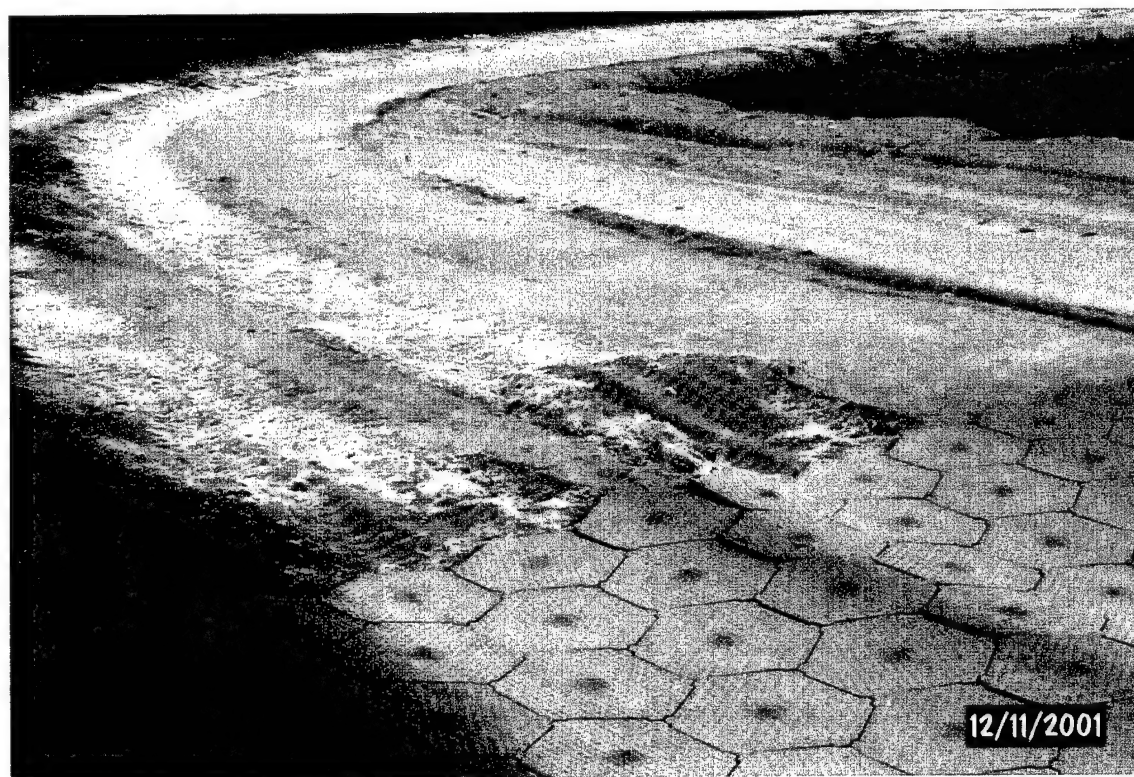


Photo 82. Deterioration in the transition zone

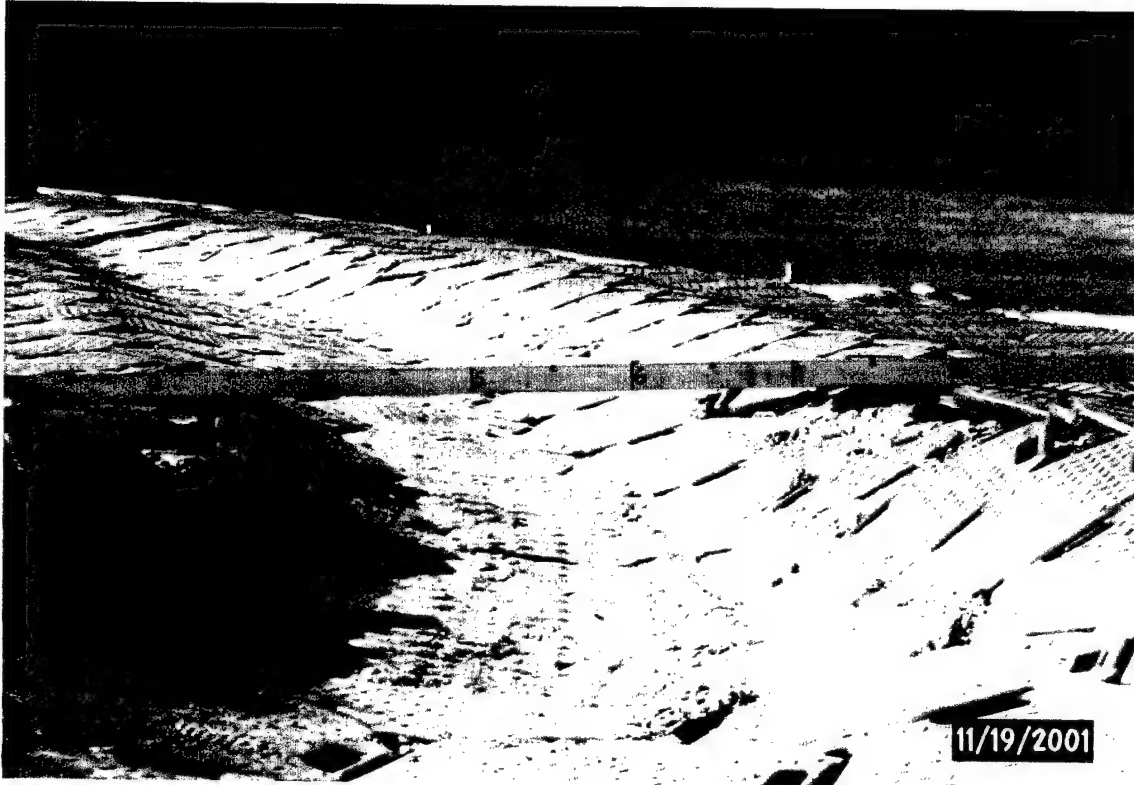


Photo 83. Rut depth measurement on Allround hexagonal mat section after 165 passes

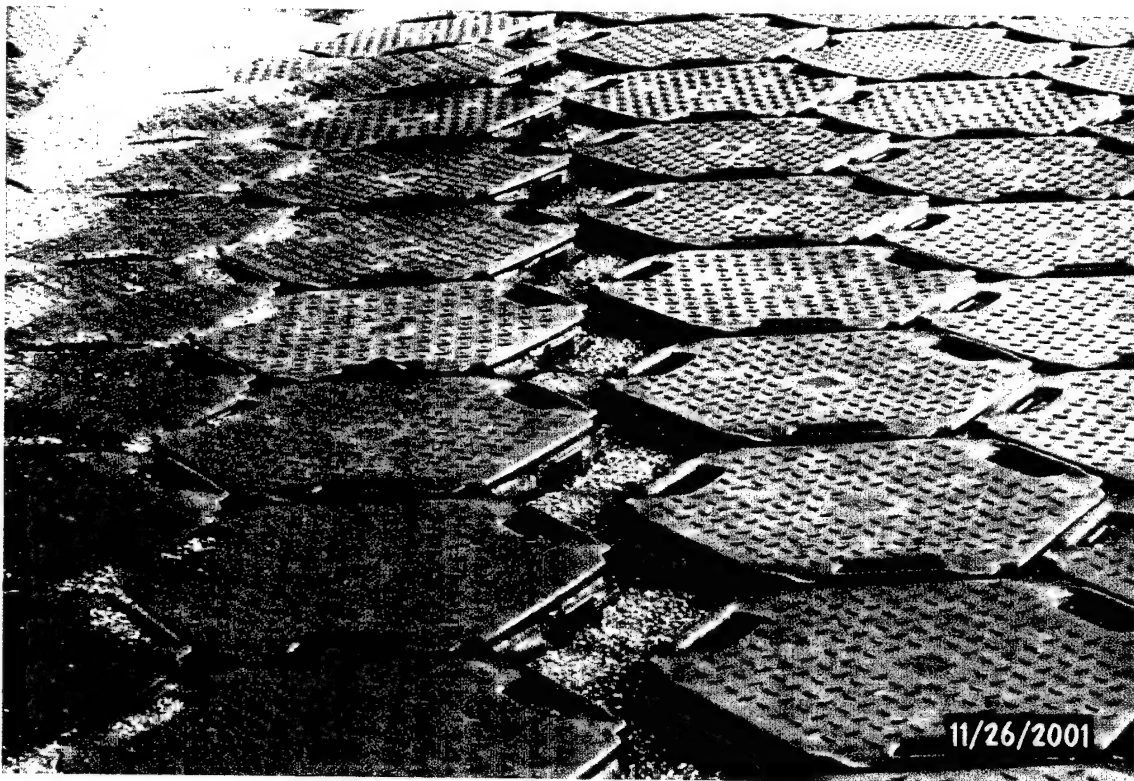


Photo 84. Allround hexagonal mat unzipped after 165 passes

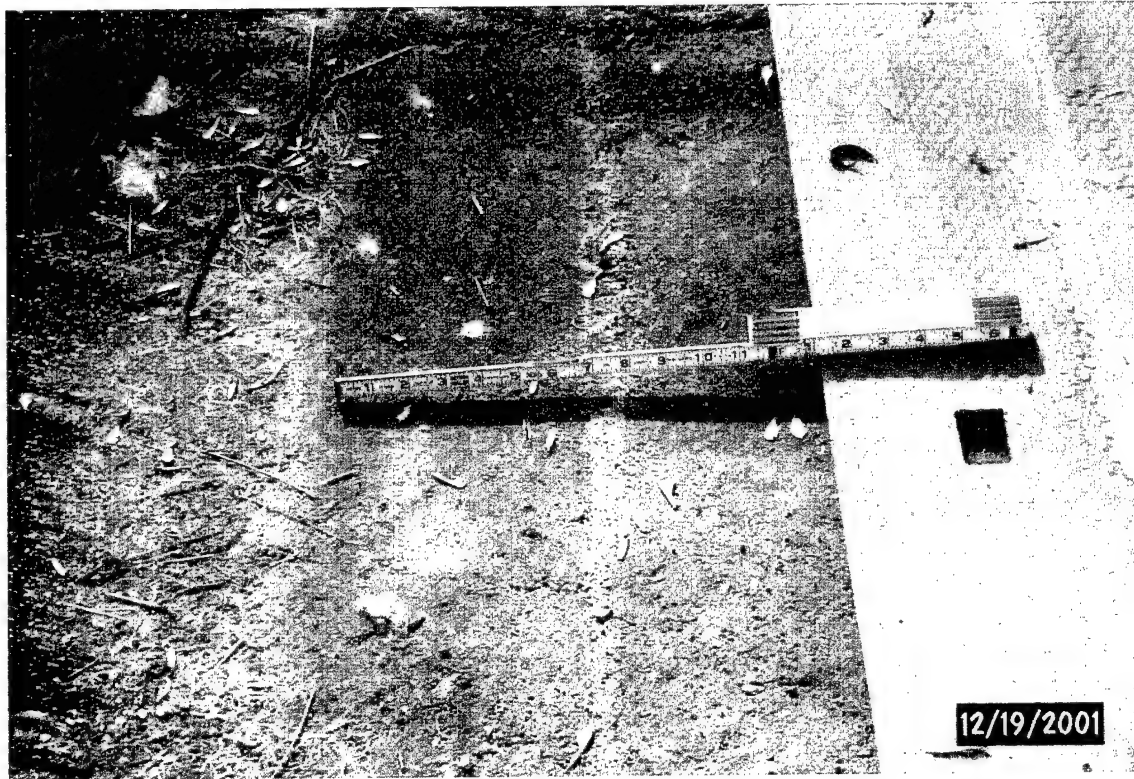


Photo 85. MP mat straight section moved 1 ft toward traffic direction after 500 passes

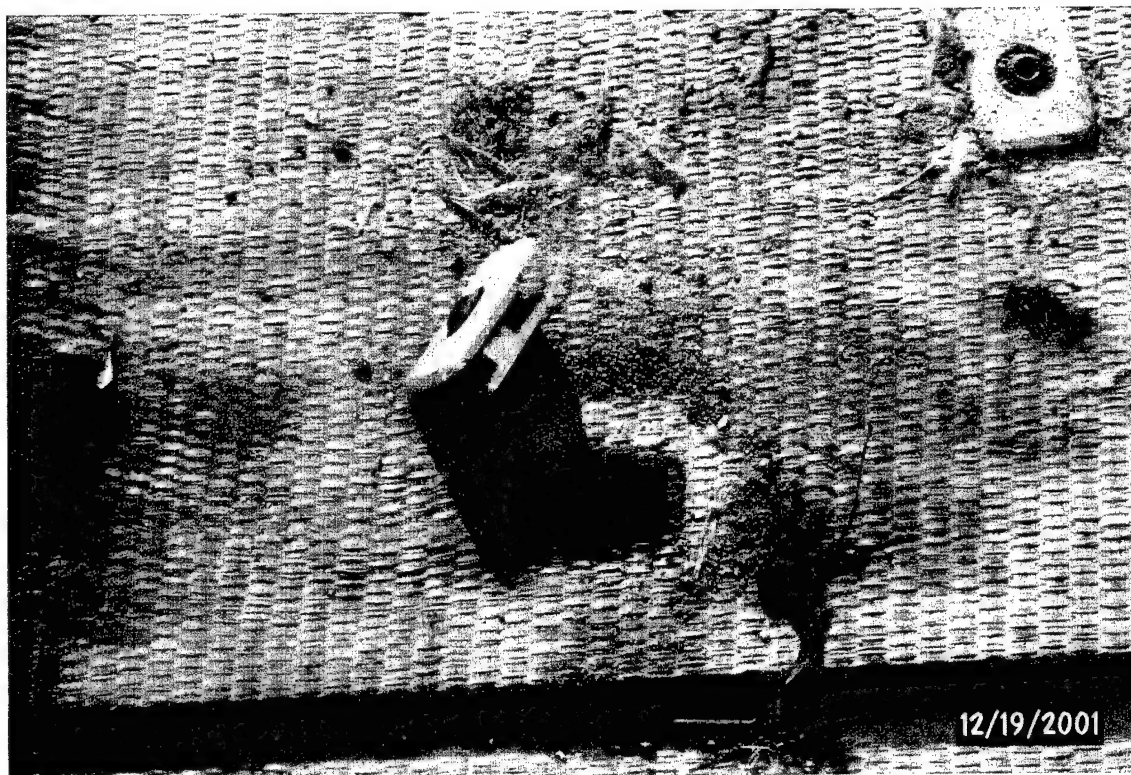


Photo 86. MP mat straight section connector pin loose after 500 passes

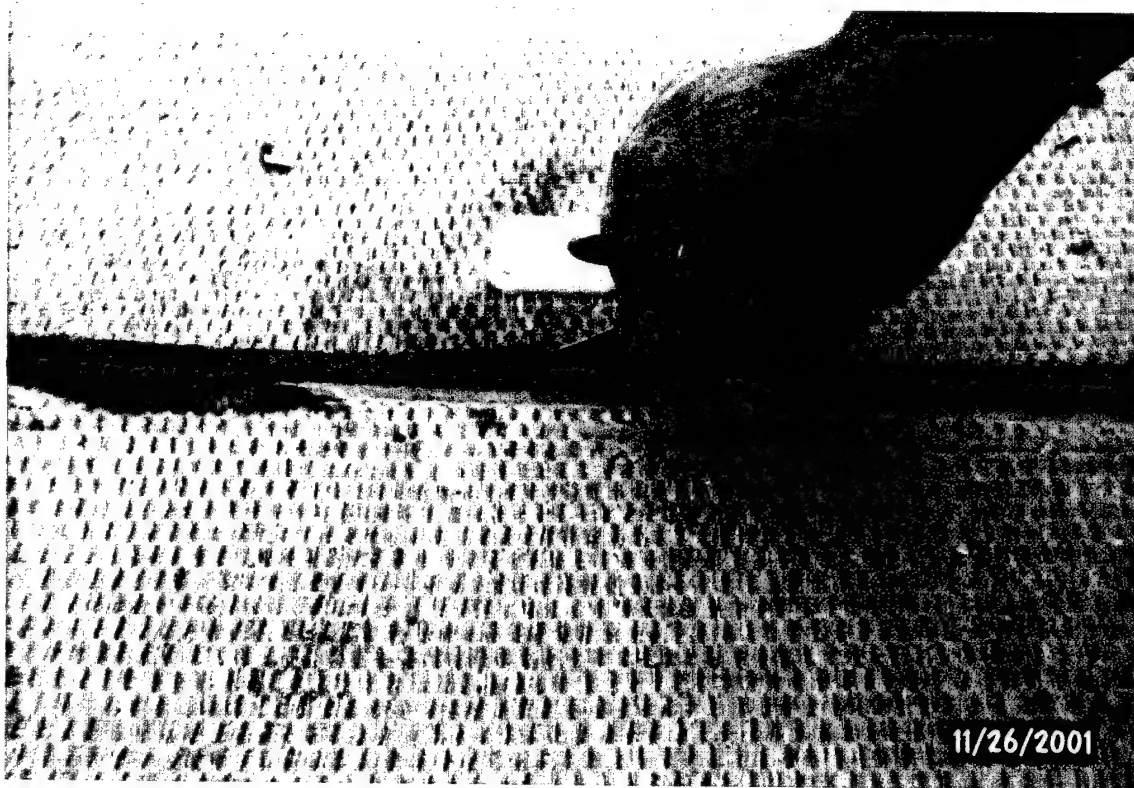


Photo 87. MP mat straight section edge delamination after 165 passes

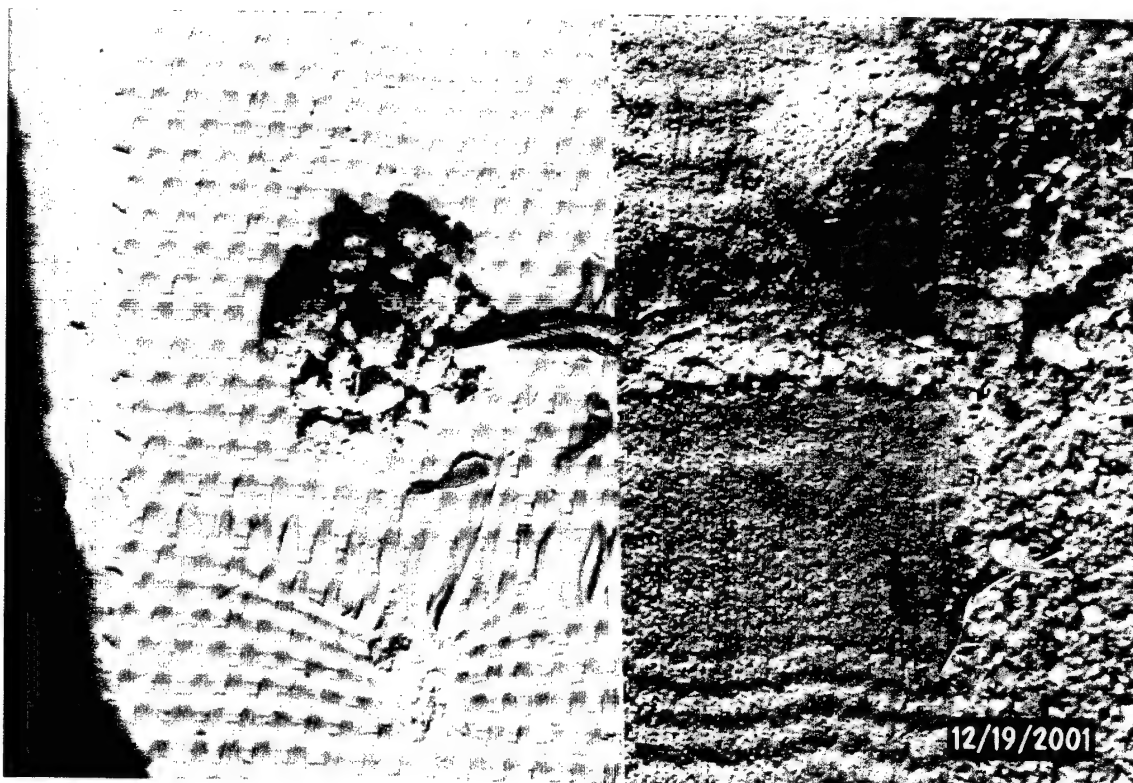


Photo 88. MP mat anchor after stretching the cable after 165 passes

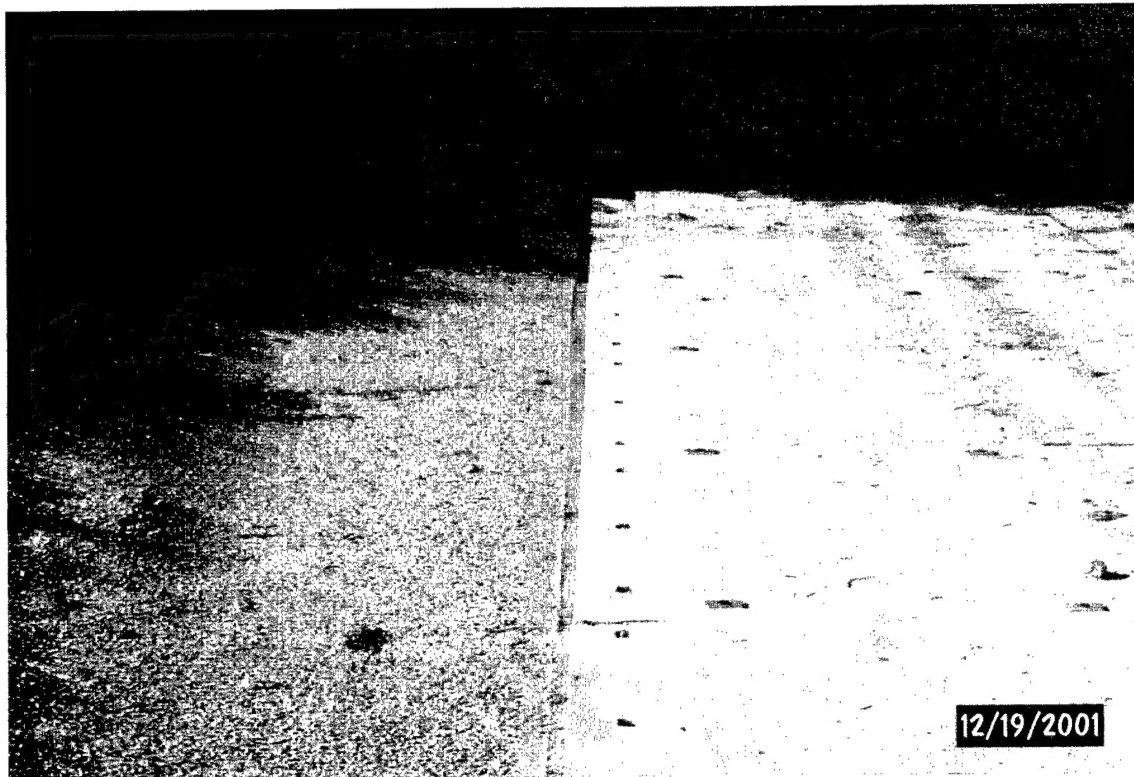


Photo 89. MP mat 50-ft radius curve moved 2 in. toward traffic direction after 500 passes



Photo 90. Allround hexagonal plastic mat bent after 165 passes

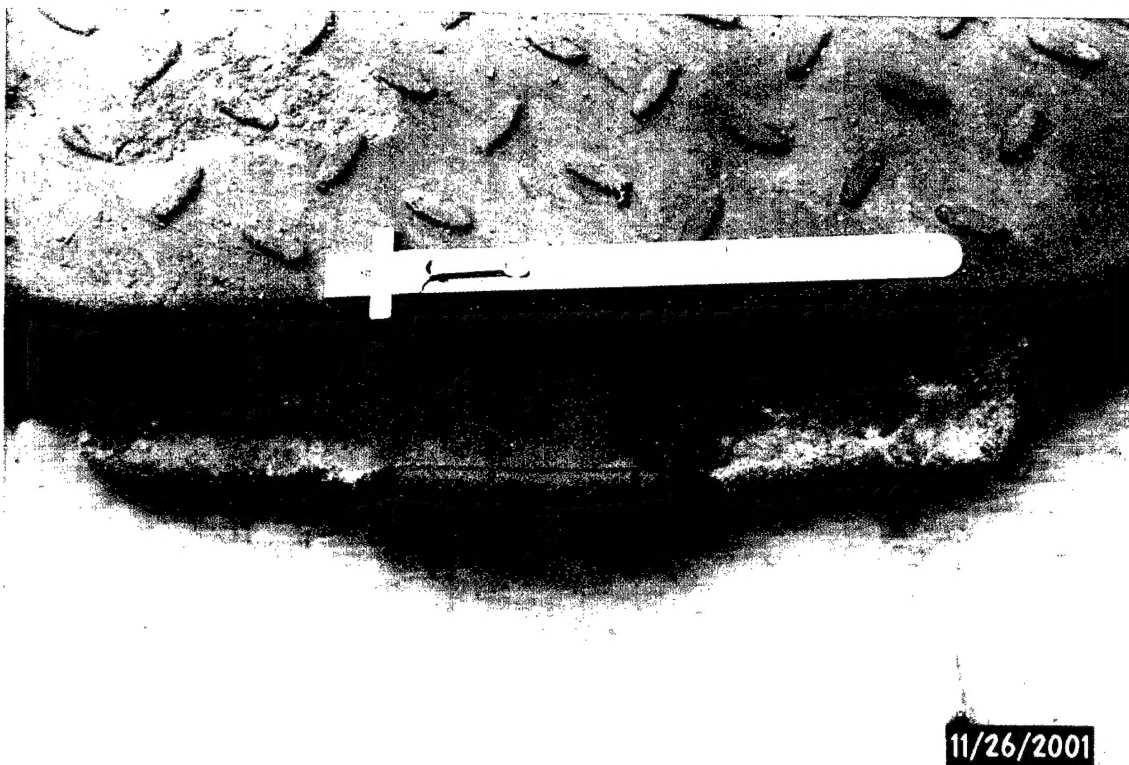


Photo 91. Allround hexagonal plastic mat broke at connector after 165 passes

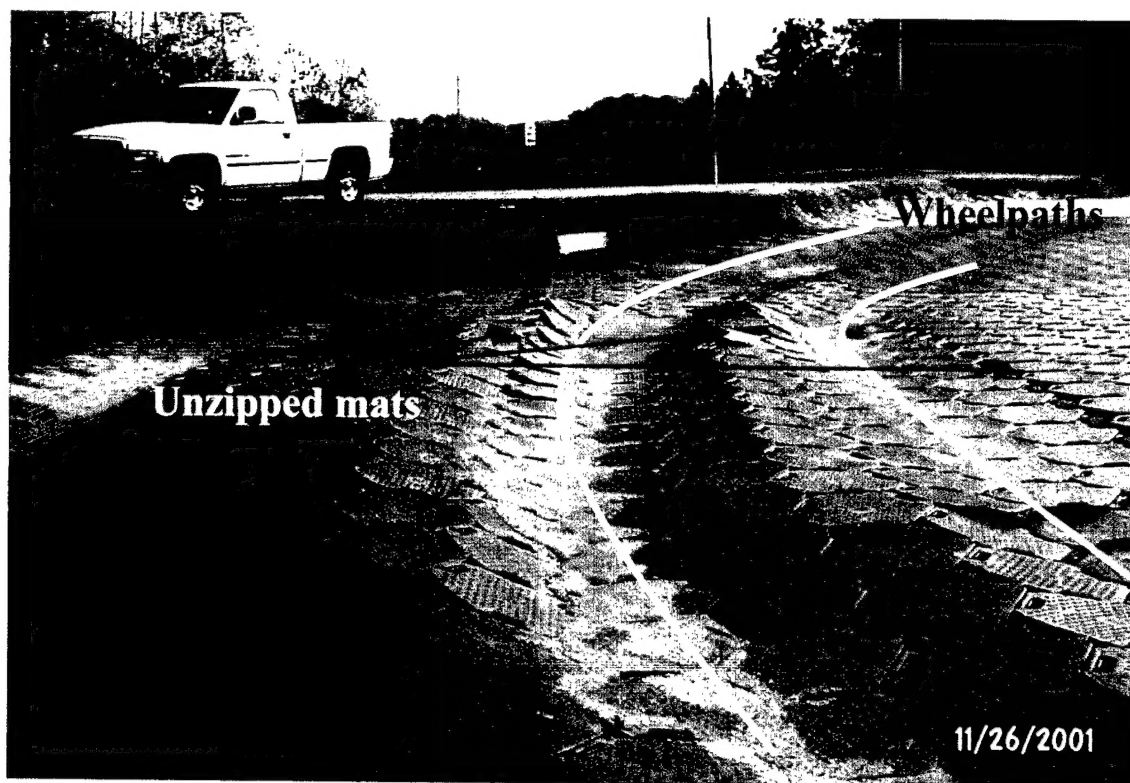


Photo 92. Allround hexagonal mat unzipped after 165 passes



Photo 93. Special hexagonal mat moved 7 in. after 500 passes

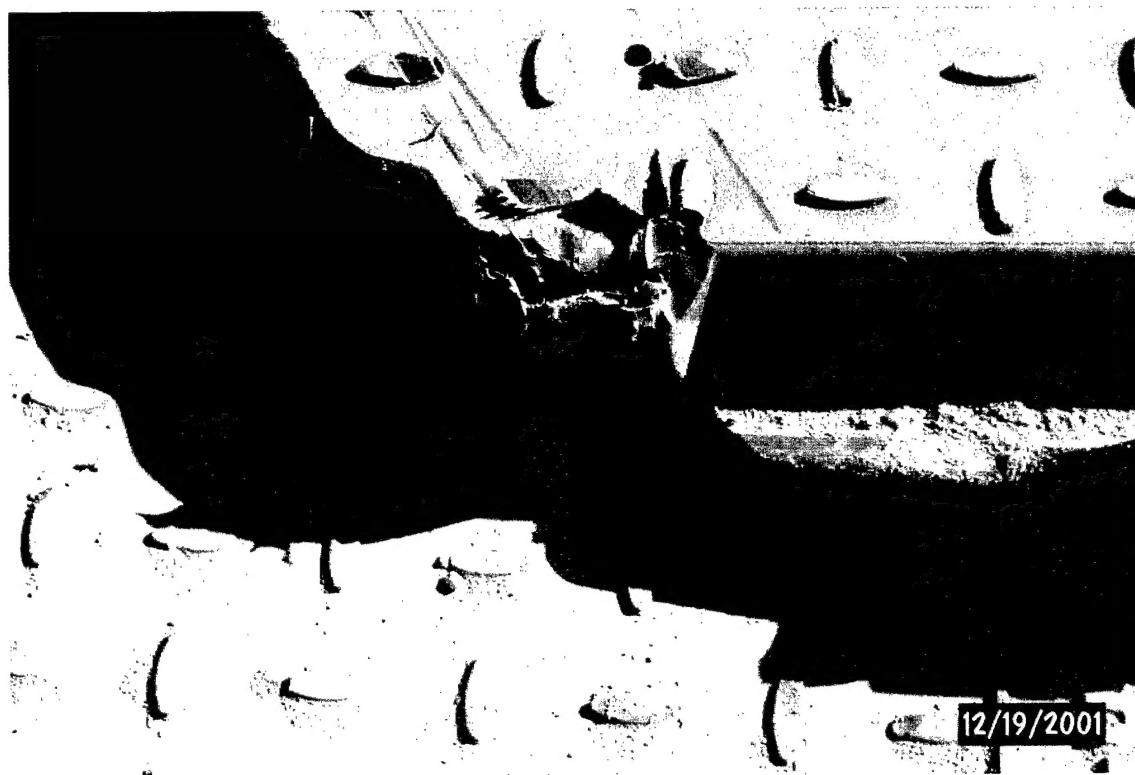


Photo 94. Special hexagonal plastic mat broke at the corner when hit by the truck axle

REPORT DOCUMENTATION PAGEForm Approved
OMB No. 0704-0188

Public reporting burden for this collection of information is estimated to average 1 hour per response, including the time for reviewing instructions, searching existing data sources, gathering and maintaining the data needed, and completing and reviewing this collection of information. Send comments regarding this burden estimate or any other aspect of this collection of information, including suggestions for reducing this burden to Department of Defense, Washington Headquarters Services, Directorate for Information Operations and Reports (0704-0188), 1215 Jefferson Davis Highway, Suite 1204, Arlington, VA 22202-4302. Respondents should be aware that notwithstanding any other provision of law, no person shall be subject to any penalty for failing to comply with a collection of information if it does not display a currently valid OMB control number. **PLEASE DO NOT RETURN YOUR FORM TO THE ABOVE ADDRESS.**

1. REPORT DATE (DD-MM-YYYY) July 2003		2. REPORT TYPE Final report		3. DATES COVERED (From - To)	
4. TITLE AND SUBTITLE Enhanced Coastal Trafficability: Road Construction Over Sandy Soils				5a. CONTRACT NUMBER	
				5b. GRANT NUMBER	
				5c. PROGRAM ELEMENT NUMBER	
6. AUTHOR(S) Rosa L. Santoni				5d. PROJECT NUMBER	
				5e. TASK NUMBER	
				5f. WORK UNIT NUMBER	
7. PERFORMING ORGANIZATION NAME(S) AND ADDRESS(ES) U.S. Army Engineer Research and Development Center Geotechnical and Structures Laboratory 3909 Halls Ferry Road Vicksburg, MS 39180-6199				8. PERFORMING ORGANIZATION REPORT NUMBER ERDC/GSL TR-03-7	
9. SPONSORING / MONITORING AGENCY NAME(S) AND ADDRESS(ES) U.S. Army Corps of Engineers Washington, DC 20314-1000				10. SPONSOR/MONITOR'S ACRONYM(S)	
				11. SPONSOR/MONITOR'S REPORT NUMBER(S)	
12. DISTRIBUTION / AVAILABILITY STATEMENT Approved for public release; distribution is unlimited.					
13. SUPPLEMENTARY NOTES					
14. ABSTRACT This report describes field experiments conducted using Multi-Purpose (MP) mats, hexagonal plastic mats (Allround and Special), and sand-geofiber stabilization for expedient road construction over sandy soils. Field sections were constructed and trafficked to evaluate construction procedures, design parameters, and their performance over loose sand conditions. Experiment items were trafficked with 500 passes of a 41,600-lb, 5-ton military truck. Field experiment results indicated that MP mats and sand-geofiber stabilization are capable of providing structural support to military traffic over sandy soil conditions on straight and curved sections. The Allround and Special hexagonal plastic mats are capable of withstanding limited traffic, but they are unsuitable for supporting substantial amounts of military traffic on curved sections over the very loose sand conditions used in this experiment.					
15. SUBJECT TERMS Contingency pavements Expedient roads		Expedient surfacings Hexagonal plastic mats Logistics-over-the-shore		Multi-purpose mats Road construction	
16. SECURITY CLASSIFICATION OF:			17. LIMITATION OF ABSTRACT	18. NUMBER OF PAGES 111	19a. NAME OF RESPONSIBLE PERSON
a. REPORT UNCLASSIFIED	b. ABSTRACT UNCLASSIFIED	c. THIS PAGE UNCLASSIFIED			19b. TELEPHONE NUMBER (include area code)